

June 28, 2019
File No. 262018.063

Ms. Corina Forson
Chief Hazards Geologist
State of Washington
Department of Natural Resources
Washington Geological Survey
111 Washington Street SE
Olympia, Washington 98504

Mr. Scott Black
Program Development Manager
State of Washington
Office of Superintendent of Public Instruction
600 Washington Street
Olympia, Washington 98504

Subject: Department of Natural Resources Washington Geological Survey,
School Seismic Safety Assessment Project, Contract No. AE 410 -
Seismic Evaluation for **Thorp School District**

Dear Ms. Forson and Mr. Black:

Reid Middleton and our consultant team, under the direction of The Department of Natural Resources (DNR) Washington Geological Survey (WGS) School Seismic Safety Project, have conducted seismic evaluations of 222 school buildings and 5 fire stations throughout Washington State. This letter is transmitting the results of these seismic assessments for each school district that graciously participated in this statewide study. We understand that you will be forwarding this letter and the accompanying seismic screening reports to each school district for their reference and use.

Many disparate studies on improving the seismic safety of our public school buildings have been performed over the last several decades. Experts in building safety, geologic hazards, emergency management, education, and even the news media have been asserting for decades that seismic risks in older public school buildings represent a risk to our communities. The time to act is now, before we have a damaging earthquake and/or tsunami that could be catastrophic. This statewide school seismic safety assessment project provides a unique opportunity to draw attention to the need for statewide seismic safety policies and funding on behalf of all school districts that will help enable school districts to increase the seismic safety of their older buildings to make them safer for students, teachers, staff, parents, and the community.

It is not the intent of this study to create an unfunded mandate for school districts to seismically upgrade their schools without associated funding or statewide seismic safety policy support. The overall goal of this study was to screen and evaluate the current levels of seismic vulnerabilities of a statewide selection of our older public school buildings and to use the data and information to help quantify funding and policy needs to improve the seismic safety of our public schools. In this process, we are using the information to inform not only the Governor and the Legislature of the policy and funding needs for seismically safe schools but also the school districts that participated in the study.

EVERETT
728 134th Street SW
Suite 200
Everett, WA 98204
425 741-3800

www.reidmiddleton.com

School Buildings Evaluated in the Thorp School District

We appreciate Thorp School District's participation and invaluable assistance in this statewide project. The following school district buildings were included as part of this study:

1. Thorp Elementary and Junior Senior High School, Brick Building
2. Thorp Elementary and Junior Senior High School, Thorp Elem/Jr/Sr High School

The seismic screening of these buildings was performed using the American Society of Civil Engineers' Standard 41-17, *Seismic Evaluation and Retrofit of Existing Buildings* (ASCE 41-17), national standard Tier 1 structural and nonstructural seismic screening checklists specific to each building's structure type.

The WGS also conducted seismic site class assessments to measure the shear wave velocity and determine the soil site class at each campus. Site class is an approximation of how much soils at a site will amplify earthquake-induced ground motions and is a critical parameter used in seismic design. Reid Middleton subsequently used this information in their seismic screening analyses.

The following table is a list of available seismic assessment information used in our study:

School Building	Year Constructed	FEMA Building Classification	Structural Drawings Available for Review
Thorp Elementary and Junior Senior High School, Brick Building	1935	Unreinforced Masonry Bearing Walls	Some
Thorp Elementary and Junior Senior High School, Thorp Elem/Jr/Sr High School	1991	Reinforced Masonry Walls with Flexible Diaphragms	Some

Detailed descriptions of the seismic screening evaluations of these buildings can be found in the individual building reports and the ASCE 41-17 Tier 1 screening checklist documents enclosed with this letter. This information will also be available for download on the WGS website: <https://www.dnr.wa.gov/programs-and-services/geology/geologic-hazards/earthquakes-and-faults/school-seismic-safety>.

These Tier 1 seismic screening checklists are often the first step employed by structural engineers when trying to determine the seismic vulnerabilities of existing buildings and to begin a process of mitigating these seismic vulnerabilities. School district facilities management personnel and their design consultants should be able to take advantage of this information to help inform and address seismic risks in existing or future renovation, repair, or modernization projects.

It is important to note that information used for these school seismic screenings was limited to available construction drawings and limited site observations by our team of licensed structural engineers to observe the general conditions and configuration of each building being seismically screened. In many cases, construction drawings were not available for review as noted in the table above. Due to the limited scope of the study, our team of engineers were not able to perform more-detailed investigations above ceilings, behind wall finishes, in confined spaces, or in other areas obstructed from view. Where building component seismic adequacy was unknown due to lack of available information, the unknown conditions were indicated as such on the ASCE 41-17 Tier 1 checklists. Additional field investigations are recommended for the “unknown” seismic evaluation checklist items if more-definitive determinations of seismic safety compliance and further development of seismic mitigation strategies are desired.

Nonstructural Seismic Screening

The enclosed ASCE 41-17 Tier 1 Nonstructural Seismic Screening checklists can provide immediate guidance on seismic deficiencies in nonstructural elements. Mitigating the risk of earthquake impacts from these nonstructural elements should be addressed as soon as practical by school districts. Some nonstructural elements may be easily mitigated by installing seismic bracing of tall cabinets, moving heavy contents to the bottom of shelving, and adding seismic strapping or bracing to water tanks and overhead elements (light fixtures, mechanical units, piping, fire protection systems, etc.).

It is often most economical to mitigate nonstructural seismic hazards when the building is already undergoing mechanical, electrical, plumbing, or architectural upgrades or modernizations. Enclosed with these nonstructural seismic screening checklists are excerpts from the Federal Emergency Management Agency (FEMA) publication E-74 entitled, *Reducing the Risks of Nonstructural Earthquake Damage* (FEMA E-74). We have included these FEMA publication excerpts to help illustrate typical seismic mitigation measures that can potentially be implemented by district facilities and maintenance personnel.

Structural Seismic Screening


The enclosed ASCE 41-17 Tier 1 Structural Seismic Screening checklists have evaluation statements that are reviewed for specific building elements and systems to determine if these items are seismically compliant, noncompliant, not applicable, or unknown. These evaluation statements provide guidance on which structural systems and elements have identified seismic deficiencies and should be investigated further. Further seismic evaluations beyond these seismic screening checklists typically consist of more-detailed seismic structural analyses to better define the seismic vulnerabilities and risks. This information is then used to determine cost-effective ways to seismically improve these buildings with stand-alone seismic upgrade projects or incrementally as part of other ongoing building maintenance, repair, or modernization projects. Consequently, implementing seismic structural mitigation strategies typically requires that they be developed as a part of longer-term capital improvements and modernization programs developed by the school district and their design consultants.

Next Steps

Due to the screening nature of the ASCE 41-17 Tier 1 procedures, an in-depth seismic evaluation and analysis of these buildings may be needed before detailed seismic upgrades or improvements, conceptual designs, and probable construction cost estimates are developed.

If you have any questions or comments regarding the engineering reports or would like to discuss this further, please contact us.

Sincerely,

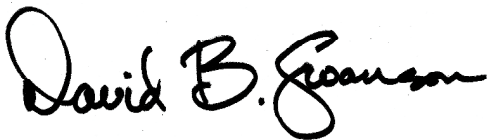

David B. Swanson, P.E., S.E.
Principal, LEED AP, F.SEI




Limitations

The professional services described in this document were performed based on available information and limited visual observation of the structures. No other warranty is made as to the professional advice included in this document. This document has been prepared for the exclusive use of the Department of Natural Resources, the Office of the Superintendent of Public Instruction, and this school district and is not intended for use by other parties, as it may not contain sufficient information for other parties' purposes or their uses.

1. Thorp, Thorp Elementary and Junior Senior High School, Brick Building

1.1 Building Description

Building Name:	Brick Building
Facility Name:	Thorp Elementary and Junior Senior High School
District Name:	Thorp
ICOS Latitude:	47.07
ICOS Longitude:	-120.676
ICOS	
County/District ID:	19400
ICOS Building ID:	21839
ASCE 41 Bldg Type:	URMa
Enrollment:	158
Gross Sq. Ft. :	16,303
Year Built:	1935
Number of Stories:	1
S _{XS} BSE-2E:	0.472
S _{X1} BSE-2E:	0.271
ASCE 41 Level of Seismicity:	High
Site Class:	C
V _{S30} (m/s):	532
Liquefaction	
Potential:	moderate to high
Tsunami Risk:	None
Structural Drawings Available:	Some
Evaluating Firm:	BergerABAM/WSP

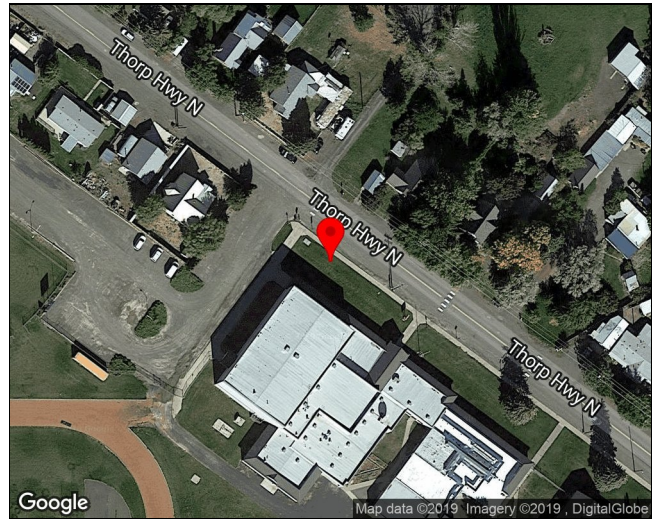

Constructed in the mid 1930s, the Thorp Middle School building is a one-story brick structure (approximate dimensions are 100 ft x 150 ft) with mechanical and storage in a small basement level space. The building has a wood frame floor with a crawl space below. The wood roof trusses were exposed in the gym. Interior faces of walls are "sheathed" in lath and plaster, both the interior face of the exterior masonry walls and each side of interior walls. The ceiling panels are fastened directly to the underside of the wood roof trusses over the classrooms. The building shares the site with the newer 1950 Thorp Elementary School space and the 1991 Thorp High School addition to the 1950 building.

1.1.1 Building Use

The "brick" building constructed in 1935 houses the middle school classrooms and gym. The basement level houses the boiler room/mechanical space and the old locker room space which now serves as storage space. The building is rectangular in plan with the classrooms arranged in a U-shape around a central gym.

1.1.2 Structural System

Table 1.1-1. Structural System Description of Thorp Elementary and Junior Senior High School

Structural System	Description
Structural Roof	According to the limited structural drawing information available, the structural roof over the classrooms and corridors is constructed from 2x rafters over 2x joists, both at 16" on center, with plywood sheathing added in a recent re-roofing project. The structural roof over the middle school gym is constructed with wood trusses at approximately 18 ft on center with 2x10 joists at 16" oc (with plywood sheathing added in a recent re-roofing project). The wood trusses are supported by 10x10 wood posts.
Structural Floor(s)	The structural floor under the classroom and corridors is 2x8 at 16" on center and the structural floor under the gym is 2x10 at 16" on center over a crawl space. The floor joists are supported by beams and posts.
Foundations	The crawl space was not entered on our site visit, but according to the limited drawings available, the foundations at the exterior walls and interior bearing walls are shallow continuous footings. Isolated footings support the beam/post supports for the interior floor framing.
Gravity System	Roof joists are supported on exterior and interior bearing walls and the wood roof trusses are supported on wood posts. The gym walls are masonry with brick veneer and the classrooms "wrap" around the gym and appear to have wood frame walls with brick veneer.
Lateral System	The lateral force resisting system consists of a flexible wood sheathed diaphragm with unreinforced masonry exterior walls, some wood frame exterior walls, and wood frame interior shear walls. Exterior walls have a lath and plaster interior finish and interior wood frame walls have lath and plaster both sides.

1.1.3 Structural System Visual Condition

Table 1.1-2. Structural System Condition Description of Thorp Elementary and Junior Senior High School

Structural System	Description
Structural Roof	Did not observe signs of corrosion, damage or deterioration.
Structural Floor(s)	Did not enter crawl space, condition unknown of structural floor unknown.
Foundations	Unknown
Gravity System	Did not observe signs of corrosion, damage or deterioration.
Lateral System	Did not observe signs of corrosion, damage or deterioration.

1.2 Seismic Evaluation Findings

1.2.1 Structural Seismic Deficiencies

The structural seismic deficiencies identified during the Tier 1 evaluation are summarized below. Commentary for each deficiency is also provided based on this evaluation.

Table 1-3. Identified Structural Seismic Deficiencies for Thorp Thorp Elementary and Junior Senior High School Brick Building

Deficiency	Description
Ties Between Foundation Elements	The footings are not restrained by slabs, further investigation required.
Wall Anchorage	Assumed non-compliant. Further investigation required. Existing drawings were minimal and was unable to verify in the field.
Wood Ledgers	Assumed non-compliant. Further investigation required. Existing drawings were minimal and was unable to verify in the field.
Transfer to Shear Walls	Assumed non-compliant. Further investigation required. Existing drawings were minimal and was unable to verify in the field.
Proportions	Field verification required, estimate $h/t = 16$ which exceeds 13 maximum for one-story building.
Cross Ties	A building of this age is not expected to have cross-ties between diaphragm chords.
Stiffness of Wall Anchors	If wall anchorage is provided, a building of this age is not expected to have taut anchors.

1.2.2 Structural Checklist Items Marked as 'Unknown'

Where building structural component seismic adequacy was unknown due to lack of available information or limited observation, the structural checklist items were marked as “unknown”. These items require further investigation if definitive determination of compliance or noncompliance is desired. The unknown structural checklist items identified during the Tier 1 evaluation are summarized below. Commentary for each unknown item is also provided based on the evaluation.

Table 1-4. Identified Structural Checklist Items Marked as Unknown for Thorp Thorp Elementary and Junior Senior High School Brick Building

Unknown Item	Description
Load Path	Due to building age and fact that limited drawings were available, viable load path between diaphragm, shear walls & foundations is not apparent. Further investigation required.
Soft Story	One-story structure (with small basement area). Crawl space under classrooms and gym should be further investigated.
Liquefaction	The liquefaction potential of site soils is unknown at this time given available information. Moderate to high liquefaction potential is identified per ICOS based on state geologic mapping. Requires further investigation by a licensed geotechnical engineer to determine liquefaction potential.
Slope Failure	Requires further investigation by a licensed geotechnical engineer to determine susceptibility to slope failure. The structure appears to be located on a relatively flat site.
Surface Fault Rupture	Requires further investigation by a licensed geotechnical engineer to determine whether site is near locations of expected surface fault ruptures.
Girder-Column Connection	Further investigation required. Existing drawings were minimal and was unable to verify in the field.
Masonry Layup	Unable to verify, further investigation required.
Beam	Girder, and Truss Supports, Limited existing drawings indicate 10x10 wood post supports at Gym trusses, but connection was not field verified.

1.3.1 Nonstructural Seismic Deficiencies

The nonstructural seismic deficiencies identified during the Tier 1 evaluation are summarized below. Commentary for each deficiency is also provided based on this evaluation. Some nonstructural deficiencies may be able to be mitigated by school district staff. Other nonstructural components that require more substantial mitigation may be more appropriately included in a long-term mitigation strategy. Some typical conceptual details for the seismic upgrade of nonstructural components can be found in the FEMA E-74 Excerpts appendix.

Table 1-5. Identified Nonstructural Seismic Deficiencies for Thorp Thorp Elementary and Junior Senior High School Brick Building

Deficiency	Description
LSS-1 Fire Suppression Piping. HR-not required; LS-LMH; PR-LMH.	No available record drawing information on fire suppression piping and unable to verify during site investigation. Based on year of construction (1930) of the building, it is assumed that seismic bracing for fire suppression piping does not comply with NFPA 13. Further investigation may be appropriate to mitigate seismic risk.
LSS-2 Flexible Couplings. HR-not required; LS-LMH; PR-LMH.	No available record drawing information on fire suppression piping and unable to verify during site investigation. Based on age of the building, it is assumed the flexible couplings on the fire suppression piping do not comply with NFPA 13. Flexible coupling for fire suppression piping may be appropriate to mitigate seismic risk.
M-4 Unreinforced Masonry Backup. HR-LMH; LS-LMH; PR-LMH.	Limited drawings available due to the age of the building, it is likely the backup masonry wall is not reinforced.
M-6 Anchorage. HR-not required; LS-MH; PR-MH.	Due to the age of the building it is assumed the masonry backup wall is unreinforced and the veneer is not positively anchored to the backup wall.
CF-2 Tall Narrow Contents. HR-not required; LS-H; PR-MH.	Basement storage area did not appear to have proper anchorage at cabinets and shelves. Unsecured storage in classroom (prior to start of school) was unbraced and unanchored. Brace tops of shelving taller than 6 feet to nearest backing wall, provide overturning base restraint.
CF-3 Fall-Prone Contents. HR-not required; LS-H; PR-H.	Basement storage area did not appear to have proper anchorage at cabinets and shelves. Unsecured storage in classroom (prior to start of school) was unbraced and unanchored. Heavy items on upper shelves should be restrained by netting or cabling to avoid falling hazards.

1.3.2 Nonstructural Checklist Items Marked as 'Unknown'

Where building nonstructural component seismic adequacy was unknown due to lack of available information or limited observation, the nonstructural checklist items were marked as “unknown”. These items require further investigation if definitive determination of compliance or noncompliance is desired. The unknown nonstructural checklist items identified during the Tier 1 evaluation are summarized below. Commentary for each unknown item is also provided based on the evaluation.

Some nonstructural deficiencies may be able to be mitigated by school district staff. Other nonstructural components that require more substantial mitigation may be more appropriately included in a long-term mitigation strategy. Some typical conceptual details for the seismic upgrade of nonstructural components can be found in the FEMA E-74 Excerpts appendix.

Table 1-6. Identified Nonstructural Checklist Items Marked as Unknown for Thorp Thorp Elementary and Junior Senior High School Brick Building

Unknown Item	Description
LSS-3 Emergency Power. HR-not required; LS-LMH; PR-LMH.	Available record drawings do not have information on anchorage or bracing for emergency power equipment and could not verify during site investigation. Based on age of the building, emergency power equipment is either nonexistent or noncompliant. Evaluation of emergency power equipment may be appropriate to mitigate seismic risk.
LSS-5 Sprinkler Ceiling Clearance. HR-not required; LS-MH; PR-MH.	No available record drawing information on sprinkler head clearance and unable to verify during site investigation. Further evaluation may be appropriate to mitigate seismic risk.
HM-2 Hazardous Material Storage. HR-LMH; LS-LMH; PR-LMH.	Unknown whether the building has hazardous materials. Further investigation may be appropriate to mitigate seismic risk.
HM-4 Shutoff Valves. HR-MH; LS-MH; PR-MH.	It is unknown if there are shutoff valves for piping containing hazardous materials. Further investigation may be appropriate to mitigate seismic risk.
HM-5 Flexible Couplings. HR-LMH; LS-LMH; PR-LMH.	Did not observe any hazardous material ductwork and piping. Further investigation may be appropriate to mitigate seismic risk.
P-3 Drift. HR-not required; LS-MH; PR-MH.	Limited drawings available, but do not believe there are rigid cementitious partitions. Further investigation may be appropriate to mitigate seismic risk.
M-1 Ties. HR-not required; LS-LMH; PR-LMH.	Limited drawings do not indicate connection between veneer and back up studs. Further investigation may be warranted to mitigate seismic risk.
M-3 Weakened Planes. HR-not required; LS-LMH; PR-LMH.	Limited drawings do not include veneer details. Further investigation may be warranted to mitigate seismic risk.
PCOA-4 Appendages. HR-MH; LS-MH; PR-LMH.	No appendages observed. Further investigation may be appropriate to mitigate seismic risk.
MC-1 URM Chimneys. HR-LMH; LS-LMH; PR-LMH.	Chimney reinforcement unknown, likely unreinforced. Chimney dimensions and height are unknown. Further investigation may be appropriate to mitigate seismic risk.
MC-2 Anchorage. HR-LMH; LS-LMH; PR-LMH.	Available drawings do not indicate anchorage at chimney. Further investigation may be appropriate to mitigate seismic risk.
S-1 Stair Enclosures. HR-not required; LS-LMH; PR-LMH.	Concrete walls indicated at stairs to basement. Unclear if wall reinforcement provided. Further investigation may be appropriate to mitigate seismic risk.
S-2 Stair Details. HR-not required; LS-LMH; PR-LMH.	Stair detailing unknown for stair down to basement. Further investigation may be appropriate to mitigate seismic risk.
ME-1 Fall-Prone Equipment. HR-not required; LS-H; PR-H.	Mechanical room equipment appeared to be well stabilized, district should confirm.
ME-2 In-Line Equipment. HR-not required; LS-H; PR-H.	Mechanical room equipment appeared to be well stabilized, district should confirm.

Unknown Item	Description
ME-3 Tall Narrow Equipment. HR-not required; LS-H; PR-MH.	Mechanical room equipment appeared to be well stabilized, district should confirm. Brace tops of tall narrow equipment taller than 6 feet to nearest backing wall, provide overturning base restraint.

Photos:



Figure 1-1. Thorp MS gym - west elevation



Figure 1-2. Thorp MS south elevation



Figure 1-3. Thorp MS hall



Figure 1-4. Thorp MS gym



Figure 1-5. Thorp MS classroom



Figure 1-6. Thorp MS mech'l room



Figure 1-7. Thorp MS storage (old locker room)



Figure 1-8. Thorp MS hazardous storage (old locker room)



Figure 1-9. Thorp MS supply storage (temporary according to district personnel)

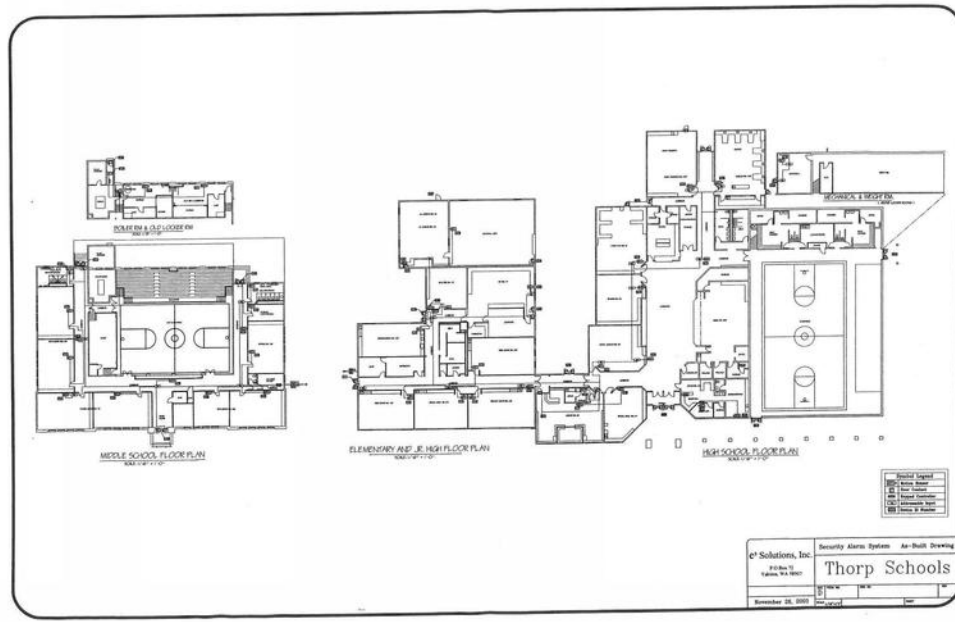


Figure 1-10. Thorp School Floor Plan

Thorp, Thorp Elementary and Junior Senior High School, Brick Building

17-2 Collapse Prevention Basic Configuration Checklist

Building record drawings have been reviewed, when available, and a non-destructive field investigation has been performed for the subject building. Each of the required checklist items are marked Compliant (C), Noncompliant (NC), Not Applicable (N/A), or Unknown (U). Items marked Compliant indicate conditions that satisfy the performance objective, whereas items marked Noncompliant or Unknown indicate conditions that do not. Certain statements might not apply to the building being evaluated.

Low Seismicity

Building System - General

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Load Path	The structure contains a complete, well-defined load path, including structural elements and connections, that serves to transfer the inertial forces associated with the mass of all elements of the building to the foundation. (Tier 2: Sec. 5.4.1.1; Commentary: Sec. A.2.1.10)				X	Due to building age and fact that limited drawings were available, viable load path between diaphragm, shear walls & foundations is not apparent. Further investigation required.
Adjacent Buildings	The clear distance between the building being evaluated and any adjacent building is greater than 0.25% of the height of the shorter building in low seismicity, 0.5% in moderate seismicity, and 1.5% in high seismicity. (Tier 2: Sec. 5.4.1.2; Commentary: Sec. A.2.1.2)	X				Adjacent building is approximately 50 feet away.
Mezzanines	Interior mezzanine levels are braced independently from the main structure or are anchored to the seismic-force-resisting elements of the main structure. (Tier 2: Sec. 5.4.1.3; Commentary: Sec. A.2.1.3)			X		

Building System - Building Configuration

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Weak Story	The sum of the shear strengths of the seismic-force-resisting system in any story in each direction is not less than 80% of the strength in the adjacent story above. (Tier 2: Sec. 5.4.2.1; Commentary: Sec. A.2.2.2)			X		
Soft Story	The stiffness of the seismic-force-resisting system in any story is not less than 70% of the seismic-force-resisting system stiffness in an adjacent story above or less than 80% of the average seismic-force-resisting system stiffness of the three stories above. (Tier 2: Sec. 5.4.2.2; Commentary: Sec. A.2.2.3)				X	One-story structure (with small basement area). Crawl space under classrooms and gym should be further investigated.
Vertical Irregularities	All vertical elements in the seismic-force-resisting system are continuous to the foundation. (Tier 2: Sec. 5.4.2.3; Commentary: Sec. A.2.2.4)	X				

Geometry	There are no changes in the net horizontal dimension of the seismic-force-resisting system of more than 30% in a story relative to adjacent stories, excluding one-story penthouses and mezzanines. (Tier 2: Sec. 5.4.2.4; Commentary: Sec. A.2.2.5)			X		One-story structure (with small basement area).
Mass	There is no change in effective mass of more than 50% from one story to the next. Light roofs, penthouses, and mezzanines need not be considered. (Tier 2: Sec. 5.4.2.5; Commentary: Sec. A.2.2.6)			X		One-story structure (with small basement area).
Torsion	The estimated distance between the story center of mass and the story center of rigidity is less than 20% of the building width in either plan dimension. (Tier 2: Sec. 5.4.2.6; Commentary: Sec. A.2.2.7)	X				The building has flexible diaphragms and a generous layout of shear walls so torsion is not expected to be an issue.

Moderate Seismicity (Complete the Following Items in Addition to the Items for Low Seismicity)

Geologic Site Hazards

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Liquefaction	Liquefaction-susceptible, saturated, loose granular soils that could jeopardize the building's seismic performance do not exist in the foundation soils at depths within 50 ft (15.2 m) under the building. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.1)				X	The liquefaction potential of site soils is unknown at this time given available information. Moderate to high liquefaction potential is identified per ICOS based on state geologic mapping. Requires further investigation by a licensed geotechnical engineer to determine liquefaction potential.
Slope Failure	The building site is located away from potential earthquake-induced slope failures or rockfalls so that it is unaffected by such failures or is capable of accommodating any predicted movements without failure. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.2)				X	Requires further investigation by a licensed geotechnical engineer to determine susceptibility to slope failure. The structure appears to be located on a relatively flat site.
Surface Fault Rupture	Surface fault rupture and surface displacement at the building site are not anticipated. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.3)				X	Requires further investigation by a licensed geotechnical engineer to determine whether site is near locations of expected surface fault ruptures.

High Seismicity (Complete the Following Items in Addition to the Items for Low and Moderate Seismicity)

Foundation Configuration

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Overturning	The ratio of the least horizontal dimension of the seismic-force-resisting system at the foundation level to the building height (base/height) is greater than 0.6Sa. (Tier 2: Sec. 5.4.3.3; Commentary: Sec. A.6.2.1)	X				The ratio of the least horizontal dimension of the seismic force resisting system is 4 which is significantly greater than $0.6S_a = 0.28$.
Ties Between Foundation Elements	The foundation has ties adequate to resist seismic forces where footings, piles, and piers are not restrained by beams, slabs, or soils classified as Site Class A, B, or C. (Tier 2: Sec. 5.4.3.4; Commentary: Sec. A.6.2.2)		X			The footings are not restrained by slabs, further investigation required.

17-36 Collapse Prevention Structural Checklist for Building Types URM and URMa

Building record drawings have been reviewed, when available, and a non-destructive field investigation has been performed for the subject building. Each of the required checklist items are marked Compliant (C), Noncompliant (NC), Not Applicable (N/A), or Unknown (U). Items marked Compliant indicate conditions that satisfy the performance objective, whereas items marked Noncompliant or Unknown indicate conditions that do not. Certain statements might not apply to the building being evaluated.

Low and Moderate Seismicity

Seismic-Force-Resisting System

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Redundancy	The number of lines of shear walls in each principal direction is greater than or equal to 2. (Tier 2: Sec. 5.5.1.1; Commentary: Sec. A.3.2.1.1)	X				The flexible diaphragm will distribute the loads to multiple shear walls in each direction on a tributary area basis.
Shear Stress Check	The shear stress in the unreinforced masonry shear walls, calculated using the Quick Check procedure of Section 4.4.3.3, is less than 30 lb/in. ² (0.21 MPa) for clay units and 70 lb/in. ² (0.48 MPa) for concrete units. (Tier 2: Sec. 5.5.3.1.1; Commentary: Sec. A.3.2.5.1)	X				Calculated shear stress in the unreinforced masonry shear walls is approximately 15 psi which is significantly less than 70 psi according to the Quick Check procedure.

Connections

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Wall Anchorage	Exterior concrete or masonry walls that are dependent on the diaphragm for lateral support are anchored for out-of-plane forces at each diaphragm level with steel anchors, reinforcing dowels, or straps that are developed into the diaphragm. Connections have strength to resist the connection force calculated in the Quick Check procedure of Section 4.4.3.7. (Tier 2: Sec. 5.7.1.1; Commentary: Sec. A.5.1.1)		X			Assumed non-compliant. Further investigation required. Existing drawings were minimal and was unable to verify in the field.
Wood Ledgers	The connection between the wall panels and the diaphragm does not induce cross-grain bending or tension in the wood ledgers. (Tier 2: Sec. 5.7.1.3; Commentary: Sec. A.5.1.2)		X			Assumed non-compliant. Further investigation required. Existing drawings were minimal and was unable to verify in the field.
Transfer to Shear Walls	Diaphragms are connected for transfer of seismic forces to the shear walls. (Tier 2: Sec. 5.7.2; Commentary: Sec. A.5.2.1)		X			Assumed non-compliant. Further investigation required. Existing drawings were minimal and was unable to verify in the field.
Girder-Column Connection	There is a positive connection using plates, connection hardware, or straps between the girder and the column support. (Tier 2: Sec. 5.7.4.1; Commentary: Sec. A.5.4.1)				X	Further investigation required. Existing drawings were minimal and was unable to verify in the field.

High Seismicity (Complete the Following Items in Addition to the Items for Low and Moderate Seismicity)

Seismic-Force-Resisting System

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Proportions	The height-to-thickness ratio of the shear walls at each story is less than the following: Top story of multi-story building – 9; First story of multi-story building – 15; All other conditions – 13. (Tier 2: Sec. 5.5.3.1.2; Commentary: Sec. A.3.2.5.2)		X			Field verification required, estimate $h/t = 16$ which exceeds 13 maximum for one-story building.
Masonry Layup	Filled collar joints of multi-wythe masonry walls have negligible voids. (Tier 2: Sec. 5.5.3.4.1; Commentary: Sec. A.3.2.5.3)				X	Unable to verify, further investigation required.

Diaphragms (Stiff or Flexible)

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Openings at Shear Walls	Diaphragm openings immediately adjacent to the shear walls are less than 25% of the wall length. (Tier 2: Sec. 5.6.1.3; Commentary: Sec. A.4.1.4)			X		One-story building
Openings at Exterior Masonry Shear Walls	Diaphragm openings immediately adjacent to exterior masonry shear walls are not greater than 8 ft (2.4 m) long. (Tier 2: Sec. 5.6.1.3; Commentary: Sec. A.4.1.6)			X		One-story building

Flexible Diaphragms

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Cross Ties	There are continuous cross ties between diaphragm chords. (Tier 2: Sec. 5.6.1.2; Commentary: Sec. A.4.1.2)		X			A building of this age is not expected to have cross-ties between diaphragm chords.
Straight Sheathing	All straight-sheathed diaphragms have aspect ratios less than 2-to-1 in the direction being considered. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.1)	X				Re-roofing project installed plywood sheathing.
Spans	All wood diaphragms with spans greater than 24 ft (7.3 m) consist of wood structural panels or diagonal sheathing. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.2)	X				Re-roofing project installed plywood sheathing.
Diagonally Sheathed and Unblocked Diaphragms	All diagonally sheathed or unblocked wood structural panel diaphragms have horizontal spans less than 40 ft (12.2 m) and aspect ratios less than or equal to 4 to-1. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.3)	X				
Other Diaphragms	The diaphragms do not consist of a system other than wood, metal deck, concrete, or horizontal bracing. (Tier 2: Sec. 5.6.5; Commentary: Sec. A.4.7.1)	X				Wood sheathed diaphragm

Connections

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
-----------------	----------------------	---	----	-----	---	---------

Stiffness of Wall Anchors	Anchors of concrete or masonry walls to wood structural elements are installed taut and are stiff enough to limit the relative movement between the wall and the diaphragm to no greater than 1/8 in. before engagement of the anchors. (Tier 2: Sec. 5.7.1.2; Commentary: Sec. A.5.1.4)		X			If wall anchorage is provided, a building of this age is not expected to have taut anchors.
Beam, Girder, and Truss Supports	Beams, girders, and trusses supported by unreinforced masonry walls or pilasters have independent secondary columns for support of vertical loads. (Tier 2: Sec. 5.7.4.4; Commentary: Sec. A.5.4.5)				X	Limited existing drawings indicate 10x10 wood post supports at Gym trusses, but connection was not field verified.

Thorp, Thorp Elementary and Junior Senior High School, Brick Building

17-38 Nonstructural Checklist

Notes:

C = Compliant, NC = Noncompliant, N/A = Not Applicable, and U = Unknown.

Performance Level: HR = Hazards Reduced, LS = Life Safety, and PR = Position Retention.

Level of Seismicity: L = Low, M = Moderate, and H = High

Life Safety Systems

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
LSS-1 Fire Suppression Piping. HR-not required; LS-LMH; PR-LMH.	Fire suppression piping is anchored and braced in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.1)		X			No available record drawing information on fire suppression piping and unable to verify during site investigation. Based on year of construction (1930) of the building, it is assumed that seismic bracing for fire suppression piping does not comply with NFPA 13. Further investigation may be appropriate to mitigate seismic risk.
LSS-2 Flexible Couplings. HR-not required; LS-LMH; PR-LMH.	Fire suppression piping has flexible couplings in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.2)		X			No available record drawing information on fire suppression piping and unable to verify during site investigation. Based on age of the building, it is assumed the flexible couplings on the fire suppression piping do not comply with NFPA 13. Flexible coupling for fire suppression piping may be appropriate to mitigate seismic risk.

LSS-3 Emergency Power. HR-not required; LS-LMH; PR-LMH.	Equipment used to power or control Life Safety systems is anchored or braced. (Tier 2: Sec. 13.7.7; Commentary: Sec. A.7.12.1)				X	Available record drawings do not have information on anchorage or bracing for emergency power equipment and could not verify during site investigation. Based on age of the building, emergency power equipment is either nonexistent or noncompliant. Evaluation of emergency power equipment may be appropriate to mitigate seismic risk.
LSS-4 Stair and Smoke Ducts. HR-not required; LS-LMH; PR-LMH.	Stair pressurization and smoke control ducts are braced and have flexible connections at seismic joints. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.1)			X		No enclosed stairs.
LSS-5 Sprinkler Ceiling Clearance. HR-not required; LS-MH; PR-MH.	Penetrations through panelized ceilings for fire suppression devices provide clearances in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.3)				X	No available record drawing information on sprinkler head clearance and unable to verify during site investigation. Further evaluation may be appropriate to mitigate seismic risk.
LSS-6 Emergency Lighting. HR-not required; LS-not required; PR-LMH	Emergency and egress lighting equipment is anchored or braced. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.1)			X		Not required for Life Safety Performance Level

Hazardous Materials

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
HM-1 Hazardous Material Equipment. HR-LMH; LS-LMH; PR-LMH.	Equipment mounted on vibration isolators and containing hazardous material is equipped with restraints or snubbers. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.2)			X		Did not observe equipment containing hazardous materials mounted on vibration isolators. Further investigation may be appropriate to mitigate seismic risk.
HM-2 Hazardous Material Storage. HR-LMH; LS-LMH; PR-LMH.	Breakable containers that hold hazardous material, including gas cylinders, are restrained by latched doors, shelf lips, wires, or other methods. (Tier 2: Sec. 13.8.3; Commentary: Sec. A.7.15.1)				X	Unknown whether the building has hazardous materials. Further investigation may be appropriate to mitigate seismic risk.

HM-3 Hazardous Material Distribution. HR-MH; LS-MH; PR-MH.	Piping or ductwork conveying hazardous materials is braced or otherwise protected from damage that would allow hazardous material release. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.4)			X		Did not observe any piping or ductwork conveying hazardous materials.
HM-4 Shutoff Valves. HR-MH; LS-MH; PR-MH.	Piping containing hazardous material, including natural gas, has shutoff valves or other devices to limit spills or leaks. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.3)				X	It is unknown if there are shutoff valves for piping containing hazardous materials. Further investigation may be appropriate to mitigate seismic risk.
HM-5 Flexible Couplings. HR-LMH; LS-LMH; PR-LMH.	Hazardous material ductwork and piping, including natural gas piping, have flexible couplings. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.15.4)				X	Did not observe any hazardous material ductwork and piping. Further investigation may be appropriate to mitigate seismic risk.
HM-6 Piping or Ducts Crossing Seismic Joints. HR-MH; LS-MH; PR-MH.	Piping or ductwork carrying hazardous material that either crosses seismic joints or isolation planes or is connected to independent structures has couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.3, 13.7.5, 13.7.6; Commentary: Sec. A.7.13.6)			X		Building has no seismic joints.

Partitions

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
P-1 Unreinforced Masonry. HR-LMH; LS-LMH; PR-LMH.	Unreinforced masonry or hollow-clay tile partitions are braced at a spacing of at most 10 ft (3.0 m) in Low or Moderate Seismicity, or at most 6 ft (1.8 m) in High Seismicity. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.1)			X		Limited drawings available, but do not believe there are URM partitions. Exterior walls are likely URM.
P-2 Heavy Partitions Supported by Ceilings. HR-LMH; LS-LMH; PR-LMH.	The tops of masonry or hollow-clay tile partitions are not laterally supported by an integrated ceiling system. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.2.1)			X		Limited structural drawings available do not indicate interior masonry partitions.
P-3 Drift. HR-not required; LS-MH; PR-MH.	Rigid cementitious partitions are detailed to accommodate the following drift ratios: in steel moment frame, concrete moment frame, and wood frame buildings, 0.02; in other buildings, 0.005. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.2)				X	Limited drawings available, but do not believe there are rigid cementitious partitions. Further investigation may be appropriate to mitigate seismic risk.
P-4 Light Partitions Supported by Ceilings. HR-not required; LS-not required; PR-MH.	The tops of gypsum board partitions are not laterally supported by an integrated ceiling system. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.2.1)			X		Not required for life safety performance level.

P-5 Structural Separations. HR-not required; LS-not required; PR-MH.	Partitions that cross structural separations have seismic or control joints. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.3)			X		Not required for life safety performance level.
P-6 Tops. HR-not required; LS-not required; PR-MH.	The tops of ceiling-high framed or panelized partitions have lateral bracing to the structure at a spacing equal to or less than 6 ft (1.8 m). (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.4)			X		Not required for Life Safety Performance Level

Ceilings

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
C-1 Suspended Lath and Plaster. HR-H; LS-MH; PR-LMH.	Suspended lath and plaster ceilings have attachments that resist seismic forces for every 12 ft ² (1.1 m ²) of area. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.3)			X		No suspended lath and plaster ceilings observed.
C-2 Suspended Gypsum Board. HR-not required; LS-MH; PR-LMH.	Suspended gypsum board ceilings have attachments that resist seismic forces for every 12 ft ² (1.1 m ²) of area. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.3)			X		Gypsum board ceilings are fastened directly to the underside of the wood joists/trusses.
C-3 Integrated Ceilings. HR-not required; LS-not required; PR-MH.	Integrated suspended ceilings with continuous areas greater than 144 ft ² (13.4 m ²) and ceilings of smaller areas that are not surrounded by restraining partitions are laterally restrained at a spacing no greater than 12 ft (3.6 m) with members attached to the structure above. Each restraint location has a minimum of four diagonal wires and compression struts, or diagonal members capable of resisting compression. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.2)			X		Not required for life safety performance level.
C-4 Edge Clearance. HR-not required; LS-not required; PR-MH.	The free edges of integrated suspended ceilings with continuous areas greater than 144 ft ² (13.4 m ²) have clearances from the enclosing wall or partition of at least the following: in Moderate Seismicity, 1/2 in. (13 mm); in High Seismicity, 3/4 in. (19 mm). (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.4)			X		Not required for life safety performance level.
C-5 Continuity Across Structure Joints. HR-not required; LS-not required; PR-MH.	The ceiling system does not cross any seismic joint and is not attached to multiple independent structures. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.5)			X		Not required for life safety performance level.
C-6 Edge Support. HR-not required; LS-not required; PR-H.	The free edges of integrated suspended ceilings with continuous areas greater than 144 ft ² (13.4 m ²) are supported by closure angles or channels not less than 2 in. (51 mm) wide. (Tier 2: Sec. 13.6.4 ; Commentary: Sec. A.7.2.6)			X		Not required for Life Safety Performance Level

C-7 Seismic Joints. HR-not required; LS-not required; PR-H.	Acoustical tile or lay-in panel ceilings have seismic separation joints such that each continuous portion of the ceiling is no more than 2,500 ft ² (232.3 m ²) and has a ratio of long-to-short dimension no more than 4-to-1. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.7)			X		Not required for life safety performance level.
---	--	--	--	---	--	---

Light Fixtures

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
LF-1 Independent Support. HR-not required; LS-MH; PR-MH.	Light fixtures that weigh more per square foot than the ceiling they penetrate are supported independent of the grid ceiling suspension system by a minimum of two wires at diagonally opposite corners of each fixture. (Tier 2: Sec. 13.6.4, 13.7.9; Commentary: Sec. A.7.3.2)			X		Lights are pendant style.
LF-2 Pendant Supports. HR-not required; LS-not required; PR-H.	Light fixtures on pendant supports are attached at a spacing equal to or less than 6 ft. Unbraced suspended fixtures are free to allow a 360-degree range of motion at an angle not less than 45 degrees from horizontal without contacting adjacent components. Alternatively, if rigidly supported and/or braced, they are free to move with the structure to which they are attached without damaging adjoining components. Additionally, the connection to the structure is capable of accommodating the movement without failure. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.3)			X		Not required for life safety performance level.
LF-3 Lens Covers. HR-not required; LS-not required; PR-H.	Lens covers on light fixtures are attached with safety devices. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.4)			X		Not required for Life Safety Performance Level

Cladding and Glazing

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
CG-1 Cladding Anchors. HR-MH; LS-MH; PR-MH.	Cladding components weighing more than 10 lb/ft ² (0.48 kN/m ²) are mechanically anchored to the structure at a spacing equal to or less than the following: for Life Safety in Moderate Seismicity, 6 ft (1.8 m); for Life Safety in High Seismicity and for Position Retention in any seismicity, 4 ft (1.2 m) (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.1)			X		The building does not have any exterior cladding components.

CG-2 Cladding Isolation. HR-not required; LS-MH; PR-MH.	For steel or concrete moment-frame buildings, panel connections are detailed to accommodate a story drift ratio by the use of rods attached to framing with oversize holes or slotted holes of at least the following: for Life Safety in Moderate Seismicity, 0.01; for Life Safety in High Seismicity and for Position Retention in any seismicity, 0.02, and the rods have a length-to-diameter ratio of 4.0 or less. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.3)			X		The building does not have any exterior cladding components.
CG-3 Multi-Story Panels. HR-MH; LS-MH; PR-MH.	For multi-story panels attached at more than one floor level, panel connections are detailed to accommodate a story drift ratio by the use of rods attached to framing with oversize holes or slotted holes of at least the following: for Life Safety in Moderate Seismicity, 0.01; for Life Safety in High Seismicity and for Position Retention in any seismicity, 0.02, and the rods have a length-to-diameter ratio of 4.0 or less. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.4)			X		The building does not have any exterior cladding components.
CG-4 Threaded Rods. HR-not required; LS-MH; PR-MH.	Threaded rods for panel connections detailed to accommodate drift by bending of the rod have a length-to-diameter ratio greater than 0.06 times the story height in inches for Life Safety in Moderate Seismicity and 0.12 times the story height in inches for Life Safety in High Seismicity and Position Retention in any seismicity. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.9)			X		The building does not have any exterior cladding components.
CG-5 Panel Connections. HR-MH; LS-MH; PR-MH.	Cladding panels are anchored out of plane with a minimum number of connections for each wall panel, as follows: for Life Safety in Moderate Seismicity, 2 connections; for Life Safety in High Seismicity and for Position Retention in any seismicity, 4 connections. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.5)			X		The building does not have any exterior cladding components.
CG-6 Bearing Connections. HR-MH; LS-MH; PR-MH.	Where bearing connections are used, there is a minimum of two bearing connections for each cladding panel. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.6)			X		The building does not have any exterior cladding components.
CG-7 Inserts. HR-MH; LS-MH; PR-MH.	Where concrete cladding components use inserts, the inserts have positive anchorage or are anchored to reinforcing steel. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.7)			X		The building does not have any exterior cladding components.

CG-8 Overhead Glazing. HR-not required; LS-MH; PR-MH.	Glazing panes of any size in curtain walls and individual interior or exterior panes more than 16 ft ² (1.5 m ²) in area are laminated annealed or laminated heat-strengthened glass and are detailed to remain in the frame when cracked. (Tier 2: Sec. 13.6.1.5; Commentary: Sec. A.7.4.8)			X		The building does not have any glazing panes.
--	---	--	--	---	--	---

Masonry Veneer

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
M-1 Ties. HR-not required; LS-LMH; PR-LMH.	Masonry veneer is connected to the backup with corrosion-resistant ties. There is a minimum of one tie for every 2-2/3 ft ² (0.25 m ²), and the ties have spacing no greater than the following: for Life Safety in Low or Moderate Seismicity, 36 in. (914 mm); for Life Safety in High Seismicity and for Position Retention in any seismicity, 24 in. (610 mm). (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.1)				X	Limited drawings do not indicate connection between veneer and back up studs. Further investigation may be warranted to mitigate seismic risk.
M-2 Shelf Angles. HR-not required; LS-LMH; PR-LMH.	Masonry veneer is supported by shelf angles or other elements at each floor above the ground floor. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.2)			X		One-story building. Limited drawings do not include details for veneer over window and door openings.
M-3 Weakened Planes. HR-not required; LS-LMH; PR-LMH.	Masonry veneer is anchored to the backup adjacent to weakened planes, such as at the locations of flashing. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.3)				X	Limited drawings do not include veneer details. Further investigation may be warranted to mitigate seismic risk.
M-4 Unreinforced Masonry Backup. HR-LMH; LS-LMH; PR-LMH.	There is no unreinforced masonry backup. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.7.2)		X			Limited drawings available due to the age of the building, it is likely the backup masonry wall is not reinforced.
M-5 Stud Tracks. HR-not required; LS-MH; PR-MH.	For veneer with coldformed steel stud backup, stud tracks are fastened to the structure at a spacing equal to or less than 24 in. (610 mm) on center. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.6.)			X		No cold formed steel stud backup at veneer.
M-6 Anchorage. HR-not required; LS-MH; PR-MH.	For veneer with concrete block or masonry backup, the backup is positively anchored to the structure at a horizontal spacing equal to or less than 4 ft along the floors and roof. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.7.1)		X			Due to the age of the building it is assumed the masonry backup wall is unreinforced and the veneer is not positively anchored to the backup wall.
M-7 Weep Holes. HR-not required; LS-not required; PR-MH.	In veneer anchored to stud walls, the veneer has functioning weep holes and base flashing. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.6)			X		Not required for Life Safety Performance Level

M-8 Openings. HR-not required; LS-not required; PR-MH.	For veneer with cold-formed-steel stud backup, steel studs frame window and door openings. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.6.2)			X		Not required for Life Safety Performance Level
--	--	--	--	---	--	--

Parapets, Cornices, Ornamentation, and Appendages

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
PCOA-1 URM Parapets or Cornices. HR-LMH; LS-LMH; PR-LMH.	Laterally unsupported unreinforced masonry parapets or cornices have height-to-thickness ratios no greater than the following: for Life Safety in Low or Moderate Seismicity, 2.5; for Life Safety in High Seismicity and for Position Retention in any seismicity, 1.5. (Tier 2: Sec. 13.6.5; Commentary: Sec. A.7.8.1)			X		No URM parapets or cornices.
PCOA-2 Canopies. HR-not required; LS-LMH; PR-LMH.	Canopies at building exits are anchored to the structure at a spacing no greater than the following: for Life Safety in Low or Moderate Seismicity, 10 ft (3.0 m); for Life Safety in High Seismicity and for Position Retention in any seismicity, 6 ft (1.8 m). (Tier 2: Sec. 13.6.6; Commentary: Sec. A.7.8.2)	X				Canopies appear to be well anchored.
PCOA-3 Concrete Parapets. HR-H; LS-MH; PR-LMH.	Concrete parapets with height-to-thickness ratios greater than 2.5 have vertical reinforcement. (Tier 2: Sec. 13.6.5; Commentary: Sec. A.7.8.3)			X		No concrete parapets.
PCOA-4 Appendages. HR-MH; LS-MH; PR-LMH.	Cornices, parapets, signs, and other ornamentation or appendages that extend above the highest point of anchorage to the structure or cantilever from components are reinforced and anchored to the structural system at a spacing equal to or less than 6 ft (1.8 m). This evaluation statement item does not apply to parapets or cornices covered by other evaluation statements. (Tier 2: Sec. 13.6.6; Commentary: Sec. A.7.8.4)				X	No appendages observed. Further investigation may be appropriate to mitigate seismic risk.

Masonry Chimneys

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
MC-1 URM Chimneys. HR-LMH; LS-LMH; PR-LMH.	Unreinforced masonry chimneys extend above the roof surface no more than the following: for Life Safety in Low or Moderate Seismicity, 3 times the least dimension of the chimney; for Life Safety in High Seismicity and for Position Retention in any seismicity, 2 times the least dimension of the chimney. (Tier 2: Sec. 13.6.7; Commentary: Sec. A.7.9.1)				X	Chimney reinforcement unknown, likely unreinforced. Chimney dimensions and height are unknown. Further investigation may be appropriate to mitigate seismic risk.

MC-2 Anchorage. HR-LMH; LS-LMH; PR-LMH.	Masonry chimneys are anchored at each floor level, at the topmost ceiling level, and at the roof. (Tier 2: Sec. 13.6.7; Commentary: Sec. A.7.9.2)				X	Available drawings do not indicate anchorage at chimney. Further investigation may be appropriate to mitigate seismic risk.
---	---	--	--	--	---	---

Stairs

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
S-1 Stair Enclosures. HR-not required; LS-LMH; PR-LMH.	Hollow-clay tile or unreinforced masonry walls around stair enclosures are restrained out of plane and have height-to-thickness ratios not greater than the following: for Life Safety in Low or Moderate Seismicity, 15-to-1; for Life Safety in High Seismicity and for Position Retention in any seismicity, 12-to-1. (Tier 2: Sec. 13.6.2, 13.6.8; Commentary: Sec. A.7.10.1)				X	Concrete walls indicated at stairs to basement. Unclear if wall reinforcement provided. Further investigation may be appropriate to mitigate seismic risk.
S-2 Stair Details. HR-not required; LS-LMH; PR-LMH.	The connection between the stairs and the structure does not rely on post-installed anchors in concrete or masonry, and the stair details are capable of accommodating the drift calculated using the Quick Check procedure of Section 4.4.3.1 for moment-frame structures or 0.5 in. for all other structures without including any lateral stiffness contribution from the stairs. (Tier 2: Sec. 13.6.8; Commentary: Sec. A.7.10.2)				X	Stair detailing unknown for stair down to basement. Further investigation may be appropriate to mitigate seismic risk.

Contents and Furnishings

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
CF-1 Industrial Storage Racks. HR-LMH; LS-MH; PR-MH.	Industrial storage racks or pallet racks more than 12 ft high meet the requirements of ANSI/RMI MH 16.1 as modified by ASCE 7, Chapter 15. (Tier 2: Sec. 13.8.1; Commentary: Sec. A.7.11.1)			X		Does not appear that there are any industrial storage racks taller than 12 feet in the building.
CF-2 Tall Narrow Contents. HR-not required; LS-H; PR-MH.	Contents more than 6 ft (1.8 m) high with a height-to-depth or height-to-width ratio greater than 3-to-1 are anchored to the structure or to each other. (Tier 2: Sec. 13.8.2; Commentary: Sec. A.7.11.2)		X			Basement storage area did not appear to have proper anchorage at cabinets and shelves. Unsecured storage in classroom (prior to start of school) was unbraced and unanchored. Brace tops of shelving taller than 6 feet to nearest backing wall, provide overturning base restraint.

CF-3 Fall-Prone Contents. HR-not required; LS-H; PR-H.	Equipment, stored items, or other contents weighing more than 20 lb (9.1 kg) whose center of mass is more than 4 ft (1.2 m) above the adjacent floor level are braced or otherwise restrained. (Tier 2: Sec. 13.8.2; Commentary: Sec. A.7.11.3)		X			Basement storage area did not appear to have proper anchorage at cabinets and shelves. Unsecured storage in classroom (prior to start of school) was unbraced and unanchored. Heavy items on upper shelves should be restrained by netting or cabling to avoid falling hazards.
CF-4 Access Floors. HR-not required; LS-not required; PR-MH.	Access floors more than 9 in. (229 mm) high are braced. (Tier 2: Sec. 13.6.10; Commentary: Sec. A.7.11.4)			X		Not required for life safety performance level.
CF-5 Equipment on Access Floors. HR-not required; LS-not required; PR-MH.	Equipment and other contents supported by access floor systems are anchored or braced to the structure independent of the access floor. (Tier 2: Sec. 13.7.7 13.6.10; Commentary: Sec. A.7.11.5)			X		Not required for life safety performance level.
CF-6 Suspended Contents. HR-not required; LS-not required; PR-H.	Items suspended without lateral bracing are free to swing from or move with the structure from which they are suspended without damaging themselves or adjoining components. (Tier 2: Sec. 13.8.2; Commentary: Sec. A.7.11.6)			X		Not required for life safety performance level.

Mechanical and Electrical Equipment

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
ME-1 Fall-Prone Equipment. HR-not required; LS-H; PR-H.	Equipment weighing more than 20 lb (9.1 kg) whose center of mass is more than 4 ft (1.2 m) above the adjacent floor level, and which is not in-line equipment, is braced. (Tier 2: Sec. 13.7.1 13.7.7; Commentary: Sec. A.7.12.4)				X	Mechanical room equipment appeared to be well stabilized, district should confirm.
ME-2 In-Line Equipment. HR-not required; LS-H; PR-H.	Equipment installed in line with a duct or piping system, with an operating weight more than 75 lb (34.0 kg), is supported and laterally braced independent of the duct or piping system. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.5)				X	Mechanical room equipment appeared to be well stabilized, district should confirm.
ME-3 Tall Narrow Equipment. HR-not required; LS-H; PR-MH.	Equipment more than 6 ft (1.8 m) high with a height-to-depth or height-to-width ratio greater than 3-to-1 is anchored to the floor slab or adjacent structural walls. (Tier 2: Sec. 13.7.1 13.7.7; Commentary: Sec. A.7.12.6)				X	Mechanical room equipment appeared to be well stabilized, district should confirm. Brace tops of tall narrow equipment taller than 6 feet to nearest backing wall, provide overturning base restraint.
ME-4 Mechanical Doors. HR-not required; LS-not required; PR-MH.	Mechanically operated doors are detailed to operate at a story drift ratio of 0.01. (Tier 2: Sec. 13.6.9; Commentary: Sec. A.7.12.7)			X		Not required for life safety performance level.

ME-5 Suspended Equipment. HR-not required; LS-not required; PR-H.	Equipment suspended without lateral bracing is free to swing from or move with the structure from which it is suspended without damaging itself or adjoining components. (Tier 2: Sec. 13.7.1, 13.7.7; Commentary: Sec. A.7.12.8)			X		Not required for life safety performance level.
ME-6 Vibration Isolators. HR-not required; LS-not required; PR-H.	Equipment mounted on vibration isolators is equipped with horizontal restraints or snubbers and with vertical restraints to resist overturning. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.9)			X		Not required for life safety performance level.
ME-7 Heavy Equipment. HR-not required; LS-not required; PR-H.	Floor supported or platform-supported equipment weighing more than 400 lb (181.4 kg) is anchored to the structure. (Tier 2: Sec. 13.7.1, 13.7.7; Commentary: Sec. A.7.12.10)			X		Not required for life safety performance level.
ME-8 Electrical Equipment. HR-not required; LS-not required; PR-H.	Electrical equipment is laterally braced to the structure. (Tier 2: Sec. 13.7.7; Commentary: Sec. A.7.12.11)			X		Not required for life safety performance level.
ME-9 Conduit Couplings. HR-not required; LS-not required; PR-H.	Conduit greater than 2.5 in. (64 mm) trade size that is attached to panels, cabinets, or other equipment and is subject to relative seismic displacement has flexible couplings or connections. (Tier 2: Sec. 13.7.8; Commentary: Sec. A.7.12.12)			X		Not required for life safety performance level.

Piping

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
PP-1 Flexible Couplings. HR-not required; LS-not required; PR-H.	Fluid and gas piping has flexible couplings. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.2)			X		Not required for life safety performance level.
PP-2 Fluid and Gas Piping. HR-not required; LS-not required; PR-H.	Fluid and gas piping is anchored and braced to the structure to limit spills or leaks. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.4)			X		Not required for life safety performance level.
PP-3 C-Clamps. HR-not required; LS-not required; PR-H.	One-sided C-clamps that support piping larger than 2.5 in. (64 mm) in diameter are restrained. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.5)			X		Not required for Life Safety Performance Level
PP-4 Piping Crossing Seismic Joints. HR-not required; LS-not required; PR-H.	Piping that crosses seismic joints or isolation planes or is connected to independent structures has couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.6)			X		Not required for life safety performance level.

Ducts

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
D-1 Duct Bracing. HR-not required; LS-not required; PR-H.	Rectangular ductwork larger than 6 ft ² (0.56 m ²) in cross-sectional area and round ducts larger than 28 in. (711 mm) in diameter are braced. The maximum spacing of transverse bracing does not exceed 30 ft (9.2 m). The maximum spacing of longitudinal bracing does not exceed 60 ft (18.3 m). (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.2)			X		Not required for Life Safety Performance Level
D-2 Duct Support. HR-not required; LS-not required; PR-H.	Ducts are not supported by piping or electrical conduit. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.3)			X		Not required for Life Safety Performance Level
D-3 Ducts Crossing Seismic Joints. HR-not required; LS-not required; PR-H.	Ducts that cross seismic joints or isolation planes or are connected to independent structures have couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.4)			X		Not required for life safety performance level.

Elevators


EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
EL-1 Retainer Guards. HR-not required; LS-H; PR-H.	Sheaves and drums have cable retainer guards. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.1)			X		No elevator in building.
EL-2 Retainer Plate. HR-not required; LS-H; PR-H.	A retainer plate is present at the top and bottom of both car and counterweight. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.2)			X		No elevator in building.
EL-3 Elevator Equipment. HR-not required; LS-not required; PR-H.	Equipment, piping, and other components that are part of the elevator system are anchored. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.3)			X		Not required for life safety performance level.
EL-4 Seismic Switch. HR-not required; LS-not required; PR-H.	Elevators capable of operating at speeds of 150 ft/min or faster are equipped with seismic switches that meet the requirements of ASME A17.1 or have trigger levels set to 20% of the acceleration of gravity at the base of the structure and 50% of the acceleration of gravity in other locations. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.4)			X		Not required for life safety performance level.
EL-5 Shaft Walls. HR-not required; LS-not required; PR-H.	Elevator shaft walls are anchored and reinforced to prevent toppling into the shaft during strong shaking. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.5)			X		Not required for Life Safety Performance Level
EL-6 Counterweight Rails. HR-not required; LS-not required; PR-H.	All counterweight rails and divider beams are sized in accordance with ASME A17.1. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.6)			X		Not required for life safety performance level.

EL-7 Brackets. HR-not required; LS-not required; PR-H.	The brackets that tie the car rails and the counterweight rail to the structure are sized in accordance with ASME A17.1. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.7)			X		Not required for Life Safety Performance Level
EL-8 Spreader Bracket. HR-not required; LS-not required; PR-H.	Spreader brackets are not used to resist seismic forces. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.8)			X		Not required for life safety performance level.
EL-9 Go-Slow Elevators. HR-not required; LS-not required; PR-H.	The building has a go-slow elevator system. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.9)			X		Not required for life safety performance level.

1. Thorp, Thorp Elementary and Junior Senior High School, Thorp Elem/Jr/Sr High School

1.1 Building Description

Building Name:	Thorp Elem/Jr/Sr High School
Facility Name:	Thorp Elementary and Junior Senior High School
District Name:	Thorp
ICOS Latitude:	47.07
ICOS Longitude:	-120.676
ICOS	
County/District ID:	19400
ICOS Building ID:	21838
ASCE 41 Bldg Type:	RM1
Enrollment:	158
Gross Sq. Ft. :	38,975
Year Built:	1991
Number of Stories:	1
S _{XS} BSE-2E:	0.472
S _{X1} BSE-2E:	0.271
ASCE 41 Level of Seismicity:	High
Site Class:	C
V _{S30} (m/s):	532
Liquefaction Potential:	moderate to high
Tsunami Risk:	None
Structural Drawings Available:	Some
Evaluating Firm:	BergerABAM/WSP

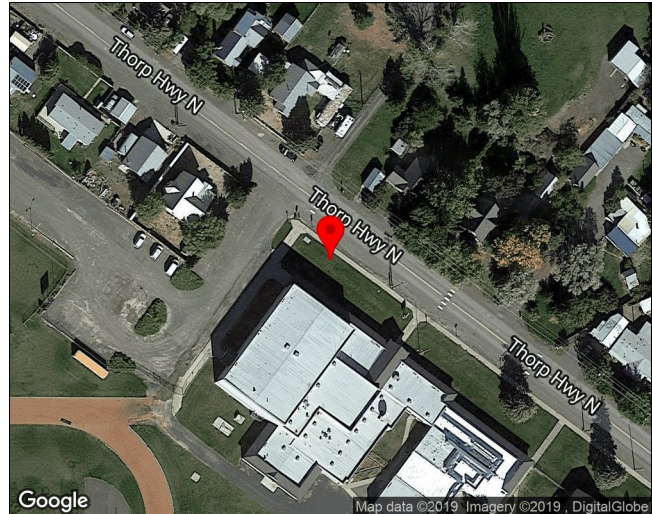

Thorp Senior High School was constructed in 1991 and is a rectangular building addition (approximately 170 ft x 124 ft) to the elementary school constructed in 1950. The high school/elementary school building shares the site with the 1935 brick Middle School building.

The high school building is wood frame with masonry veneer and the gym is reinforced masonry construction. The roof framing over the classroom/commons/office space is constructed with prefabricated wood roof trusses at 24" oc with 5/8" sheathing. The shear walls extend up to the roof. The gym roof framing is constructed with wood TJG trusses at 7'-9" oc with 2x10 at 24" oc joists and 5/8" sheathing (blocked at perimeter) supported on reinforced masonry walls. There is a wood frame second floor upper gym/mechanical space over the locker rooms. The upper gym/mechanical space is framed with metal joists.

The floor sheathing is unclear from the available drawings and may be 3/8" sheathing over 3" T&G decking. Five pages of general notes, plans and typical details were made available, but the balance of details were unavailable.

The wood frame portion of the building meets benchmark standards (constructed post 1976 UBC) and does not need to be evaluated for collapse prevention. The reinforced masonry gym does not meet benchmark building standards and will be evaluated for collapse prevention.

1.1.1 Building Use

The 1991 addition is the high school space which includes classrooms, offices/administration, a commons, gym, and locker rooms. Above the locker rooms is a gym mezzanine including an upper gym area and mechanical room. According to the drawings, a second floor stage constructed of 2x12 @ 12" oc with plywood sheathing is located over the music room, however according to district personnel, this area does not exist. District to confirm.

1.1.2 Structural System

Table 1.1-1. Structural System Description of Thorp Elementary and Junior Senior High School

Structural System	Description
Structural Roof	The structural roof at the classrooms, commons and offices is constructed with prefabricated wood roof trusses at 24" oc with 5/8" sheathing. The gym roof is constructed with 2x10 at 24" oc joists with 5/8" sheathing supported by TJG trusses at 6'-9" oc .
Structural Floor(s)	The structural first floor is 4" slab on grade reinforced with 6x6 W2.9 x W2.9 WWF. The mechanical room/upper gym space is constructed with steel joists at 36" oc. The floor is unclear from the available drawings - either consisting of metal deck or 3x decking with 3/8" sheathing.
Foundations	Continuous footings support the exterior and interior bearing walls.
Gravity System	The gravity system consists of wood frame joist/roof truss supported by bearing walls supported on continuous footings.
Lateral System	The lateral force resisting system consists of wood sheathed roof diaphragms with wood sheathed shear walls at the classroom, commons, and offices and reinforced masonry shear walls at the gym.

1.1.3 Structural System Visual Condition

Table 1.1-2. Structural System Condition Description of Thorp Elementary and Junior Senior High School

Structural System	Description
Structural Roof	Did not observe signs of corrosion, damage or deterioration.
Structural Floor(s)	Did not observe signs of corrosion, damage or deterioration.
Foundations	Unknown
Gravity System	Did not observe signs of corrosion, damage or deterioration.
Lateral System	Did not observe signs of corrosion, damage or deterioration.

1.2 Seismic Evaluation Findings

1.2.1 Structural Seismic Deficiencies

The structural seismic deficiencies identified during the Tier 1 evaluation are summarized below. Commentary for each deficiency is also provided based on this evaluation.

Table 1-3. Identified Structural Seismic Deficiencies for Thorp Thorp Elementary and Junior Senior High School Thorp Elem/Jr/Sr High School

Deficiency	Description
Load Path	Limited drawings were available. The gym walls should be further investigated to confirm running bond construction. One wall section appeared to be stack bond construction.

1.2.2 Structural Checklist Items Marked as 'U'nknown

Where building structural component seismic adequacy was unknown due to lack of available information or limited observation, the structural checklist items were marked as “unknown”. These items require further investigation if definitive determination of compliance or noncompliance is desired. The unknown structural checklist items identified during the Tier 1 evaluation are summarized below. Commentary for each unknown item is also provided based on the evaluation.

Table 1-4. Identified Structural Checklist Items Marked as Unknown for Thorp Thorp Elementary and Junior Senior High School Thorp Elem/Jr/Sr High School

Unknown Item	Description
Liquefaction	The liquefaction potential of site soils is unknown at this time given available information. Moderate to high liquefaction potential is identified per ICOS based on state geologic mapping. Requires further investigation by a licensed geotechnical engineer to determine liquefaction potential.
Slope Failure	Requires further investigation by a licensed geotechnical engineer to determine susceptibility to slope failure. The structure appears to be located on a relatively flat site.
Surface Fault Rupture	Requires further investigation by a licensed geotechnical engineer to determine whether site is near locations of expected surface fault ruptures.
Wall Anchorage	Details unavailable on limited structural drawings.
Wood Ledgers	Details unavailable on limited structural drawings.
Transfer to Shear Walls	Details unavailable on limited structural drawings.
Cross Ties	Limited structural drawings available, unable to verify in field. Trusses act as cross ties running east-west.
Diagonally Sheathed and Unblocked Diaphragms	Limited structural drawings available, most of the roof complies. Gym roof diaphragm exceeds 40 ft, blocking unknown.
Stiffness of Wall Anchors	Limited structural drawings available, unable to verify in field. Likely to have been installed.

1.3.1 Nonstructural Seismic Deficiencies

The nonstructural seismic deficiencies identified during the Tier 1 evaluation are summarized below. Commentary for each deficiency is also provided based on this evaluation. Some nonstructural deficiencies may be able to be mitigated by school district staff. Other nonstructural components that require more substantial mitigation may be more appropriately included in a long-term mitigation strategy. Some typical conceptual details for the seismic upgrade of nonstructural components can be found in the FEMA E-74 Excerpts appendix.

Table 1-5. Identified Nonstructural Seismic Deficiencies for Thorp Thorp Elementary and Junior Senior High School Thorp Elem/Jr/Sr High School

Deficiency	Description
------------	-------------

The Tier 1 nonstructural seismic evaluation performed for this school building could not confirm nonstructural seismic deficiencies due to limited access for visual observation and/or lack of existing drawings available for review. Please refer to the next page of this report for the list of nonstructural items marked as “unknown” and commentary indicating the need for further investigation or the likelihood of compliance or non-compliance based on the age of construction.

1.3.2 Nonstructural Checklist Items Marked as 'Unknown'

Where building nonstructural component seismic adequacy was unknown due to lack of available information or limited observation, the nonstructural checklist items were marked as “unknown”. These items require further investigation if definitive determination of compliance or noncompliance is desired. The unknown nonstructural checklist items identified during the Tier 1 evaluation are summarized below. Commentary for each unknown item is also provided based on the evaluation.

Some nonstructural deficiencies may be able to be mitigated by school district staff. Other nonstructural components that require more substantial mitigation may be more appropriately included in a long-term mitigation strategy. Some typical conceptual details for the seismic upgrade of nonstructural components can be found in the FEMA E-74 Excerpts appendix.

Table 1-6. Identified Nonstructural Checklist Items Marked as Unknown for Thorp Thorp Elementary and Junior Senior High School Thorp Elem/Jr/Sr High School

Unknown Item	Description
LSS-1 Fire Suppression Piping. HR-not required; LS-LMH; PR-LMH.	Not detailed on available drawings or visually verified during site visit. See Report documents (including Appendix) for bracing guidance.
LSS-2 Flexible Couplings. HR-not required; LS-LMH; PR-LMH.	Not detailed on available drawings or visually verified during site visit. See Report documents (including Appendix) for bracing guidance.
LSS-3 Emergency Power. HR-not required; LS-LMH; PR-LMH.	Not detailed on available drawings or visually verified during site visit. See Report documents (including Appendix) for bracing guidance.
LSS-4 Stair and Smoke Ducts. HR-not required; LS-LMH; PR-LMH.	No enclosed stairs.
LSS-5 Sprinkler Ceiling Clearance. HR-not required; LS-MH; PR-MH.	Not detailed on available drawings.
HM-1 Hazardous Material Equipment. HR-LMH; LS-LMH; PR-LMH.	Did not observe equipment containing hazardous materials mounted on vibration isolators. District to confirm.
HM-2 Hazardous Material Storage. HR-LMH; LS-LMH; PR-LMH.	Did not observe breakable containers with hazardous materials. District to confirm.
HM-3 Hazardous Material Distribution. HR-MH; LS-MH; PR-MH.	Did not observe piping or ductwork conveying hazardous materials. District to confirm.
HM-4 Shutoff Valves. HR-MH; LS-MH; PR-MH.	Did not observe but most likely compliant. Should be confirmed.
HM-5 Flexible Couplings. HR-LMH; LS-LMH; PR-LMH.	Did not observe flexible couplings. Should be confirmed.
LF-1 Independent Support. HR-not required; LS-MH; PR-MH.	Unknown what supports or bracing may be hidden in the ceiling space.
M-3 Weakened Planes. HR-not required; LS-LMH; PR-LMH.	Limited drawings available, but most likely complies.
PCOA-4 Appendages. HR-MH; LS-MH; PR-LMH.	No appendages.
S-1 Stair Enclosures. HR-not required; LS-LMH; PR-LMH.	

Unknown Item	Description
S-2 Stair Details. HR-not required; LS-LMH; PR-LMH.	Limited drawings available do not indicate gap between steel stair stringer and masonry walls.
CF-1 Industrial Storage Racks. HR-LMH; LS-MH; PR-MH.	Did not observe racks more than 12 ft high. District to confirm. See Report documents (including Appendix) for bracing guidance.
CF-2 Tall Narrow Contents. HR-not required; LS-H; PR-MH.	Did not observe, district to confirm. Brace tops of shelving taller than 6 feet to nearest backing wall, provide overturning base restraint.
CF-3 Fall-Prone Contents. HR-not required; LS-H; PR-H.	Did not observe, district to confirm. Heavy items on upper shelves should be restrained by netting or cabling to avoid becoming falling hazards.
ME-1 Fall-Prone Equipment. HR-not required; LS-H; PR-H.	Did not enter mechanical room in gym mezzanine level. District to confirm fall prone equipment is braced.
ME-2 In-Line Equipment. HR-not required; LS-H; PR-H.	Did not enter mechanical room in gym mezzanine level. District to confirm in-line equipment is braced.
ME-3 Tall Narrow Equipment. HR-not required; LS-H; PR-MH.	Did not enter mechanical room in gym mezzanine level. District to confirm tall narrow equipment is braced to nearest backing wall, provide overturning base restraint. See Report document & appendix for bracing guidance.

Photos:



Figure 1-1. Thorp HS west elevation



Figure 1-2. Thorp HS Gym north wall



Figure 1-3. Thorp HS Commons



Figure 1-4. Thorp HS Commons -Band area ceiling



Figure 1-5. Thorp HS hallway



Figure 1-6. Thorp HS classroom



Figure 1-7. Thorp HS gym & mezzanine



Figure 1-8. Thorp HS North wall (stack bond?)



Figure 1-9. Thorp HS addition to 1950 construction

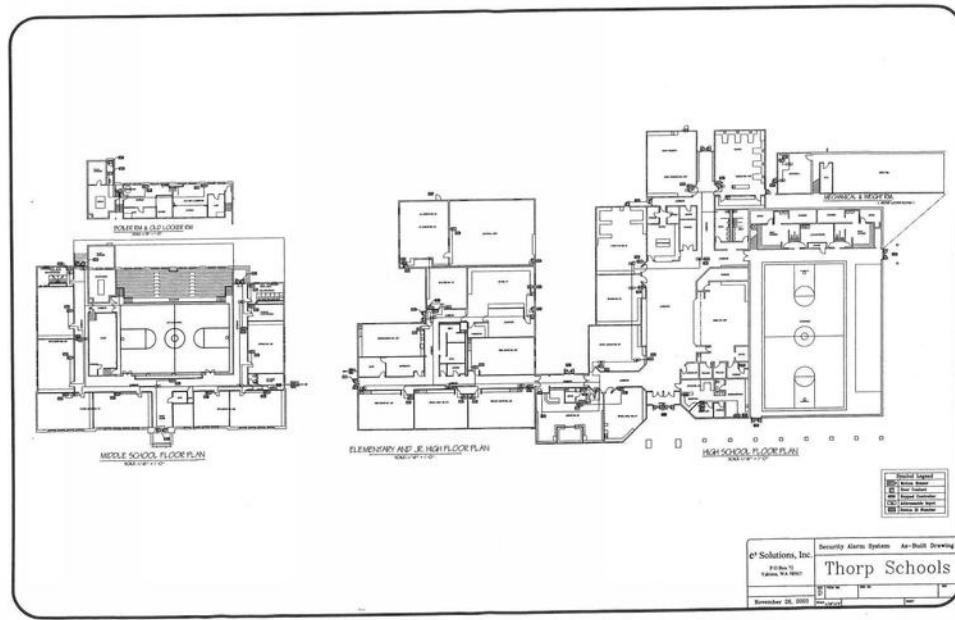


Figure 1-10. Floor plan received from district

Thorp, Thorp Elementary and Junior Senior High School, Thorp Elem/Jr/Sr High School

17-2 Collapse Prevention Basic Configuration Checklist

Building record drawings have been reviewed, when available, and a non-destructive field investigation has been performed for the subject building. Each of the required checklist items are marked Compliant (C), Noncompliant (NC), Not Applicable (N/A), or Unknown (U). Items marked Compliant indicate conditions that satisfy the performance objective, whereas items marked Noncompliant or Unknown indicate conditions that do not. Certain statements might not apply to the building being evaluated.

Low Seismicity

Building System - General

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Load Path	The structure contains a complete, well-defined load path, including structural elements and connections, that serves to transfer the inertial forces associated with the mass of all elements of the building to the foundation. (Tier 2: Sec. 5.4.1.1; Commentary: Sec. A.2.1.10)		X			Limited drawings were available. The gym walls should be further investigated to confirm running bond construction. One wall section appeared to be stack bond construction.
Adjacent Buildings	The clear distance between the building being evaluated and any adjacent building is greater than 0.25% of the height of the shorter building in low seismicity, 0.5% in moderate seismicity, and 1.5% in high seismicity. (Tier 2: Sec. 5.4.1.2; Commentary: Sec. A.2.1.2)			X		No seismic joint where the 1991 building meets the adjacent 1950s building. No seismic joint between reinforced masonry gym walls and wood frame classroom walls.
Mezzanines	Interior mezzanine levels are braced independently from the main structure or are anchored to the seismic-force-resisting elements of the main structure. (Tier 2: Sec. 5.4.1.3; Commentary: Sec. A.2.1.3)	X				Limited drawings were available but details available suggest mezzanine spaces are well constructed.

Building System - Building Configuration

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Weak Story	The sum of the shear strengths of the seismic-force-resisting system in any story in each direction is not less than 80% of the strength in the adjacent story above. (Tier 2: Sec. 5.4.2.1; Commentary: Sec. A.2.2.2)			X		One-story building (with mezzanine).
Soft Story	The stiffness of the seismic-force-resisting system in any story is not less than 70% of the seismic-force-resisting system stiffness in an adjacent story above or less than 80% of the average seismic-force-resisting system stiffness of the three stories above. (Tier 2: Sec. 5.4.2.2; Commentary: Sec. A.2.2.3)			X		One-story building (with mezzanine).

Vertical Irregularities	All vertical elements in the seismic-force-resisting system are continuous to the foundation. (Tier 2: Sec. 5.4.2.3; Commentary: Sec. A.2.2.4)	X				
Geometry	There are no changes in the net horizontal dimension of the seismic-force-resisting system of more than 30% in a story relative to adjacent stories, excluding one-story penthouses and mezzanines. (Tier 2: Sec. 5.4.2.4; Commentary: Sec. A.2.2.5)			X		One-story building (with mezzanine).
Mass	There is no change in effective mass of more than 50% from one story to the next. Light roofs, penthouses, and mezzanines need not be considered. (Tier 2: Sec. 5.4.2.5; Commentary: Sec. A.2.2.6)			X		One-story building (with mezzanine).
Torsion	The estimated distance between the story center of mass and the story center of rigidity is less than 20% of the building width in either plan dimension. (Tier 2: Sec. 5.4.2.6; Commentary: Sec. A.2.2.7)			X		The building has flexible diaphragms and a generous layout of shear walls so torsion is not expected to be an issue.

Moderate Seismicity (Complete the Following Items in Addition to the Items for Low Seismicity)

Geologic Site Hazards

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Liquefaction	Liquefaction-susceptible, saturated, loose granular soils that could jeopardize the building's seismic performance do not exist in the foundation soils at depths within 50 ft (15.2 m) under the building. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.1)				X	The liquefaction potential of site soils is unknown at this time given available information. Moderate to high liquefaction potential is identified per ICOS based on state geologic mapping. Requires further investigation by a licensed geotechnical engineer to determine liquefaction potential.
Slope Failure	The building site is located away from potential earthquake-induced slope failures or rockfalls so that it is unaffected by such failures or is capable of accommodating any predicted movements without failure. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.2)				X	Requires further investigation by a licensed geotechnical engineer to determine susceptibility to slope failure. The structure appears to be located on a relatively flat site.
Surface Fault Rupture	Surface fault rupture and surface displacement at the building site are not anticipated. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.3)				X	Requires further investigation by a licensed geotechnical engineer to determine whether site is near locations of expected surface fault ruptures.

High Seismicity (Complete the Following Items in Addition to the Items for Low and Moderate Seismicity)

Foundation Configuration

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Overturning	The ratio of the least horizontal dimension of the seismic-force-resisting system at the foundation level to the building height (base/height) is greater than 0.6Sa. (Tier 2: Sec. 5.4.3.3; Commentary: Sec. A.6.2.1)	X				0.6Sa = 0.48 which is less than gym base/height ration of 2.7.
Ties Between Foundation Elements	The foundation has ties adequate to resist seismic forces where footings, piles, and piers are not restrained by beams, slabs, or soils classified as Site Class A, B, or C. (Tier 2: Sec. 5.4.3.4; Commentary: Sec. A.6.2.2)	X				The footings are restrained by slabs. Soil Site Class E

17-34 Collapse Prevention Structural Checklist for Building Types RM1 and RM2

Building record drawings have been reviewed, when available, and a non-destructive field investigation has been performed for the subject building. Each of the required checklist items are marked Compliant (C), Noncompliant (NC), Not Applicable (N/A), or Unknown (U). Items marked Compliant indicate conditions that satisfy the performance objective, whereas items marked Noncompliant or Unknown indicate conditions that do not. Certain statements might not apply to the building being evaluated.

Low and Moderate Seismicity

Seismic-Force-Resisting System

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Redundancy	The number of lines of shear walls in each principal direction is greater than or equal to 2. (Tier 2: Sec. 5.5.1.1; Commentary: Sec. A.3.2.1.1)	X				The flexible diaphragm will distribute the loads to multiple shear walls in each direction on a tributary area basis.
Shear Stress Check	The shear stress in the reinforced masonry shear walls, calculated using the Quick Check procedure of Section 4.4.3.3, is less than 70 lb/in.2 (0.48 MPa). (Tier 2: Sec. 5.5.3.1.1; Commentary: Sec. A.3.2.4.1)	X				The ASCE Quick Check of the shear stress in the reinforced masonry shear walls indicated compliance.
Reinforcing Steel	The total vertical and horizontal reinforcing steel ratio in reinforced masonry walls is greater than 0.002 of the wall with the minimum of 0.0007 in either of the two directions; the spacing of reinforcing steel is less than 48 in. (1220 mm), and all vertical bars extend to the top of the walls. (Tier 2: Sec. 5.5.3.1.3; Commentary: Sec. A.3.2.4.2)	X				12-inch cmu reinforcement as indicated on available structural drawings meets minimums required.

Stiff Diaphragms

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Topping Slab	Precast concrete diaphragm elements are interconnected by a continuous reinforced concrete topping slab. (Tier 2: Sec. 5.6.4; Commentary: Sec. A.4.5.1)			X		No precast concrete diaphragm elements or concrete topping slab.

Connections

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Wall Anchorage	Exterior concrete or masonry walls that are dependent on the diaphragm for lateral support are anchored for out-of-plane forces at each diaphragm level with steel anchors, reinforcing dowels, or straps that are developed into the diaphragm. Connections have strength to resist the connection force calculated in the Quick Check procedure of Section 4.4.3.7. (Tier 2: Sec. 5.7.1.1; Commentary: Sec. A.5.1.1)				X	Details unavailable on limited structural drawings.

Wood Ledgers	The connection between the wall panels and the diaphragm does not induce cross-grain bending or tension in the wood ledgers. (Tier 2: Sec. 5.7.1.3; Commentary: Sec. A.5.1.2)				X	Details unavailable on limited structural drawings.
Transfer to Shear Walls	Diaphragms are connected for transfer of seismic forces to the shear walls. (Tier 2: Sec. 5.7.2; Commentary: Sec. A.5.2.1)				X	Details unavailable on limited structural drawings.
Topping Slab to Walls or Frames	Reinforced concrete topping slabs that interconnect the precast concrete diaphragm elements are doweled for transfer of forces into the shear wall or frame elements. (Tier 2: Sec. 5.7.2; Commentary: Sec. A.5.2.)			X		No precast concrete diaphragm elements or concrete topping slab.
Foundation Dowels	Wall reinforcement is doweled into the foundation. (Tier 2: Sec. 5.7.3.4; Commentary: Sec. A.5.3.5)	X				Limited structural drawings available do not indicate footing details. Likely to have been installed.
Girder-Column Connection	There is a positive connection using plates, connection hardware, or straps between the girder and the column support. (Tier 2: Sec. 5.7.4.1; Commentary: Sec. A.5.4.1)	X				Available drawings indicate beams positively connected to columns.

High Seismicity (Complete the Following Items in Addition to the Items for Low and Moderate Seismicity)

Stiff Diaphragms

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Openings at Shear Walls	Diaphragm openings immediately adjacent to the shear walls are less than 25% of the wall length. (Tier 2: Sec. 5.6.1.3; Commentary: Sec. A.4.1.4)	X				No stiff (or rigid) diaphragm
Openings at Exterior Masonry Shear Walls	Diaphragm openings immediately adjacent to exterior masonry shear walls are not greater than 8 ft (2.4 m) long. (Tier 2: Sec. 5.6.1.3; Commentary: Sec. A.4.1.6)	X				No stiff (or rigid) diaphragm

Flexible Diaphragms

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Cross Ties	There are continuous cross ties between diaphragm chords. (Tier 2: Sec. 5.6.1.2; Commentary: Sec. A.4.1.2)				X	Limited structural drawings available, unable to verify in field. Trusses act as cross ties running east-west.
Openings at Shear Walls	Diaphragm openings immediately adjacent to the shear walls are less than 25% of the wall length. (Tier 2: Sec. 5.6.1.3; Commentary: Sec. A.4.1.4)	X				No diaphragm openings adjacent to shear walls.
Openings at Exterior Masonry Shear Walls	Diaphragm openings immediately adjacent to exterior masonry shear walls are not greater than 8 ft (2.4 m) long. (Tier 2: Sec. 5.6.1.3; Commentary: Sec. A.4.1.6)	X				No diaphragm openings adjacent to shear walls.
Straight Sheathing	All straight-sheathed diaphragms have aspect ratios less than 2-to-1 in the direction being considered. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.1)			X		No straight sheathed diaphragms.

Spans	All wood diaphragms with spans greater than 24 ft (7.3 m) consist of wood structural panels or diagonal sheathing. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.2)	X				Wood diaphragms consist of wood structural panels.
Diagonally Sheathed and Unblocked Diaphragms	All diagonally sheathed or unblocked wood structural panel diaphragms have horizontal spans less than 40 ft (12.2 m) and aspect ratios less than or equal to 4 to-1. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.3)				X	Limited structural drawings available, most of the roof complies. Gym roof diaphragm exceeds 40 ft, blocking unknown.
Other Diaphragms	Diaphragms do not consist of a system other than wood, metal deck, concrete, or horizontal bracing. (Tier 2: Sec. 5.6.5; Commentary: Sec. A.4.7.1)	X				Wood frame roof and floor diaphragms.

Connections

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Stiffness of Wall Anchors	Anchors of concrete or masonry walls to wood structural elements are installed taut and are stiff enough to limit the relative movement between the wall and the diaphragm to no greater than 1/8 in. (3 mm) before engagement of the anchors. (Tier 2: Sec. 5.7.1.2; Commentary: Sec. A.5.1.4)				X	Limited structural drawings available, unable to verify in field. Likely to have been installed.

Thorp, Thorp Elementary and Junior Senior High School, Thorp Elem/Jr/Sr High School

17-38 Nonstructural Checklist

Notes:

C = Compliant, NC = Noncompliant, N/A = Not Applicable, and U = Unknown.

Performance Level: HR = Hazards Reduced, LS = Life Safety, and PR = Position Retention.

Level of Seismicity: L = Low, M = Moderate, and H = High

Life Safety Systems

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
LSS-1 Fire Suppression Piping. HR-not required; LS-LMH; PR-LMH.	Fire suppression piping is anchored and braced in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.1)				X	No available record drawing information on fire suppression piping and unable to verify during site investigation. Based on year of construction (1991) of the building, it is assumed that seismic bracing for fire suppression piping may be compliant with NFPA 13. District to confirm.
LSS-2 Flexible Couplings. HR-not required; LS-LMH; PR-LMH.	Fire suppression piping has flexible couplings in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.2)				X	No available record drawing information on fire suppression piping and unable to verify during site investigation. Based on age of the building, it is assumed the flexible couplings on the fire suppression piping comply with NFPA 13.
LSS-3 Emergency Power. HR-not required; LS-LMH; PR-LMH.	Equipment used to power or control Life Safety systems is anchored or braced. (Tier 2: Sec. 13.7.7; Commentary: Sec. A.7.12.1)				X	Available record drawings do not have information on anchorage or bracing for emergency power equipment and could not verify during site investigation. Based on age of the building, evaluation of emergency power equipment may be appropriate to mitigate seismic risk.
LSS-4 Stair and Smoke Ducts. HR-not required; LS-LMH; PR-LMH.	Stair pressurization and smoke control ducts are braced and have flexible connections at seismic joints. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.1)			X		No enclosed stairs.

LSS-5 Sprinkler Ceiling Clearance. HR-not required; LS-MH; PR-MH.	Penetrations through panelized ceilings for fire suppression devices provide clearances in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.3)				X	No available record drawing information on sprinkler head clearance and unable to verify during site investigation. Further evaluation may be appropriate to mitigate seismic risk.
LSS-6 Emergency Lighting. HR-not required; LS-not required; PR-LMH	Emergency and egress lighting equipment is anchored or braced. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.1)			X		Not required for Life Safety Performance Level

Hazardous Materials

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
HM-1 Hazardous Material Equipment. HR-LMH; LS-LMH; PR-LMH.	Equipment mounted on vibration isolators and containing hazardous material is equipped with restraints or snubbers. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.2)			X		Did not observe equipment containing hazardous materials mounted on vibration isolators. Further investigation may be appropriate to mitigate seismic risk.
HM-2 Hazardous Material Storage. HR-LMH; LS-LMH; PR-LMH.	Breakable containers that hold hazardous material, including gas cylinders, are restrained by latched doors, shelf lips, wires, or other methods. (Tier 2: Sec. 13.8.3; Commentary: Sec. A.7.15.1)				X	Unknown whether the building has hazardous materials. Further investigation may be appropriate to mitigate seismic risk.
HM-3 Hazardous Material Distribution. HR-MH; LS-MH; PR-MH.	Piping or ductwork conveying hazardous materials is braced or otherwise protected from damage that would allow hazardous material release. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.4)			X		Did not observe any piping or ductwork conveying hazardous materials.
HM-4 Shutoff Valves. HR-MH; LS-MH; PR-MH.	Piping containing hazardous material, including natural gas, has shutoff valves or other devices to limit spills or leaks. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.3)				X	It is unknown if there are shutoff valves for piping containing hazardous materials. Further investigation may be appropriate to mitigate seismic risk.
HM-5 Flexible Couplings. HR-LMH; LS-LMH; PR-LMH.	Hazardous material ductwork and piping, including natural gas piping, have flexible couplings. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.15.4)				X	Did not observe any hazardous material ductwork and piping. Further investigation may be appropriate to mitigate seismic risk.

HM-6 Piping or Ducts Crossing Seismic Joints. HR-MH; LS-MH; PR-MH.	Piping or ductwork carrying hazardous material that either crosses seismic joints or isolation planes or is connected to independent structures has couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.3, 13.7.5, 13.7.6; Commentary: Sec. A.7.13.6)			X		Building has no seismic joints.
--	--	--	--	---	--	---------------------------------

Partitions

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
P-1 Unreinforced Masonry. HR-LMH; LS-LMH; PR-LMH.	Unreinforced masonry or hollow-clay tile partitions are braced at a spacing of at most 10 ft (3.0 m) in Low or Moderate Seismicity, or at most 6 ft (1.8 m) in High Seismicity. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.1)			X		There are no URM partitions in the building.
P-2 Heavy Partitions Supported by Ceilings. HR-LMH; LS-LMH; PR-LMH.	The tops of masonry or hollow-clay tile partitions are not laterally supported by an integrated ceiling system. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.2.1)			X		Limited structural drawings available do not indicate interior masonry partitions.
P-3 Drift. HR-not required; LS-MH; PR-MH.	Rigid cementitious partitions are detailed to accommodate the following drift ratios: in steel moment frame, concrete moment frame, and wood frame buildings, 0.02; in other buildings, 0.005. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.2)			X		There were no rigid cementitious partitions observed in building.
P-4 Light Partitions Supported by Ceilings. HR-not required; LS-not required; PR-MH.	The tops of gypsum board partitions are not laterally supported by an integrated ceiling system. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.2.1)			X		Not required for life safety performance level.
P-5 Structural Separations. HR-not required; LS-not required; PR-MH.	Partitions that cross structural separations have seismic or control joints. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.3)			X		Not required for life safety performance level.
P-6 Tops. HR-not required; LS-not required; PR-MH.	The tops of ceiling-high framed or panelized partitions have lateral bracing to the structure at a spacing equal to or less than 6 ft (1.8 m). (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.4)			X		Not required for Life Safety Performance Level

Ceilings

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
C-1 Suspended Lath and Plaster. HR-H; LS-MH; PR-LMH.	Suspended lath and plaster ceilings have attachments that resist seismic forces for every 12 ft ² (1.1 m ²) of area. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.3)			X		No suspended lath and plaster ceilings observed.
C-2 Suspended Gypsum Board. HR-not required; LS-MH; PR-LMH.	Suspended gypsum board ceilings have attachments that resist seismic forces for every 12 ft ² (1.1 m ²) of area. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.3)			X		There are no suspended gypsum board ceilings.

C-3 Integrated Ceilings. HR-not required; LS-not required; PR-MH.	Integrated suspended ceilings with continuous areas greater than 144 ft ² (13.4 m ²) and ceilings of smaller areas that are not surrounded by restraining partitions are laterally restrained at a spacing no greater than 12 ft (3.6 m) with members attached to the structure above. Each restraint location has a minimum of four diagonal wires and compression struts, or diagonal members capable of resisting compression. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.2)			X		Not required for life safety performance level.
C-4 Edge Clearance. HR-not required; LS-not required; PR-MH.	The free edges of integrated suspended ceilings with continuous areas greater than 144 ft ² (13.4 m ²) have clearances from the enclosing wall or partition of at least the following: in Moderate Seismicity, 1/2 in. (13 mm); in High Seismicity, 3/4 in. (19 mm). (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.4)			X		Not required for life safety performance level.
C-5 Continuity Across Structure Joints. HR-not required; LS-not required; PR-MH.	The ceiling system does not cross any seismic joint and is not attached to multiple independent structures. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.5)			X		Not required for life safety performance level.
C-6 Edge Support. HR-not required; LS-not required; PR-H.	The free edges of integrated suspended ceilings with continuous areas greater than 144 ft ² (13.4 m ²) are supported by closure angles or channels not less than 2 in. (51 mm) wide. (Tier 2: Sec. 13.6.4 ; Commentary: Sec. A.7.2.6)			X		Not required for Life Safety Performance Level
C-7 Seismic Joints. HR-not required; LS-not required; PR-H.	Acoustical tile or lay-in panel ceilings have seismic separation joints such that each continuous portion of the ceiling is no more than 2,500 ft ² (232.3 m ²) and has a ratio of long-to-short dimension no more than 4-to-1. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.7)			X		Not required for life safety performance level.

Light Fixtures

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
LF-1 Independent Support. HR-not required; LS-MH; PR-MH.	Light fixtures that weigh more per square foot than the ceiling they penetrate are supported independent of the grid ceiling suspension system by a minimum of two wires at diagonally opposite corners of each fixture. (Tier 2: Sec. 13.6.4, 13.7.9; Commentary: Sec. A.7.3.2)				X	Unknown what supports or bracing may be hidden in the ceiling space. Further investigation may be appropriate to mitigate seismic risk.

LF-2 Pendant Supports. HR-not required; LS-not required; PR-H.	Light fixtures on pendant supports are attached at a spacing equal to or less than 6 ft. Unbraced suspended fixtures are free to allow a 360-degree range of motion at an angle not less than 45 degrees from horizontal without contacting adjacent components. Alternatively, if rigidly supported and/or braced, they are free to move with the structure to which they are attached without damaging adjoining components. Additionally, the connection to the structure is capable of accommodating the movement without failure. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.3)			X		Not required for life safety performance level.
LF-3 Lens Covers. HR-not required; LS-not required; PR-H.	Lens covers on light fixtures are attached with safety devices. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.4)			X		Not required for Life Safety Performance Level

Cladding and Glazing

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
CG-1 Cladding Anchors. HR-MH; LS-MH; PR-MH.	Cladding components weighing more than 10 lb/ft ² (0.48 kN/m ²) are mechanically anchored to the structure at a spacing equal to or less than the following: for Life Safety in Moderate Seismicity, 6 ft (1.8 m); for Life Safety in High Seismicity and for Position Retention in any seismicity, 4 ft (1.2 m) (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.1)			X		The building does not have any exterior cladding components.
CG-2 Cladding Isolation. HR-not required; LS-MH; PR-MH.	For steel or concrete moment-frame buildings, panel connections are detailed to accommodate a story drift ratio by the use of rods attached to framing with oversize holes or slotted holes of at least the following: for Life Safety in Moderate Seismicity, 0.01; for Life Safety in High Seismicity and for Position Retention in any seismicity, 0.02, and the rods have a length-to-diameter ratio of 4.0 or less. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.3)			X		The building does not have any exterior cladding components.
CG-3 Multi-Story Panels. HR-MH; LS-MH; PR-MH.	For multi-story panels attached at more than one floor level, panel connections are detailed to accommodate a story drift ratio by the use of rods attached to framing with oversize holes or slotted holes of at least the following: for Life Safety in Moderate Seismicity, 0.01; for Life Safety in High Seismicity and for Position Retention in any seismicity, 0.02, and the rods have a length-to-diameter ratio of 4.0 or less. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.4)			X		The building does not have any exterior cladding components.

CG-4 Threaded Rods. HR-not required; LS-MH; PR-MH.	Threaded rods for panel connections detailed to accommodate drift by bending of the rod have a length-to-diameter ratio greater than 0.06 times the story height in inches for Life Safety in Moderate Seismicity and 0.12 times the story height in inches for Life Safety in High Seismicity and Position Retention in any seismicity. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.9)			X		The building does not have any exterior cladding components.
CG-5 Panel Connections. HR-MH; LS-MH; PR-MH.	Cladding panels are anchored out of plane with a minimum number of connections for each wall panel, as follows: for Life Safety in Moderate Seismicity, 2 connections; for Life Safety in High Seismicity and for Position Retention in any seismicity, 4 connections. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.5)			X		The building does not have any exterior cladding components.
CG-6 Bearing Connections. HR-MH; LS-MH; PR-MH.	Where bearing connections are used, there is a minimum of two bearing connections for each cladding panel. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.6)			X		The building does not have any exterior cladding components.
CG-7 Inserts. HR-MH; LS-MH; PR-MH.	Where concrete cladding components use inserts, the inserts have positive anchorage or are anchored to reinforcing steel. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.7)			X		The building does not have any exterior cladding components.
CG-8 Overhead Glazing. HR-not required; LS-MH; PR-MH.	Glazing panes of any size in curtain walls and individual interior or exterior panes more than 16 ft ² (1.5 m ²) in area are laminated annealed or laminated heat-strengthened glass and are detailed to remain in the frame when cracked. (Tier 2: Sec. 13.6.1.5; Commentary: Sec. A.7.4.8)			X		The building does not have any glazing panes.

Masonry Veneer

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
M-1 Ties. HR-not required; LS-LMH; PR-LMH.	Masonry veneer is connected to the backup with corrosion-resistant ties. There is a minimum of one tie for every 2-2/3 ft ² (0.25 m ²), and the ties have spacing no greater than the following: for Life Safety in Low or Moderate Seismicity, 36 in. (914 mm); for Life Safety in High Seismicity and for Position Retention in any seismicity, 24 in. (610 mm). (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.1)	X				Structural notes on available drawings indicate veneer ties to wood studs are provided.
M-2 Shelf Angles. HR-not required; LS-LMH; PR-LMH.	Masonry veneer is supported by shelf angles or other elements at each floor above the ground floor. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.2)	X				Available drawings indicate masonry veneer is supported by shelf angles over openings.

M-3 Weakened Planes. HR-not required; LS-LMH; PR-LMH.	Masonry veneer is anchored to the backup adjacent to weakened planes, such as at the locations of flashing. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.3)				X	Limited drawings available. Further investigation may be warranted to mitigate seismic risk.
M-4 Unreinforced Masonry Backup. HR-LMH; LS-LMH; PR-LMH.	There is no unreinforced masonry backup. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.7.2)	X				No URM backup.
M-5 Stud Tracks. HR-not required; LS-MH; PR-MH.	For veneer with coldformed steel stud backup, stud tracks are fastened to the structure at a spacing equal to or less than 24 in. (610 mm) on center. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.6.)			X		No cold-formed steel stud backup.
M-6 Anchorage. HR-not required; LS-MH; PR-MH.	For veneer with concrete block or masonry backup, the backup is positively anchored to the structure at a horizontal spacing equal to or less than 4 ft along the floors and roof. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.7.1)			X		No veneer at concrete block gym walls.
M-7 Weep Holes. HR-not required; LS-not required; PR-MH.	In veneer anchored to stud walls, the veneer has functioning weep holes and base flashing. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.6)			X		Not required for Life Safety Performance Level
M-8 Openings. HR-not required; LS-not required; PR-MH.	For veneer with cold-formed-steel stud backup, steel studs frame window and door openings. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.6.2)			X		Not required for Life Safety Performance Level

Parapets, Cornices, Ornamentation, and Appendages

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
PCOA-1 URM Parapets or Cornices. HR-LMH; LS-LMH; PR-LMH.	Laterally unsupported unreinforced masonry parapets or cornices have height-to-thickness ratios no greater than the following: for Life Safety in Low or Moderate Seismicity, 2.5; for Life Safety in High Seismicity and for Position Retention in any seismicity, 1.5. (Tier 2: Sec. 13.6.5; Commentary: Sec. A.7.8.1)			X		No URM parapets or cornices.
PCOA-2 Canopies. HR-not required; LS-LMH; PR-LMH.	Canopies at building exits are anchored to the structure at a spacing no greater than the following: for Life Safety in Low or Moderate Seismicity, 10 ft (3.0 m); for Life Safety in High Seismicity and for Position Retention in any seismicity, 6 ft (1.8 m). (Tier 2: Sec. 13.6.6; Commentary: Sec. A.7.8.2)	X				Limited structural drawings available, but canopies appear to be well anchored.
PCOA-3 Concrete Parapets. HR-H; LS-MH; PR-LMH.	Concrete parapets with height-to-thickness ratios greater than 2.5 have vertical reinforcement. (Tier 2: Sec. 13.6.5; Commentary: Sec. A.7.8.3)			X		No concrete parapets.

PCOA-4 Appendages. HR-MH; LS-MH; PR-LMH.	Cornices, parapets, signs, and other ornamentation or appendages that extend above the highest point of anchorage to the structure or cantilever from components are reinforced and anchored to the structural system at a spacing equal to or less than 6 ft (1.8 m). This evaluation statement item does not apply to parapets or cornices covered by other evaluation statements. (Tier 2: Sec. 13.6.6; Commentary: Sec. A.7.8.4)				X	No appendages observed. Further investigation may be appropriate to mitigate seismic risk.
---	--	--	--	--	---	--

Masonry Chimneys

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
MC-1 URM Chimneys. HR-LMH; LS-LMH; PR-LMH.	Unreinforced masonry chimneys extend above the roof surface no more than the following: for Life Safety in Low or Moderate Seismicity, 3 times the least dimension of the chimney; for Life Safety in High Seismicity and for Position Retention in any seismicity, 2 times the least dimension of the chimney. (Tier 2: Sec. 13.6.7; Commentary: Sec. A.7.9.1)			X		No URM chimneys.
MC-2 Anchorage. HR-LMH; LS-LMH; PR-LMH.	Masonry chimneys are anchored at each floor level, at the topmost ceiling level, and at the roof. (Tier 2: Sec. 13.6.7; Commentary: Sec. A.7.9.2)			X		No masonry chimneys.

Stairs

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
S-1 Stair Enclosures. HR-not required; LS-LMH; PR-LMH.	Hollow-clay tile or unreinforced masonry walls around stair enclosures are restrained out of plane and have height-to-thickness ratios not greater than the following: for Life Safety in Low or Moderate Seismicity, 15-to-1; for Life Safety in High Seismicity and for Position Retention in any seismicity, 12-to-1. (Tier 2: Sec. 13.6.2, 13.6.8; Commentary: Sec. A.7.10.1)				X	Item not visually verified during site visit. Further investigation may be appropriate to mitigate seismic risk.
S-2 Stair Details. HR-not required; LS-LMH; PR-LMH.	The connection between the stairs and the structure does not rely on post-installed anchors in concrete or masonry, and the stair details are capable of accommodating the drift calculated using the Quick Check procedure of Section 4.4.3.1 for moment-frame structures or 0.5 in. for all other structures without including any lateral stiffness contribution from the stairs. (Tier 2: Sec. 13.6.8; Commentary: Sec. A.7.10.2)				X	Limited drawings available do not indicate gap between steel stair stringer and masonry walls. Further investigation may be appropriate to mitigate seismic risk.

Contents and Furnishings

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
CF-1 Industrial Storage Racks. HR-LMH; LS-MH; PR-MH.	Industrial storage racks or pallet racks more than 12 ft high meet the requirements of ANSI/RMI MH 16.1 as modified by ASCE 7, Chapter 15. (Tier 2: Sec. 13.8.1; Commentary: Sec. A.7.11.1)			X		Does not appear that there are any industrial storage racks taller than 12 feet in the building.
CF-2 Tall Narrow Contents. HR-not required; LS-H; PR-MH.	Contents more than 6 ft (1.8 m) high with a height-to-depth or height-to-width ratio greater than 3-to-1 are anchored to the structure or to each other. (Tier 2: Sec. 13.8.2; Commentary: Sec. A.7.11.2)				X	Did not observe, district to confirm. Brace tops of shelving taller than 6 feet to nearest backing wall, provide overturning base restraint.
CF-3 Fall-Prone Contents. HR-not required; LS-H; PR-H.	Equipment, stored items, or other contents weighing more than 20 lb (9.1 kg) whose center of mass is more than 4 ft (1.2 m) above the adjacent floor level are braced or otherwise restrained. (Tier 2: Sec. 13.8.2; Commentary: Sec. A.7.11.3)				X	Did not observe, district to confirm. Heavy items on upper shelves should be restrained by netting or cabling to avoid falling hazards.
CF-4 Access Floors. HR-not required; LS-not required; PR-MH.	Access floors more than 9 in. (229 mm) high are braced. (Tier 2: Sec. 13.6.10; Commentary: Sec. A.7.11.4)			X		Not required for life safety performance level.
CF-5 Equipment on Access Floors. HR-not required; LS-not required; PR-MH.	Equipment and other contents supported by access floor systems are anchored or braced to the structure independent of the access floor. (Tier 2: Sec. 13.7.7 13.6.10; Commentary: Sec. A.7.11.5)			X		Not required for life safety performance level.
CF-6 Suspended Contents. HR-not required; LS-not required; PR-H.	Items suspended without lateral bracing are free to swing from or move with the structure from which they are suspended without damaging themselves or adjoining components. (Tier 2: Sec. 13.8.2; Commentary: Sec. A.7.11.6)			X		Not required for life safety performance level.

Mechanical and Electrical Equipment

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
ME-1 Fall-Prone Equipment. HR-not required; LS-H; PR-H.	Equipment weighing more than 20 lb (9.1 kg) whose center of mass is more than 4 ft (1.2 m) above the adjacent floor level, and which is not in-line equipment, is braced. (Tier 2: Sec. 13.7.1 13.7.7; Commentary: Sec. A.7.12.4)				X	Did not enter mechanical room in gym mezzanine level. District to confirm fall prone equipment is braced. Bracing required for equipment weighing more than 20 lb located 4 feet or more above the floor to mitigate seismic risk.

ME-2 In-Line Equipment. HR-not required; LS-H; PR-H.	Equipment installed in line with a duct or piping system, with an operating weight more than 75 lb (34.0 kg), is supported and laterally braced independent of the duct or piping system. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.5)				X	Did not enter mechanical room in gym mezzanine level. Bracing for heavy in-line equipment may be appropriate to mitigate seismic risk.
ME-3 Tall Narrow Equipment. HR-not required; LS-H; PR-MH.	Equipment more than 6 ft (1.8 m) high with a height-to-depth or height-to-width ratio greater than 3-to-1 is anchored to the floor slab or adjacent structural walls. (Tier 2: Sec. 13.7.1 13.7.7; Commentary: Sec. A.7.12.6)				X	Did not enter mechanical room in gym mezzanine level. District to confirm tall narrow equipment is braced to nearest backing wall, provide overturning base restraint.
ME-4 Mechanical Doors. HR-not required; LS-not required; PR-MH.	Mechanically operated doors are detailed to operate at a story drift ratio of 0.01. (Tier 2: Sec. 13.6.9; Commentary: Sec. A.7.12.7)			X		Not required for life safety performance level.
ME-5 Suspended Equipment. HR-not required; LS-not required; PR-H.	Equipment suspended without lateral bracing is free to swing from or move with the structure from which it is suspended without damaging itself or adjoining components. (Tier 2: Sec. 13.7.1, 13.7.7; Commentary: Sec. A.7.12.8)			X		Not required for life safety performance level.
ME-6 Vibration Isolators. HR-not required; LS-not required; PR-H.	Equipment mounted on vibration isolators is equipped with horizontal restraints or snubbers and with vertical restraints to resist overturning. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.9)			X		Not required for life safety performance level.
ME-7 Heavy Equipment. HR-not required; LS-not required; PR-H.	Floor supported or platform-supported equipment weighing more than 400 lb (181.4 kg) is anchored to the structure. (Tier 2: Sec. 13.7.1, 13.7.7; Commentary: Sec. A.7.12.10)			X		Not required for life safety performance level.
ME-8 Electrical Equipment. HR-not required; LS-not required; PR-H.	Electrical equipment is laterally braced to the structure. (Tier 2: Sec. 13.7.7; Commentary: Sec. A.7.12.11)			X		Not required for life safety performance level.
ME-9 Conduit Couplings. HR-not required; LS-not required; PR-H.	Conduit greater than 2.5 in. (64 mm) trade size that is attached to panels, cabinets, or other equipment and is subject to relative seismic displacement has flexible couplings or connections. (Tier 2: Sec. 13.7.8; Commentary: Sec. A.7.12.12)			X		Not required for life safety performance level.

Piping

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
PP-1 Flexible Couplings. HR-not required; LS-not required; PR-H.	Fluid and gas piping has flexible couplings. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.2)			X		Not required for life safety performance level.
PP-2 Fluid and Gas Piping. HR-not required; LS-not required; PR-H.	Fluid and gas piping is anchored and braced to the structure to limit spills or leaks. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.4)			X		Not required for life safety performance level.

PP-3 C-Clamps. HR-not required; LS-not required; PR-H.	One-sided C-clamps that support piping larger than 2.5 in. (64 mm) in diameter are restrained. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.5)			X		Not required for Life Safety Performance Level
PP-4 Piping Crossing Seismic Joints. HR-not required; LS-not required; PR-H.	Piping that crosses seismic joints or isolation planes or is connected to independent structures has couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.6)			X		Not required for life safety performance level.

Ducts

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
D-1 Duct Bracing. HR-not required; LS-not required; PR-H.	Rectangular ductwork larger than 6 ft ² (0.56 m ²) in cross-sectional area and round ducts larger than 28 in. (711 mm) in diameter are braced. The maximum spacing of transverse bracing does not exceed 30 ft (9.2 m). The maximum spacing of longitudinal bracing does not exceed 60 ft (18.3 m). (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.2)			X		Not required for Life Safety Performance Level
D-2 Duct Support. HR-not required; LS-not required; PR-H.	Ducts are not supported by piping or electrical conduit. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.3)			X		Not required for Life Safety Performance Level
D-3 Ducts Crossing Seismic Joints. HR-not required; LS-not required; PR-H.	Ducts that cross seismic joints or isolation planes or are connected to independent structures have couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.4)			X		Not required for life safety performance level.

Elevators


EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
EL-1 Retainer Guards. HR-not required; LS-H; PR-H.	Sheaves and drums have cable retainer guards. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.1)			X		No elevator in building.
EL-2 Retainer Plate. HR-not required; LS-H; PR-H.	A retainer plate is present at the top and bottom of both car and counterweight. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.2)			X		No elevator in building.
EL-3 Elevator Equipment. HR-not required; LS-not required; PR-H.	Equipment, piping, and other components that are part of the elevator system are anchored. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.3)			X		Not required for life safety performance level.
EL-4 Seismic Switch. HR-not required; LS-not required; PR-H.	Elevators capable of operating at speeds of 150 ft/min or faster are equipped with seismic switches that meet the requirements of ASME A17.1 or have trigger levels set to 20% of the acceleration of gravity at the base of the structure and 50% of the acceleration of gravity in other locations. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.4)			X		Not required for life safety performance level.

EL-5 Shaft Walls. HR-not required; LS-not required; PR-H.	Elevator shaft walls are anchored and reinforced to prevent toppling into the shaft during strong shaking. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.5)			X		Not required for Life Safety Performance Level
EL-6 Counterweight Rails. HR-not required; LS-not required; PR-H.	All counterweight rails and divider beams are sized in accordance with ASME A17.1. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.6)			X		Not required for life safety performance level.
EL-7 Brackets. HR-not required; LS-not required; PR-H.	The brackets that tie the car rails and the counterweight rail to the structure are sized in accordance with ASME A17.1. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.7)			X		Not required for Life Safety Performance Level
EL-8 Spreader Bracket. HR-not required; LS-not required; PR-H.	Spreader brackets are not used to resist seismic forces. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.8)			X		Not required for life safety performance level.
EL-9 Go-Slow Elevators. HR-not required; LS-not required; PR-H.	The building has a go-slow elevator system. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.9)			X		Not required for life safety performance level.

FEMA E-74 Nonstructural Seismic Bracing Excerpts

This page intentionally left blank.

Life Safety Systems

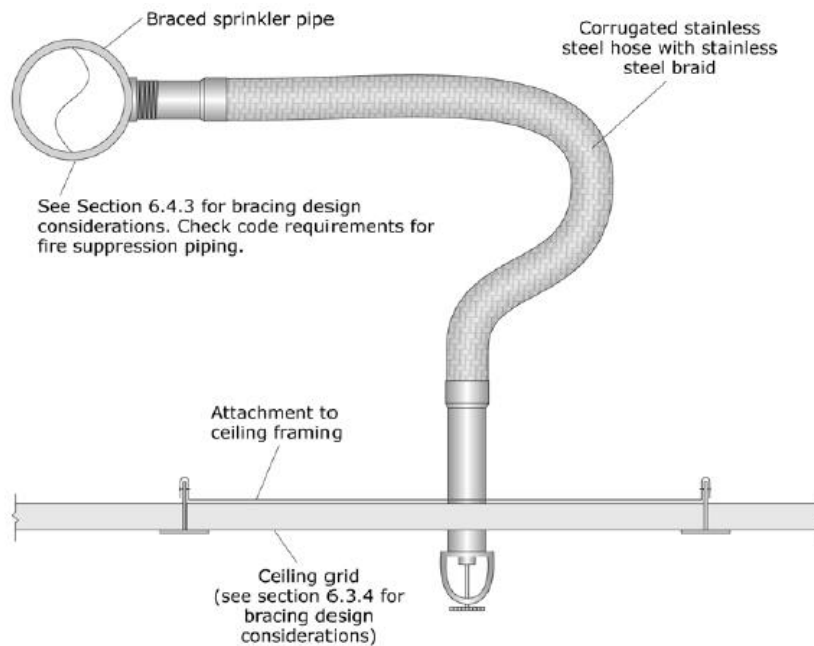

Note: for seismic design category D, E & F, the flexible sprinkler hose fitting must accommodate at least 1" of ceiling movement without use of an oversized opening. Alternatively, the sprinkler head must have a 2" oversize ring or adapter that allows 1" movement in all directions.

Figure G-1. Flexible Sprinkler Drop.

(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

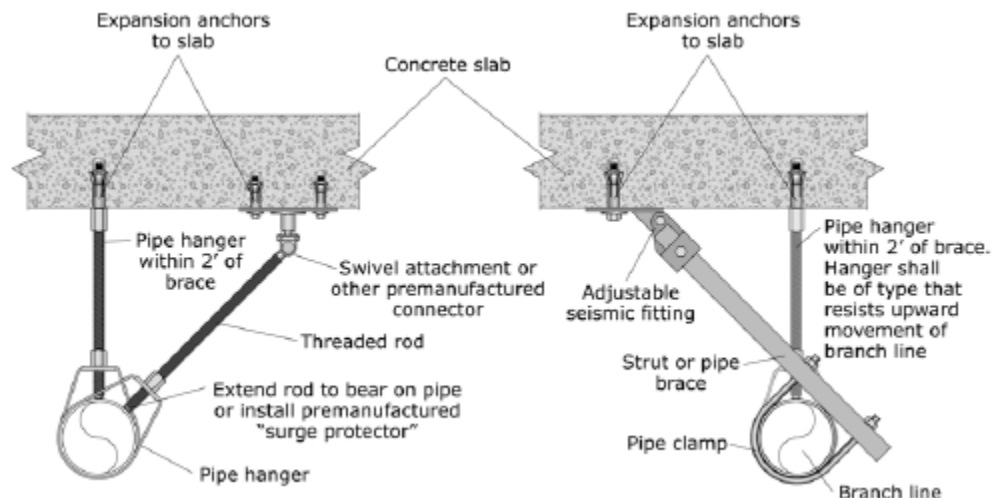


Figure G-2. End of Line Restraint.

(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

Partitions

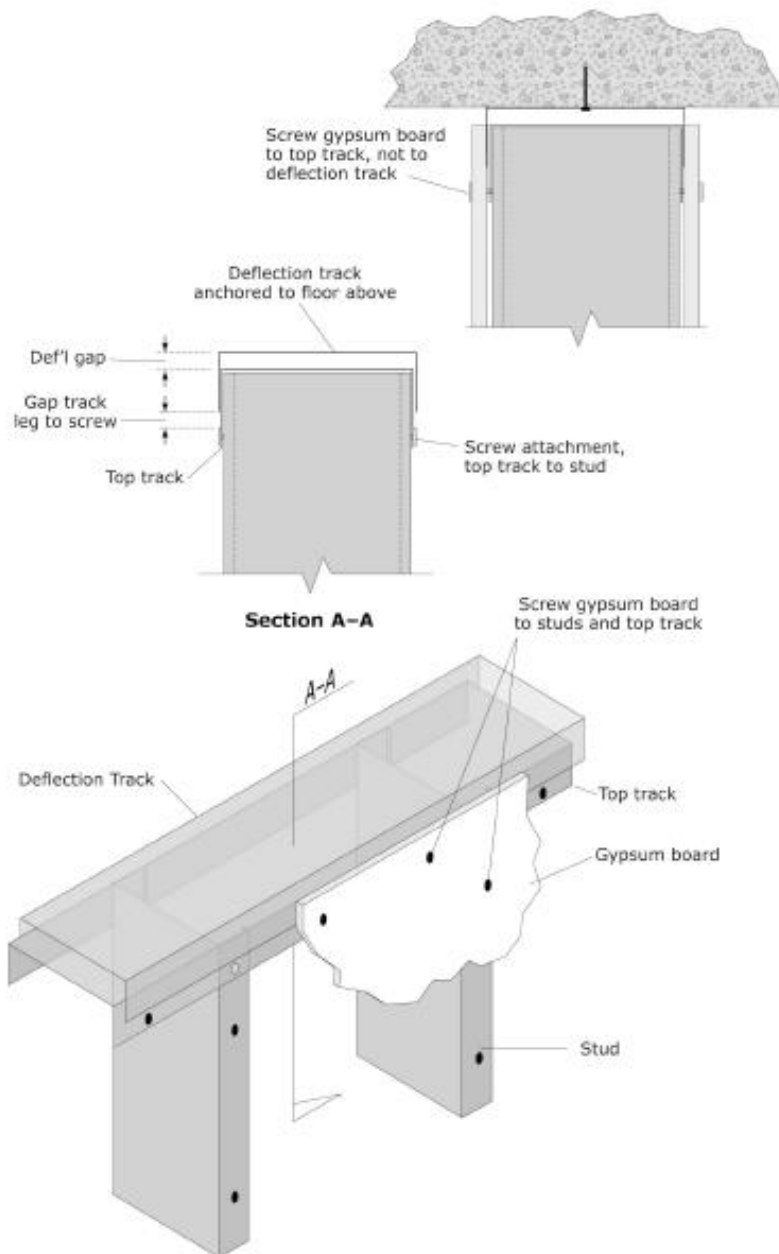


Figure G-3. Mitigation Schemes for Bracing the Tops of Metal Stud Partitions Walls.
(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

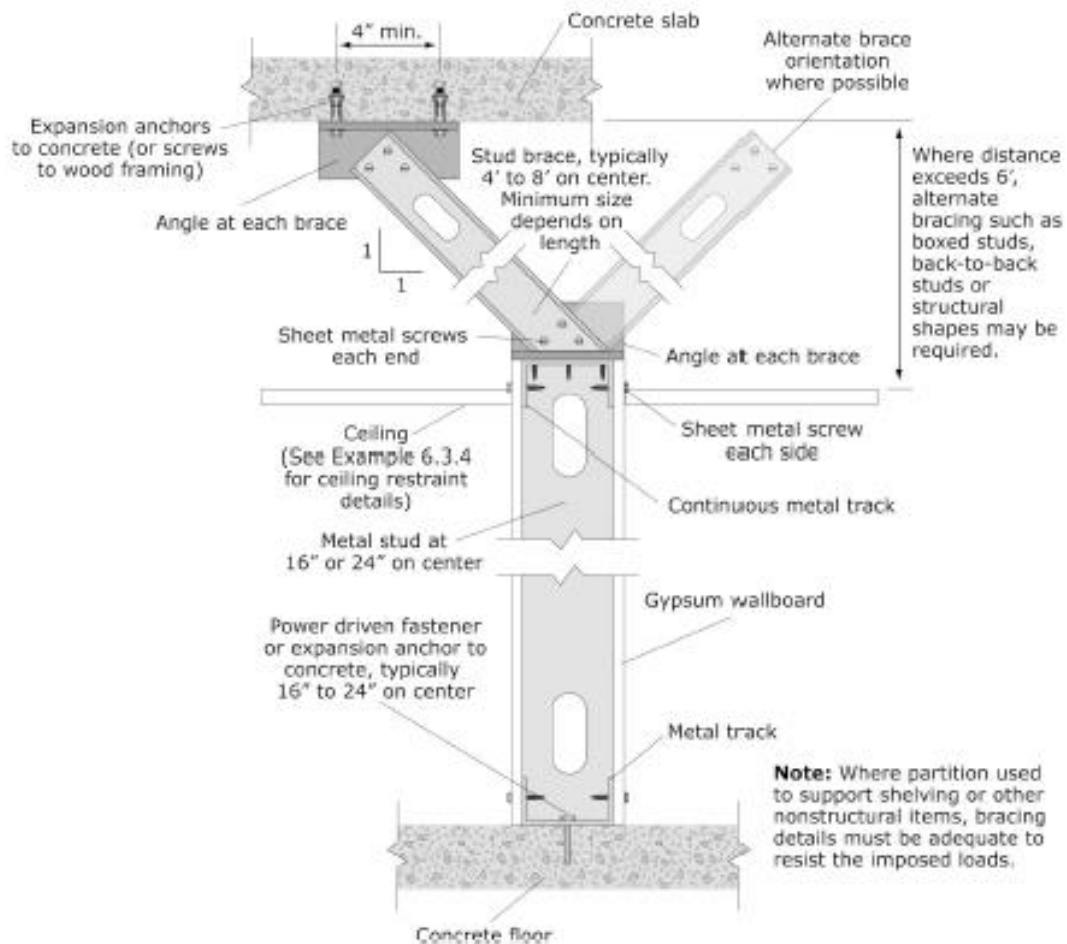


Figure G-4. Mitigation Schemes for Bracing the Tops of Metal Stud Partition Walls.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

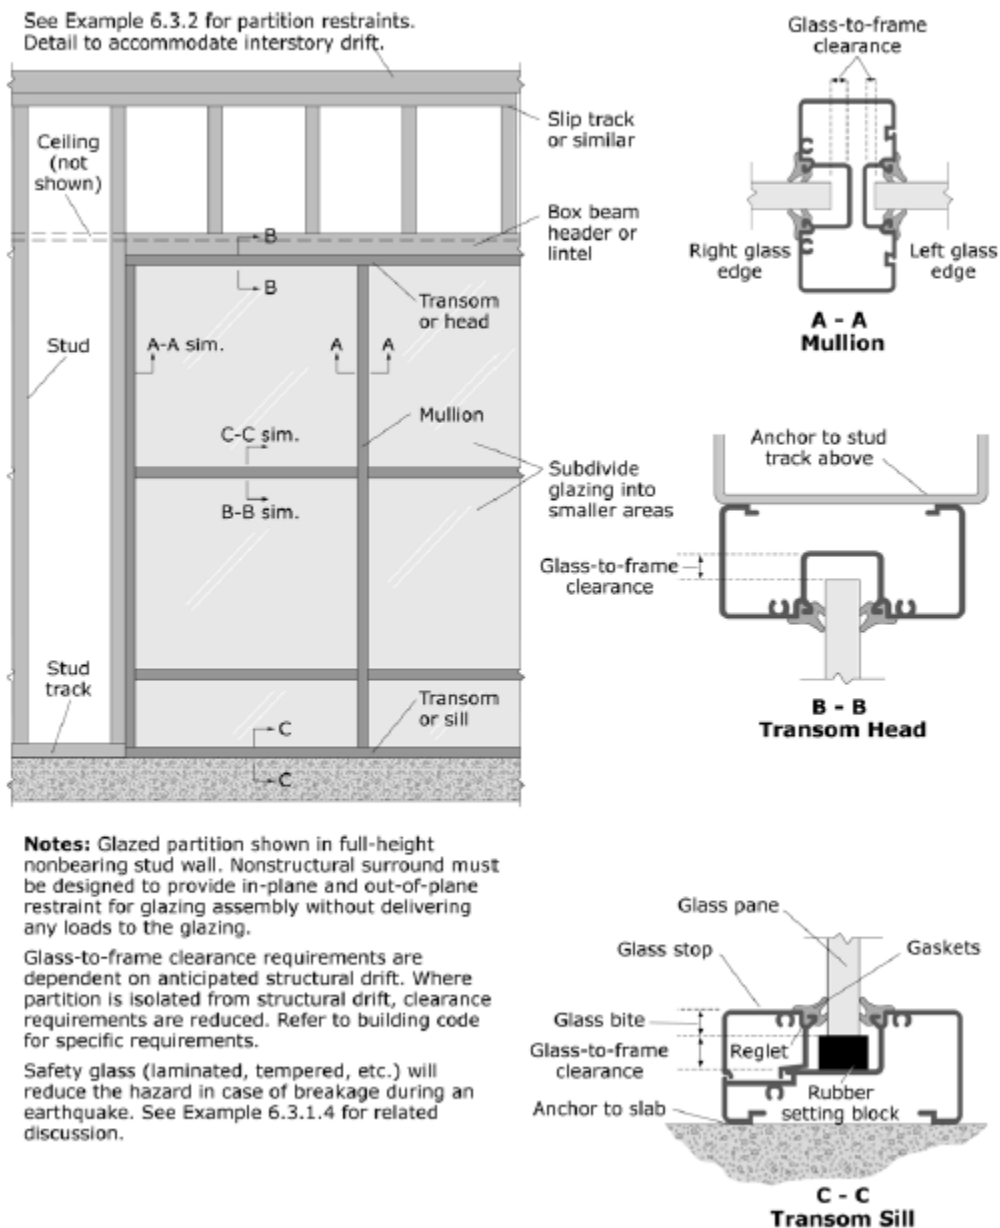


Figure G-5. Full-height Glazed Partition.

(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

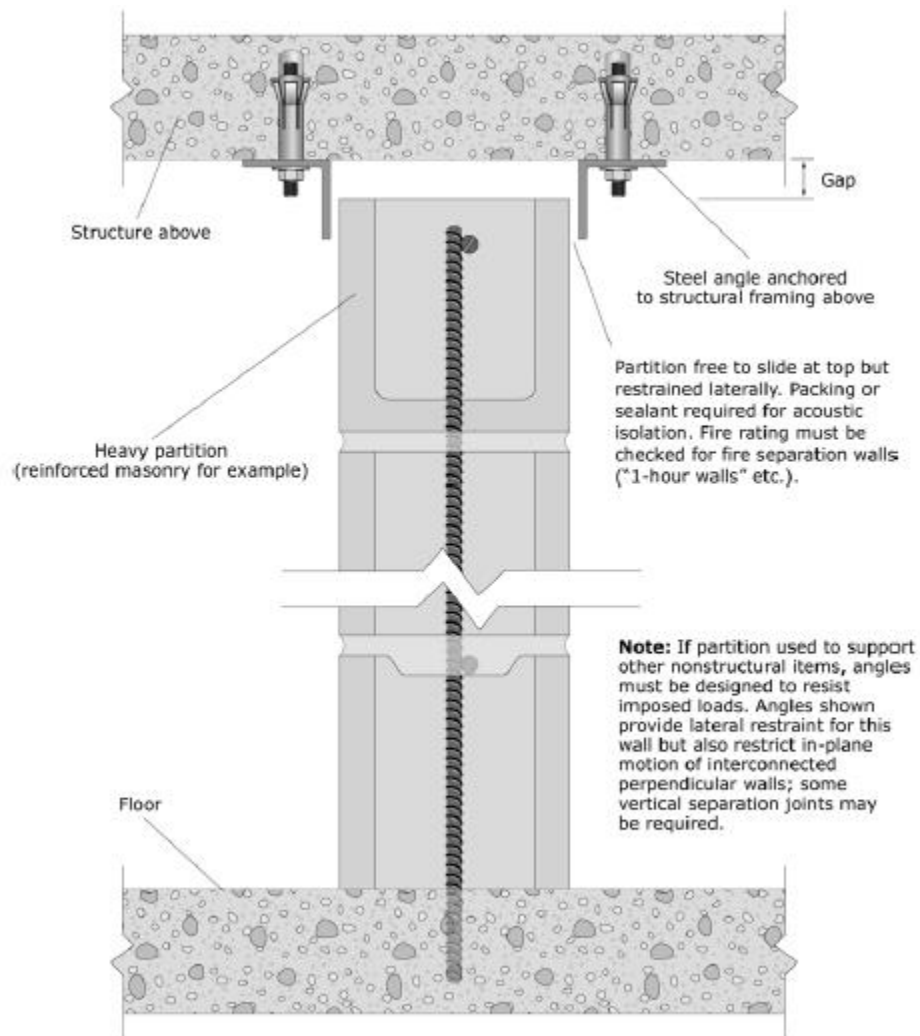


Figure G-6. Full-height Heavy Partition.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

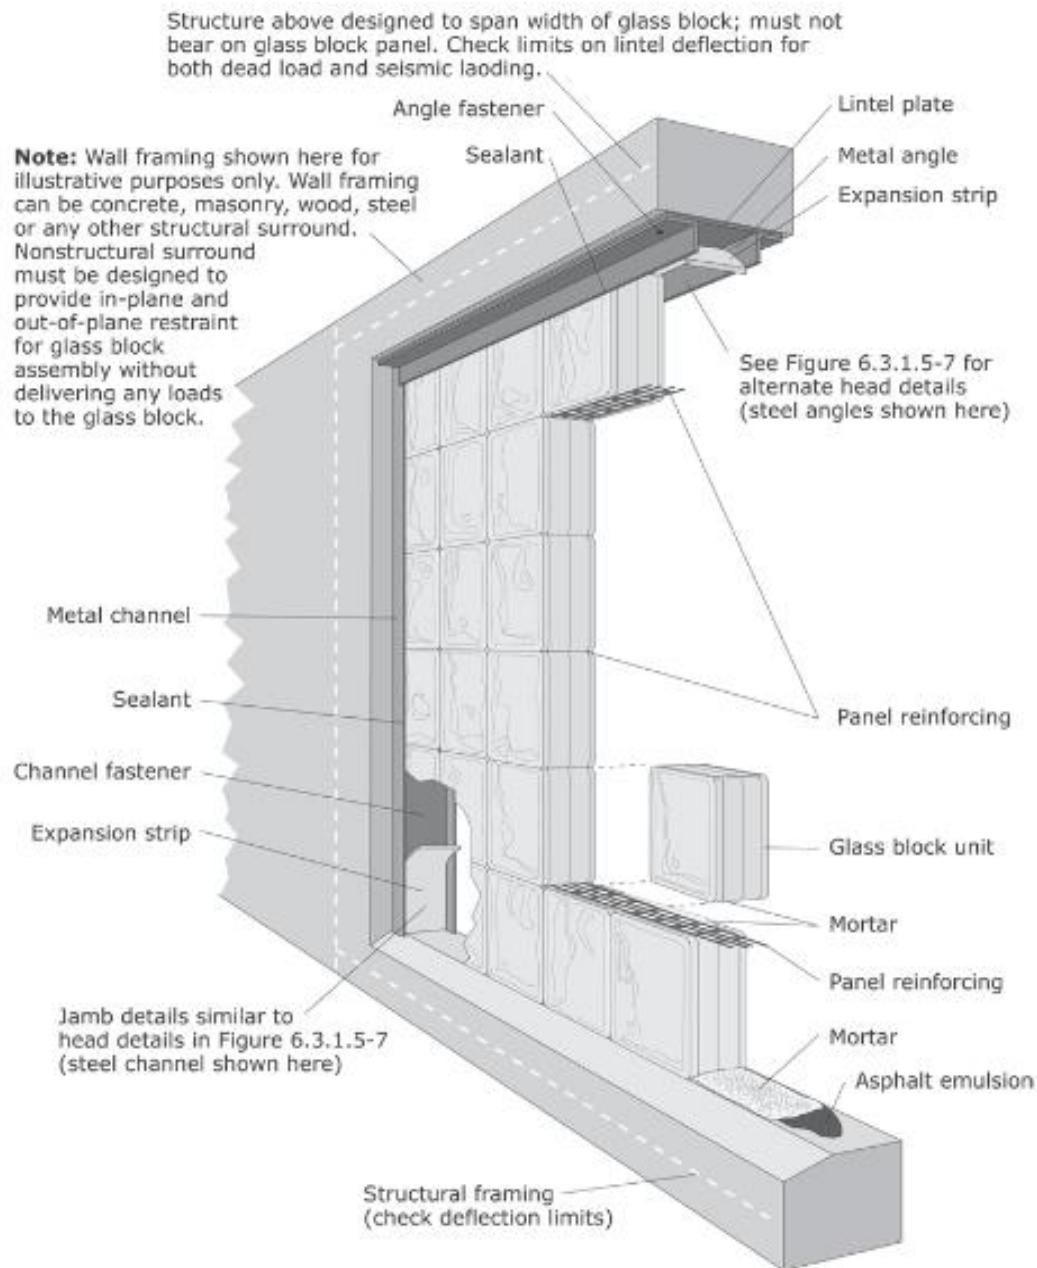


Figure G-7. Typical Glass Block Panel Details.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

Ceilings


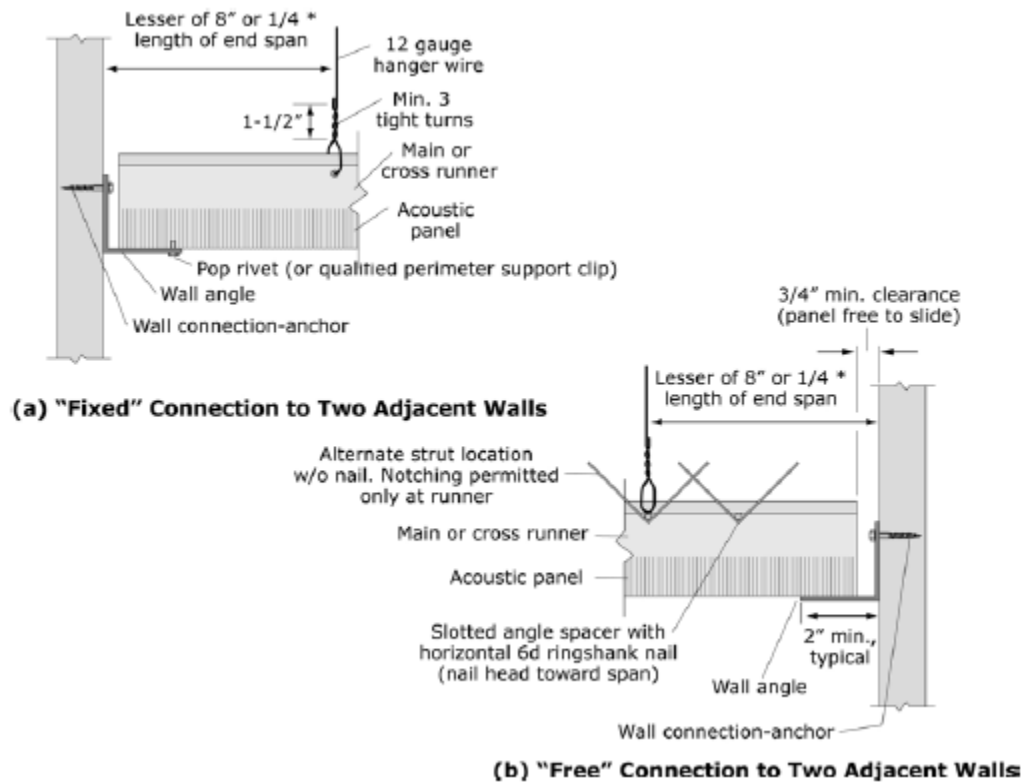


Figure G-8. Suspension System for Acoustic Lay-in Panel Ceilings – Edge Conditions.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

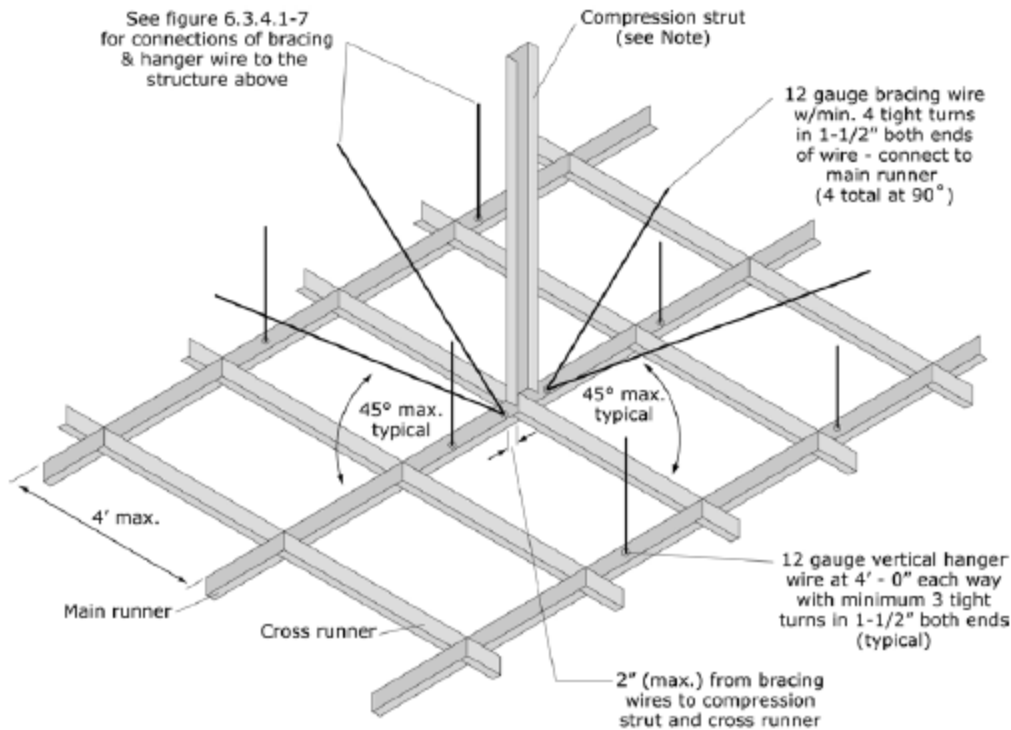

Note: Compression strut shall not replace hanger wire. Compression strut consists of a steel section attached to main runner with 2 - #12 sheet metal screws and to structure with 2 - #12 screws to wood or 1/4" min. expansion anchor to structure. Size of strut is dependent on distance between ceiling and structure ($l/r \leq 200$). A 1" diameter conduit can be used for up to 6'; a 1-5/8" X 1-1/4" metal stud can be used for up to 10'

Per DSA IR 25-5, ceiling areas less than 144 sq. ft. or fire rated ceilings less than 96 sq. ft., surrounded by walls braced to the structure above do not require lateral bracing assemblies when they are attached to two adjacent walls. (ASTM E580 does not require lateral bracing assemblies for ceilings less than 1000 sq. ft.; see text.)

Figure G-9. Suspension System for Acoustic Lay-in Panel Ceilings – General Bracing Assembly.
(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

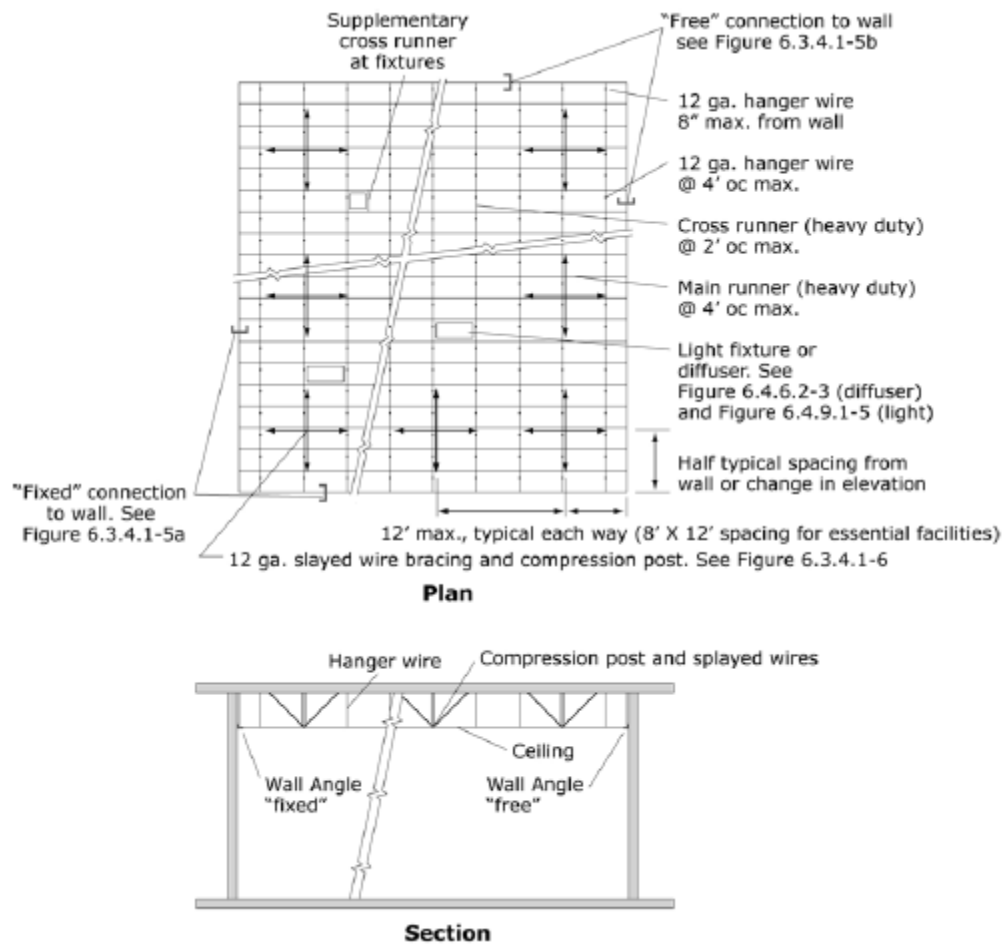


Figure G-10. Suspension System for Acoustic Lay-in Panel Ceilings – General Bracing Layout.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)



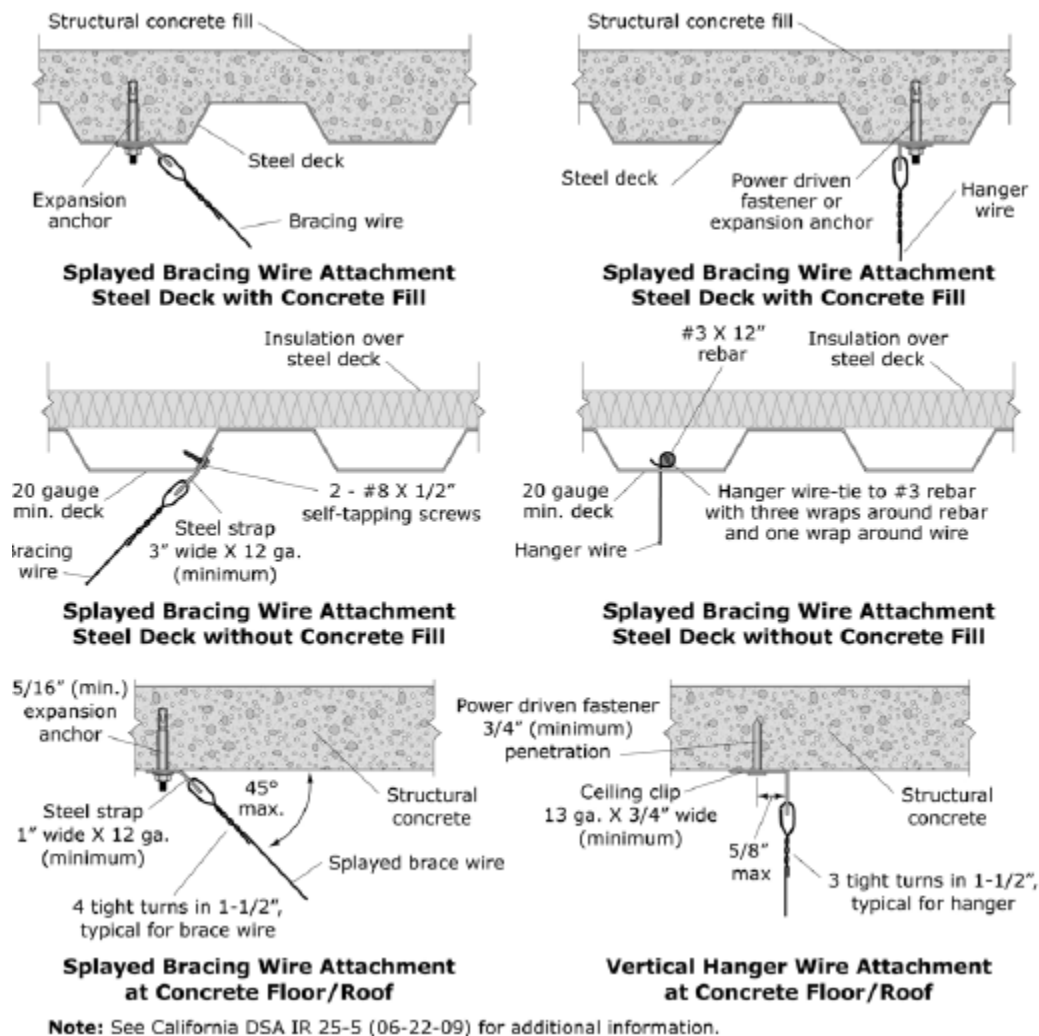


Figure G-11. Suspension System for Acoustic Lay-in Panel Ceilings – Overhead Attachment Details.

(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

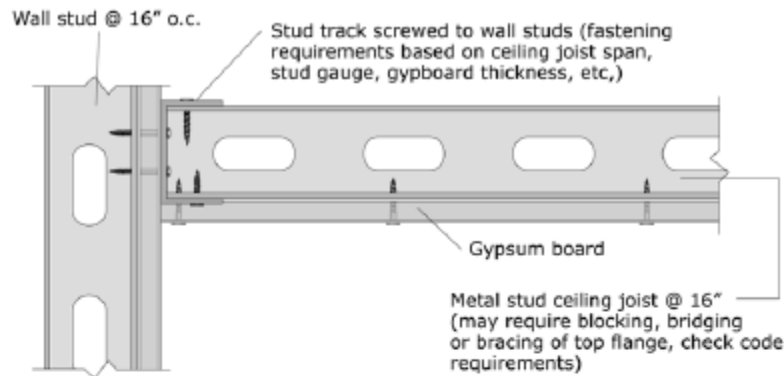

a) Gypsum board attached directly to ceiling joists

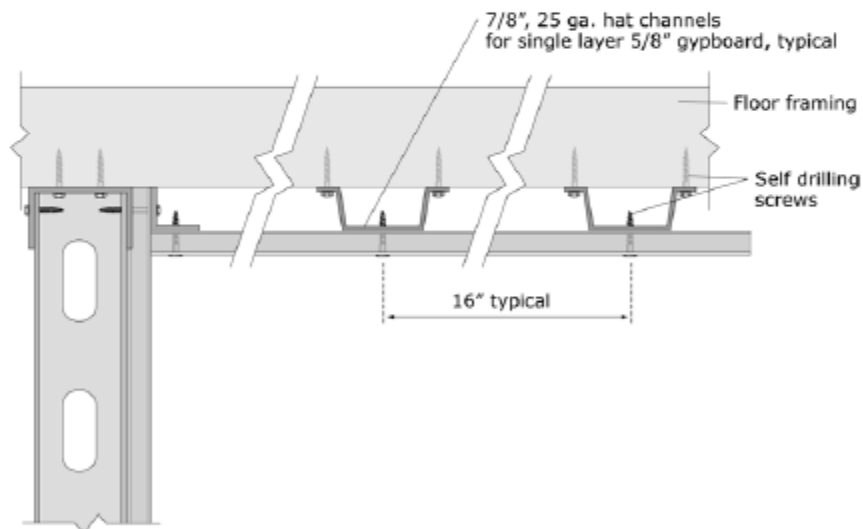

b) Gypsum board attached directly to furring strips (hat channel or similar)

Note: Commonly used details shown; no special seismic details are required as long as furring and gypboard secured. Check for certified assemblies (UL listed, FM approved, etc.) if fire or sound rating required.

Figure G-12. Gypsum Board Ceiling Applied Directly to Structure.
(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

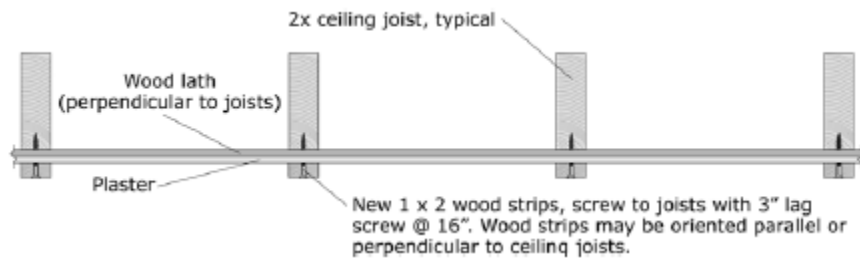


Figure G-13. Retrofit Detail for Existing Lath and Plaster.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)



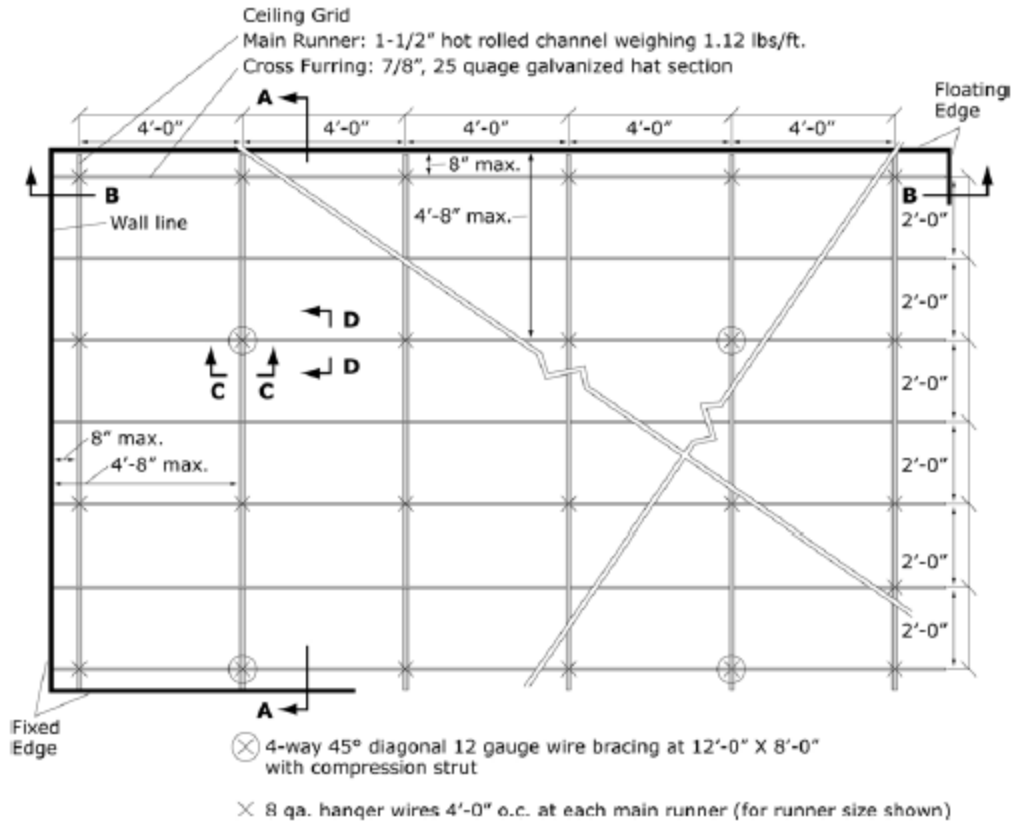


Figure G-14. Diagrammatic View of Suspended Heavy Ceiling Grid and Lateral Bracing.
(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

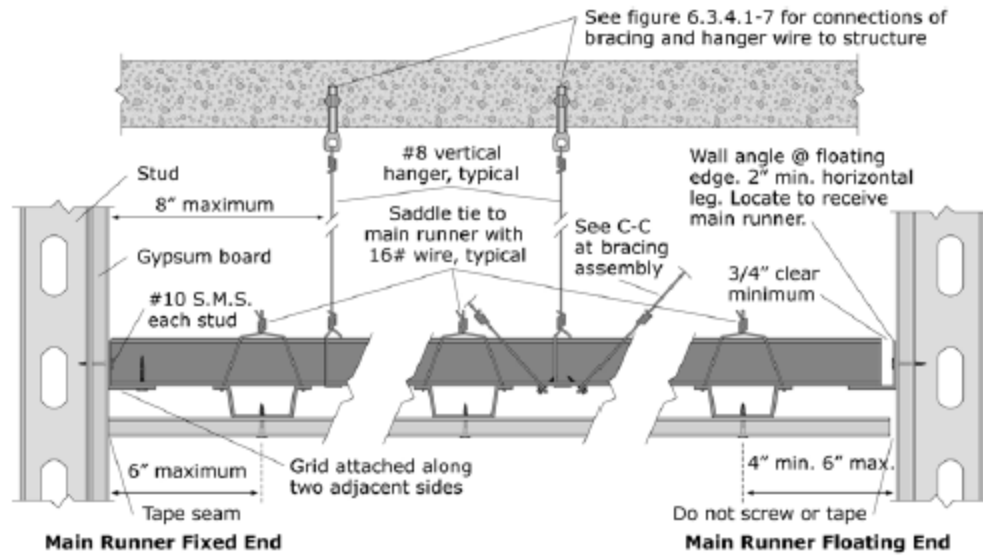


A-A Main Runner at Perimeter

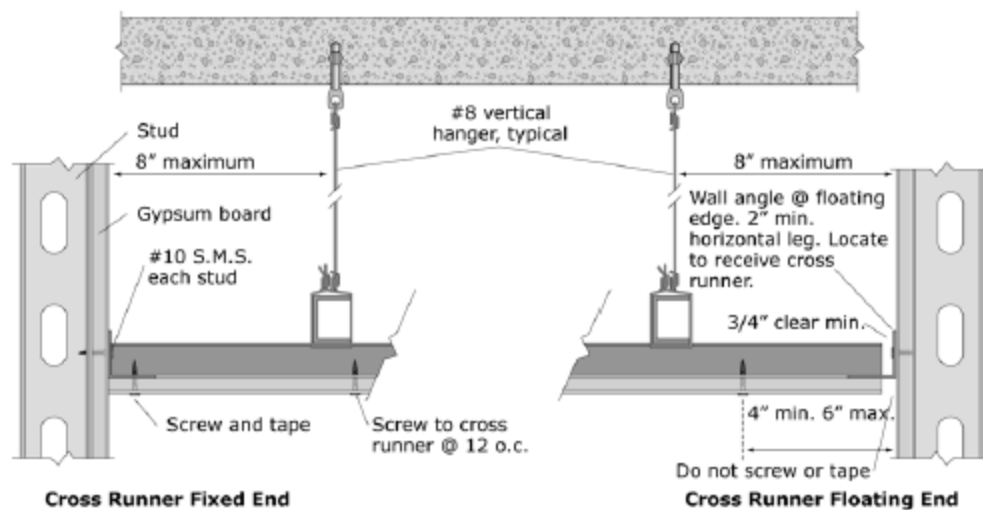

B-B Cross Runner at Perimeter

Figure G-15. Perimeter Details for Suspended Gypsum Board Ceiling.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

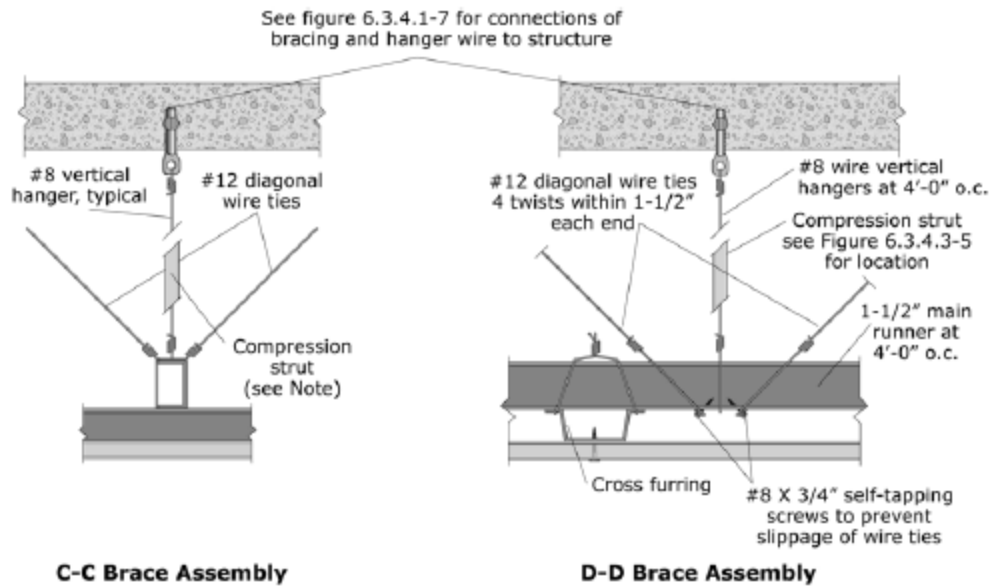

Note: Compression strut shall not replace hanger wire. Compression strut consists of a steel section attached to main runner with 2 - #12 sheet metal screws and to structure with 2 - #12 screws to wood or 1/4" min. expansion anchor to concrete. Size of strut is dependent on distance between ceiling and structure ($l/r \leq 200$). A 1" diameter conduit can be used for up to 6', a 1-5/8" X 1-1/4" metal stud can be used for up to 10'. See figure 6.3.4.1-6 for example of bracing assembly.

Figure G-16. Details for Lateral Bracing Assembly for Suspended Gypsum Board Ceiling.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

Light Fixtures

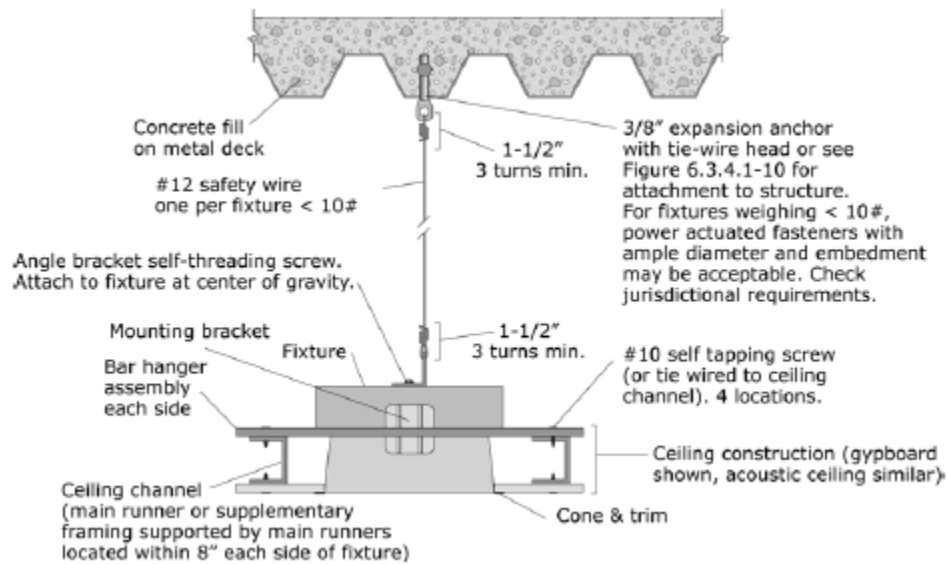


Figure G-17. Recessed Light Fixture in suspended Ceiling (Fixture Weight < 10 pounds).
(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

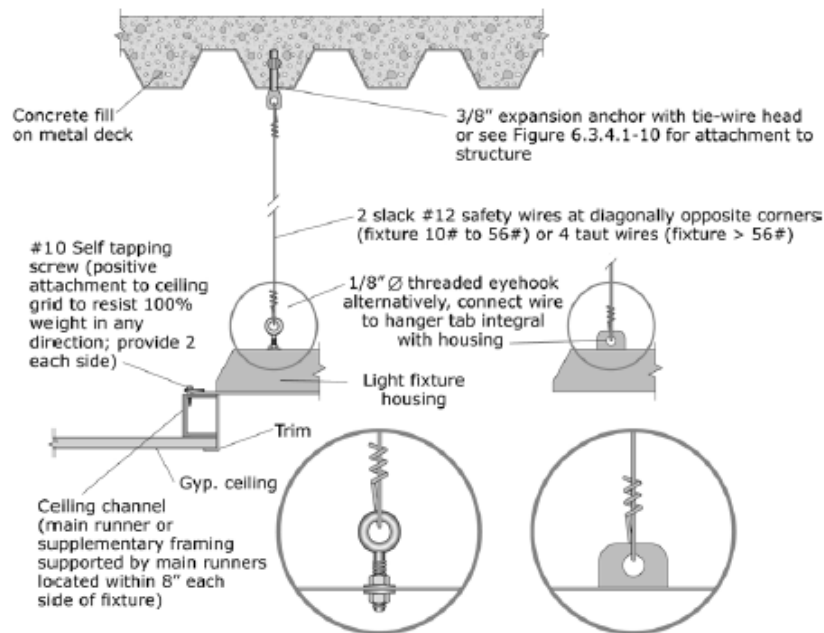


Figure G-18. Recessed Light Fixture in suspended Ceiling (Fixture Weight 10 to 56 pounds).
(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

Contents and Furnishings


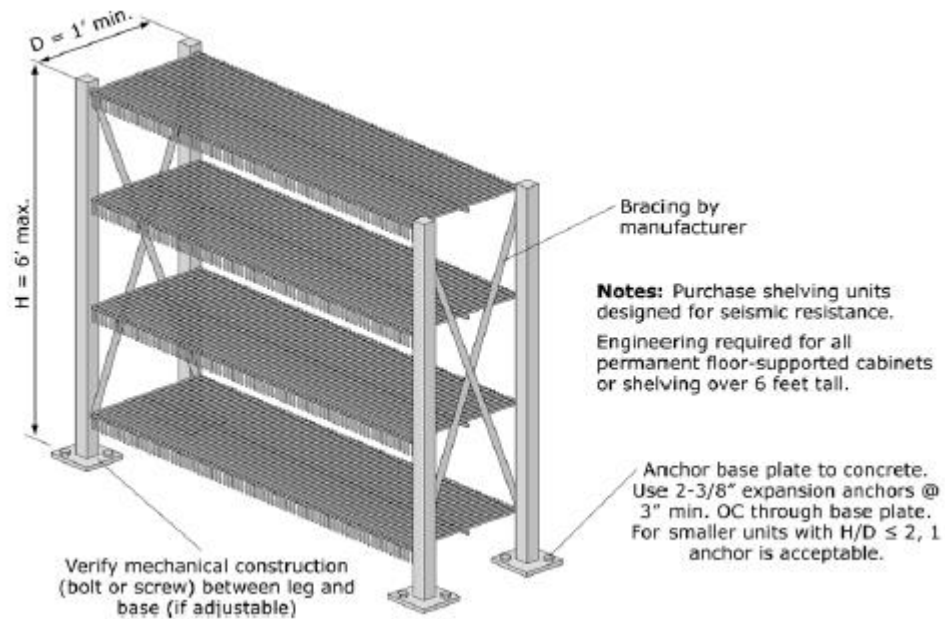


Figure G-19. Light Storage Racks.
(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

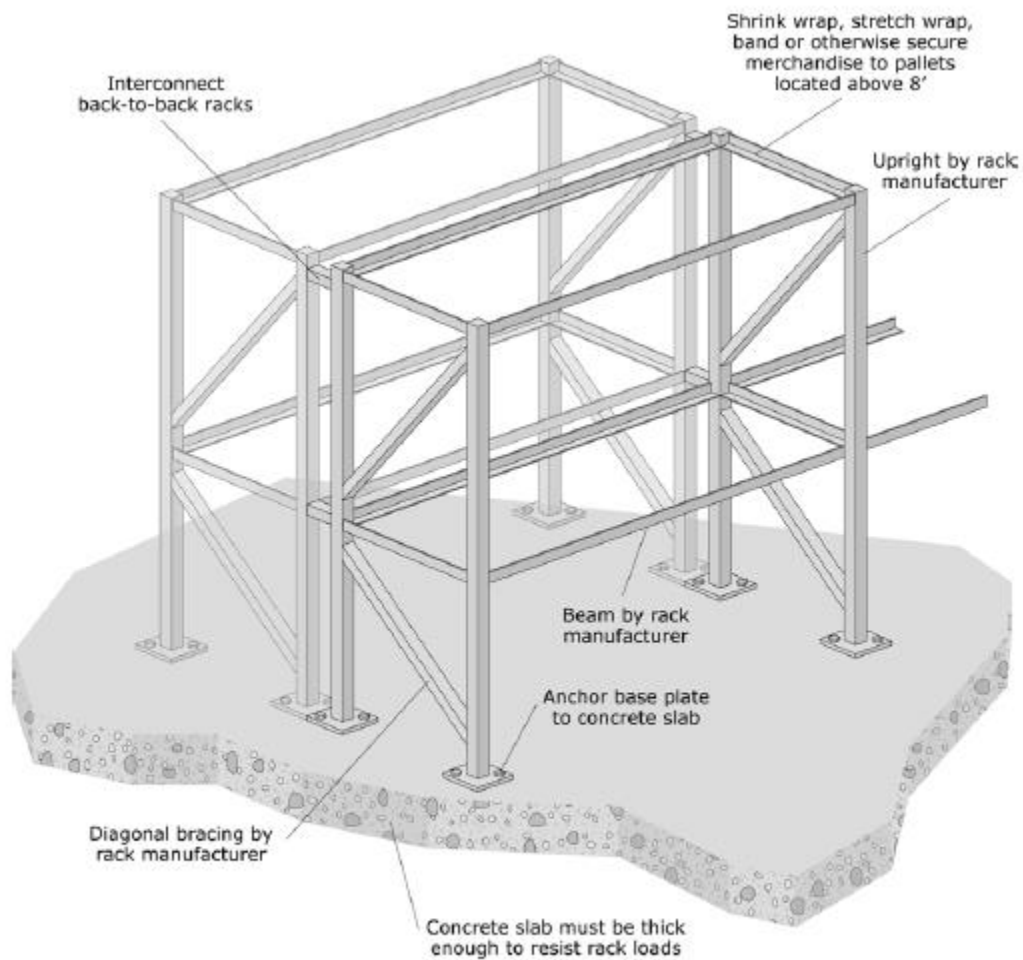

Note: Purchase storage racks designed for seismic resistance. Storage racks may be classified as either nonstructural elements or nonbuilding structures depending upon their size and support conditions. Check the applicable code to see which provisions apply.

Figure G-20. Industrial Storage Racks.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

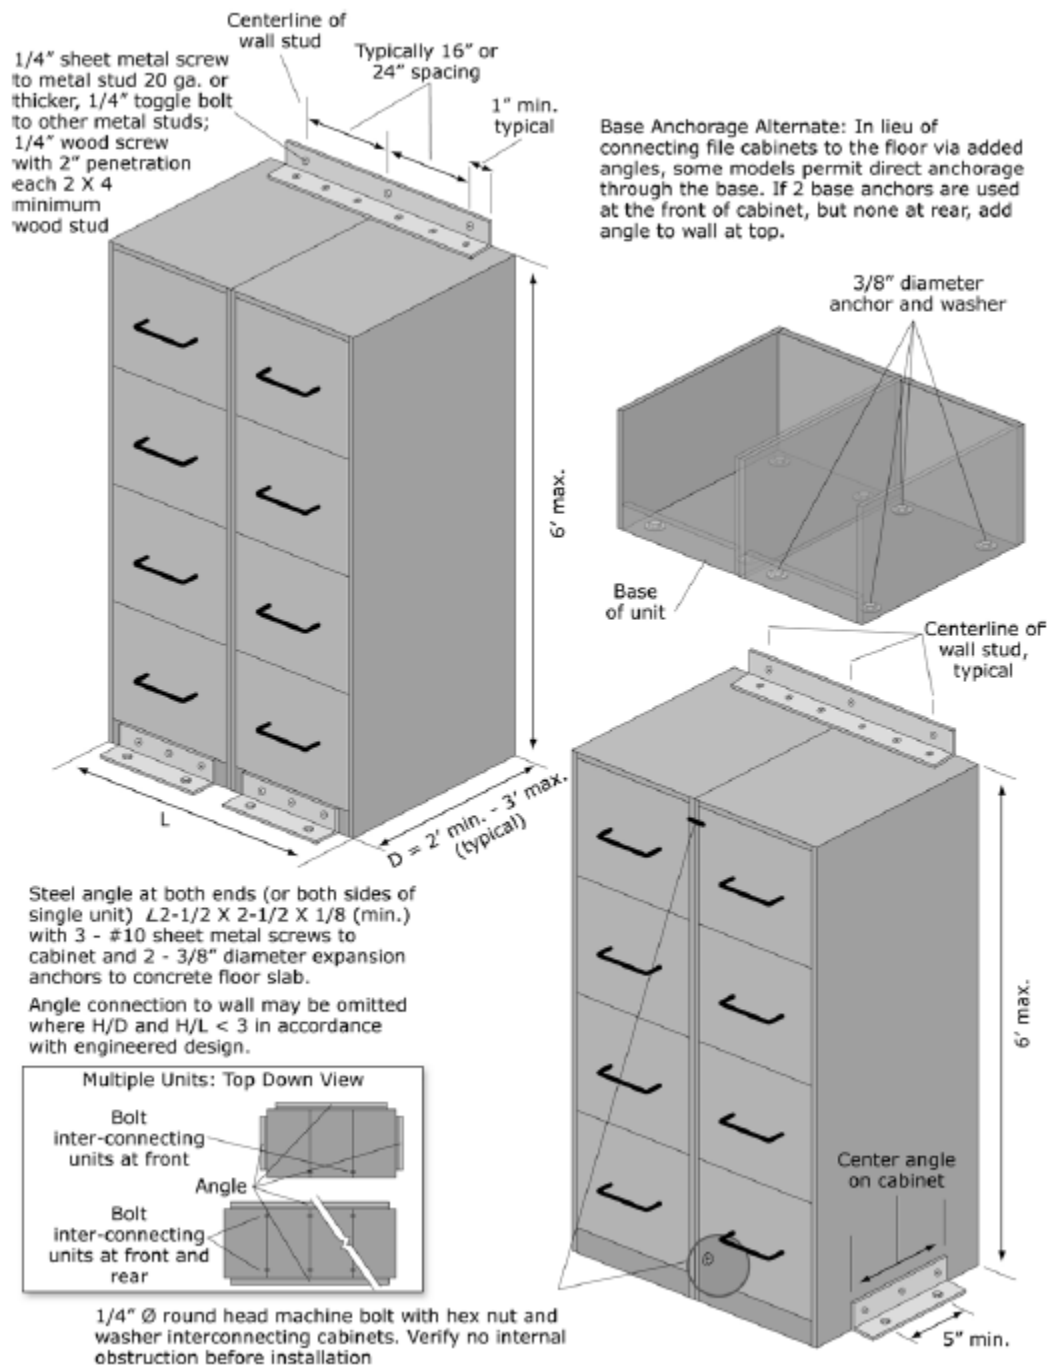


Figure G-21. Wall-mounted File Cabinets.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)


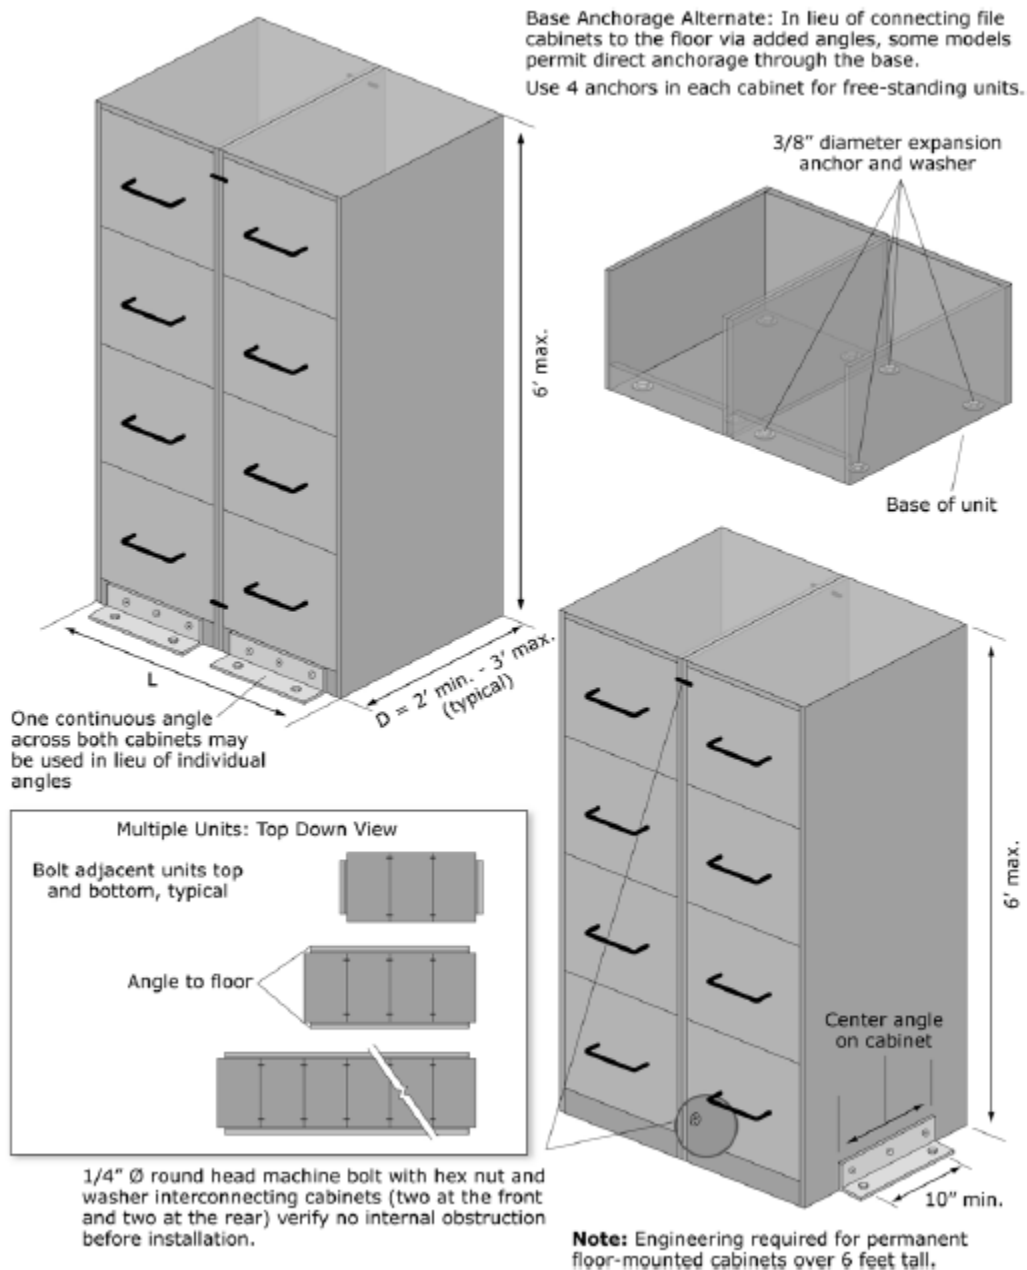


Figure G-22. Base Anchored File Cabinets.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

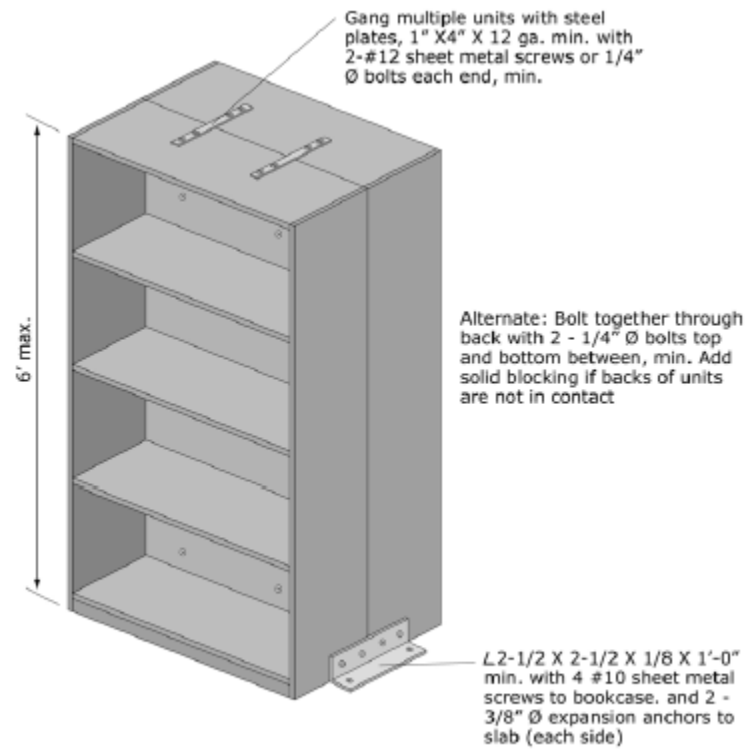

Note: Engineering required for all permanent floor-supported cabinets or shelving over 6 feet tall. Details shown are adequate for typical shelving 6 feet or less in height.

Figure G-23. Anchorage of Freestanding Book Cases Arranged Back to Back.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)



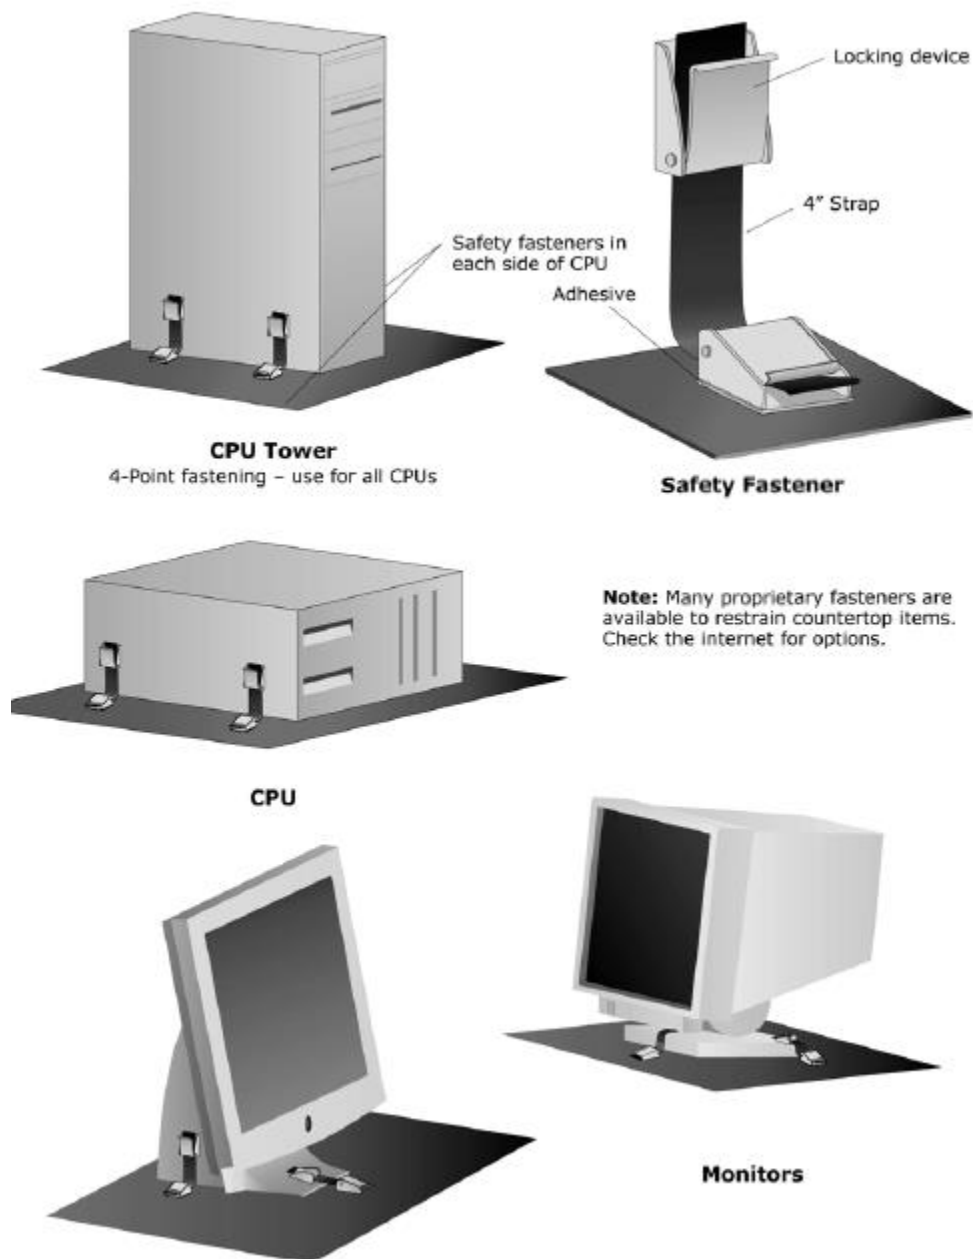


Figure G-24. Desktop Computers and Accessories.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

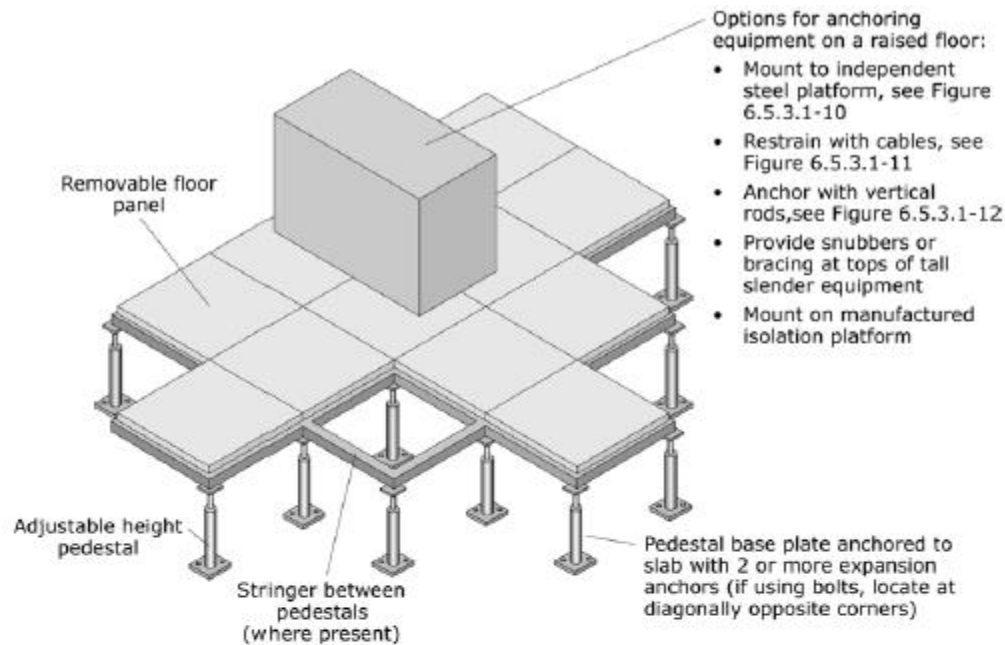


Cantilevered Access Floor Pedestal

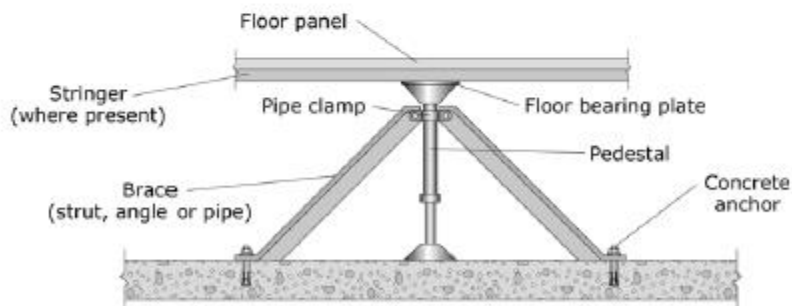

Braced Access Floor Pedestal
(use for tall floors or where pedestals are not strong enough to resist seismic forces)


Note: For new floors in areas of high seismicity, purchase and install systems that meet the applicable code provisions for "special access floors."

Figure G-25. Equipment Mounted on Access Floor.
(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

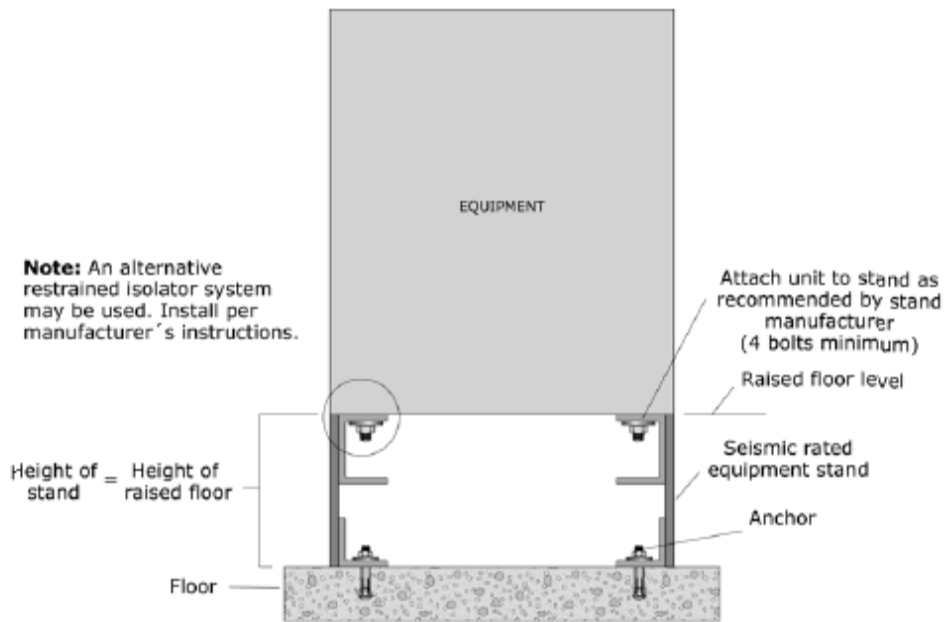


Equipment installed on an independent steel platform within a raised floor

Figure G-26. Equipment Mounted on Access Floor – Independent Base.
(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

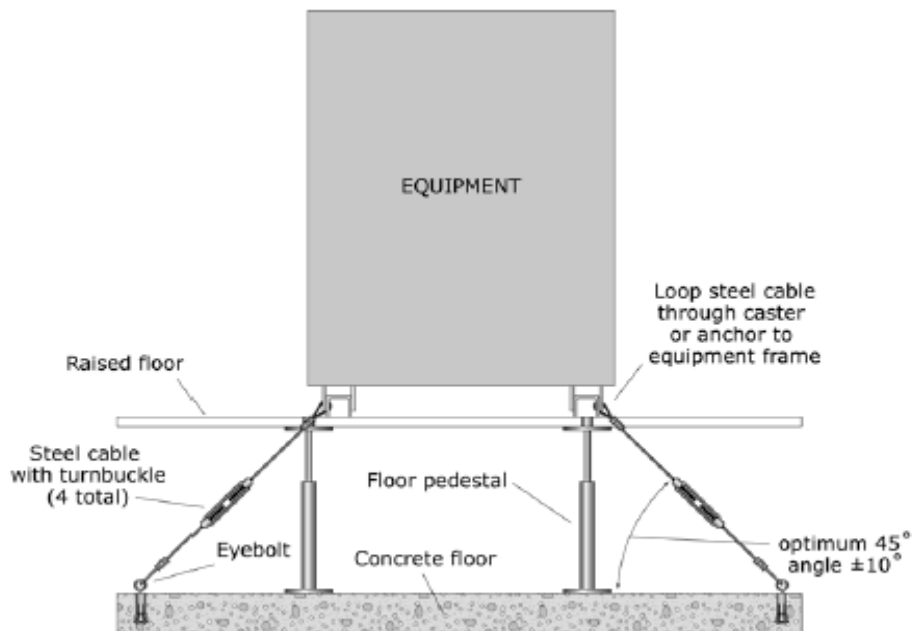

Equipment restrained with cables beneath a raised floor


Figure G-27. Equipment Mounted on Access Floor – Cable Braced.
(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

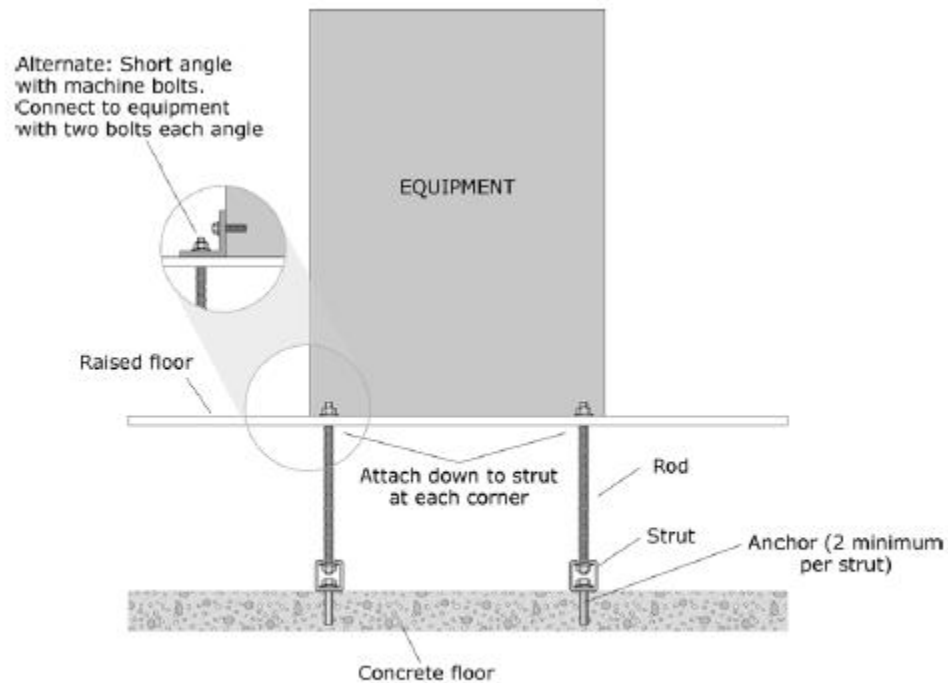

Equipment anchored with vertical rods beneath a raised floor


Figure G-28. Equipment Mounted on Access Floor – Tie-down Rods.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

Mechanical and Electrical Equipment

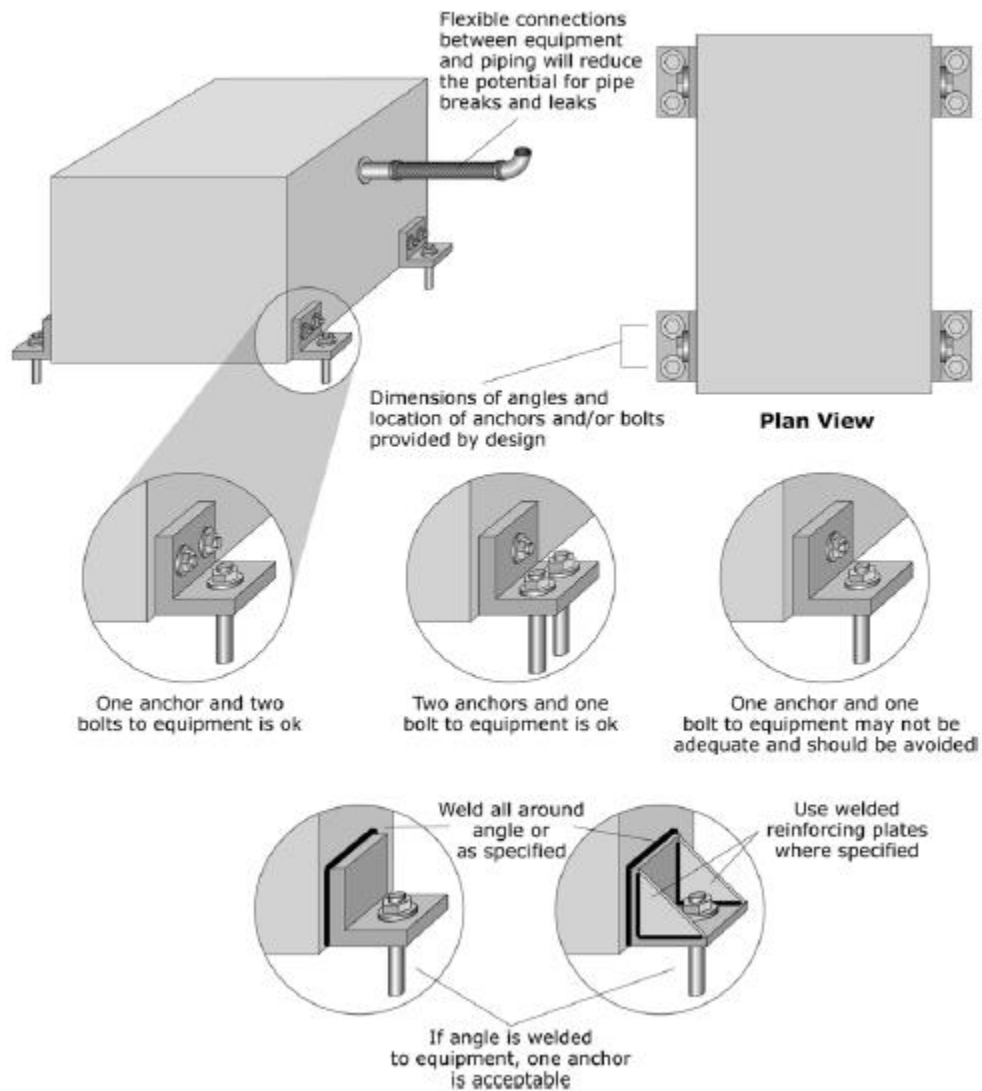


Note: Rigidly mounted equipment shall have flexible connections for the fuel lines and piping.


Figure G-29. Rigidly Floor-mounted Equipment with Added Angles.
(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

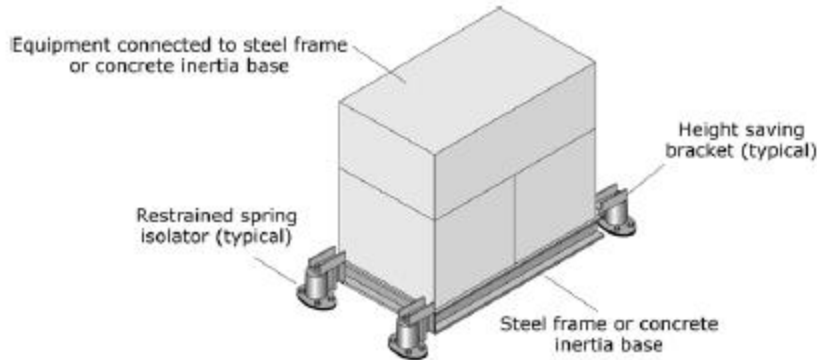

Supplemental base with restrained spring isolators

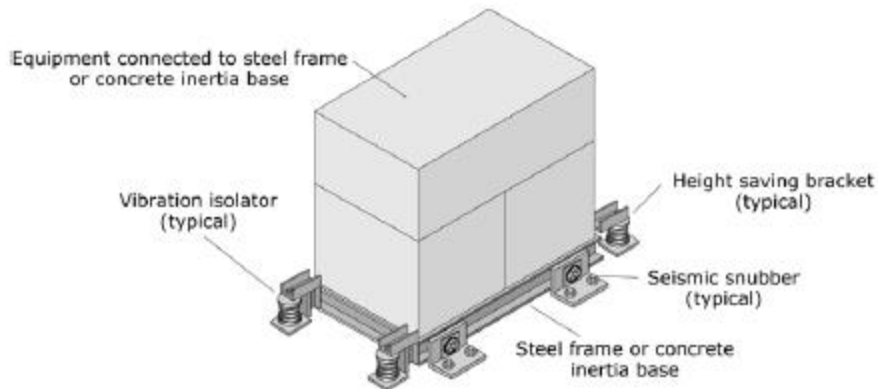

Supplemental base with open springs and all-directional snubbers

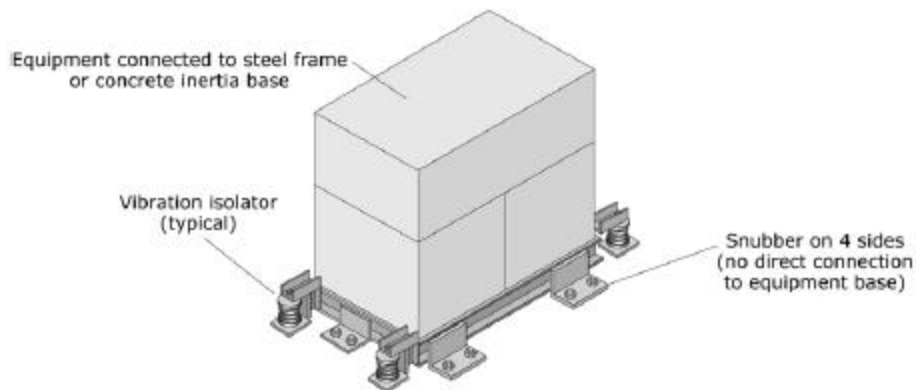

Supplemental base with open springs and one-directional snubbers

Figure G-30. HVAC Equipment with Vibration Isolation.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

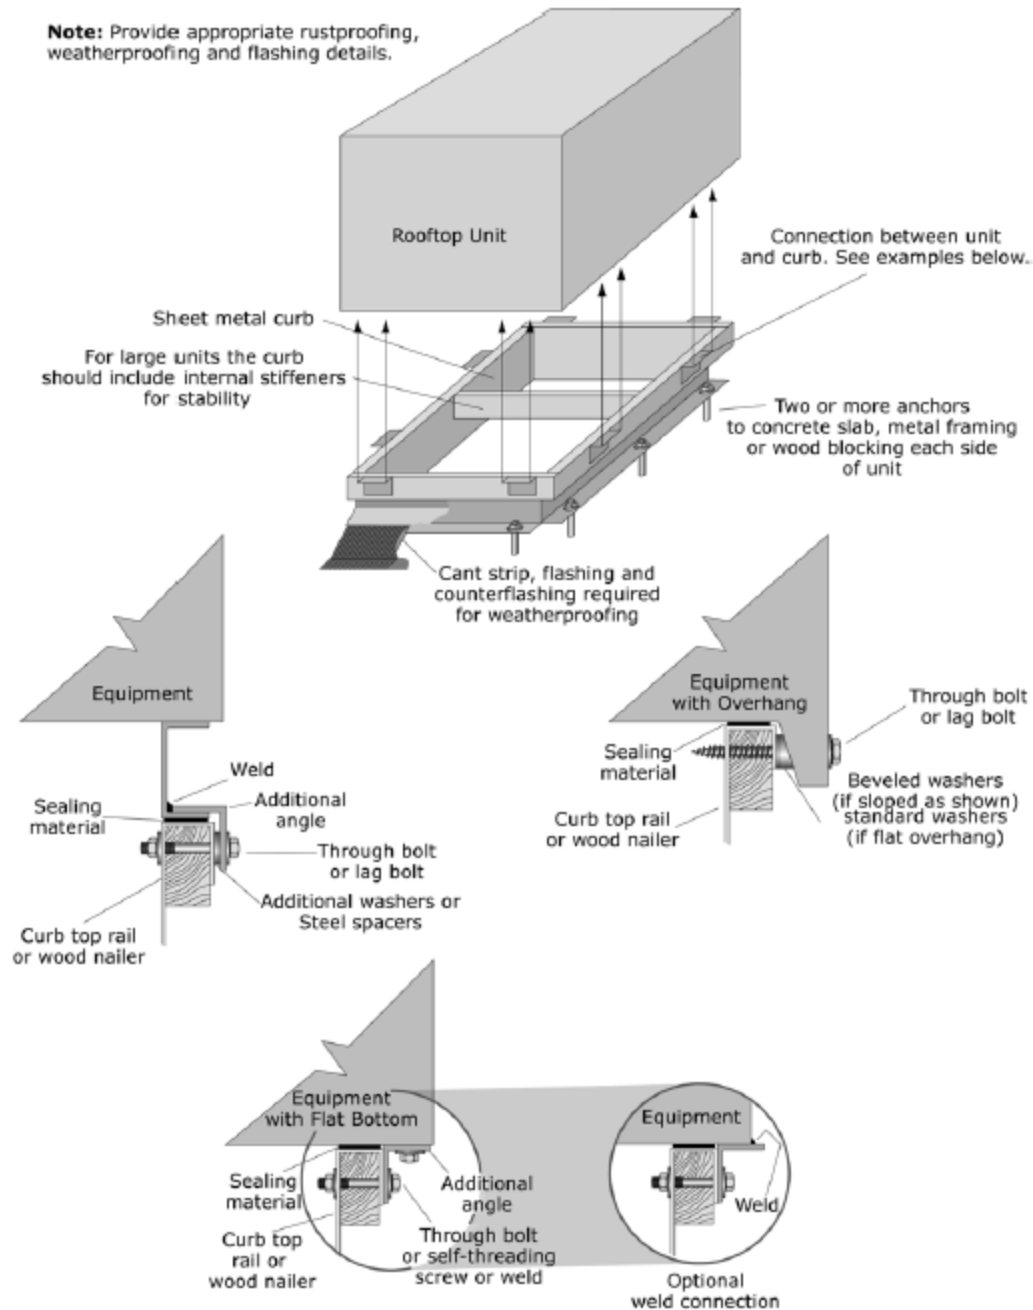


Figure G-31. Rooftop HVAC Equipment.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

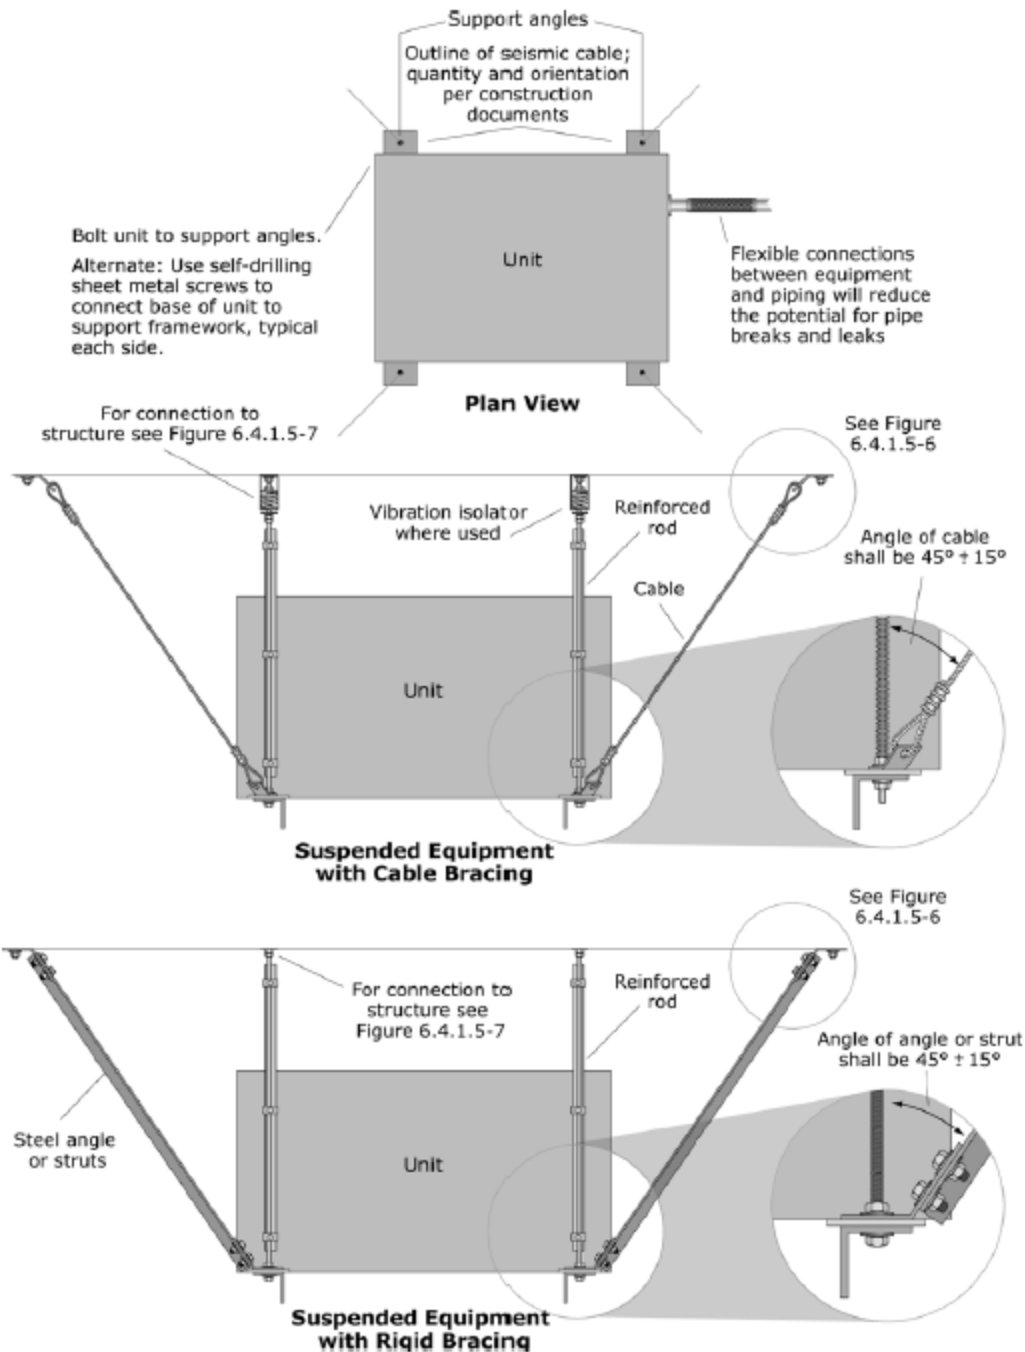


Figure G-32. Suspended Equipment.
 (FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

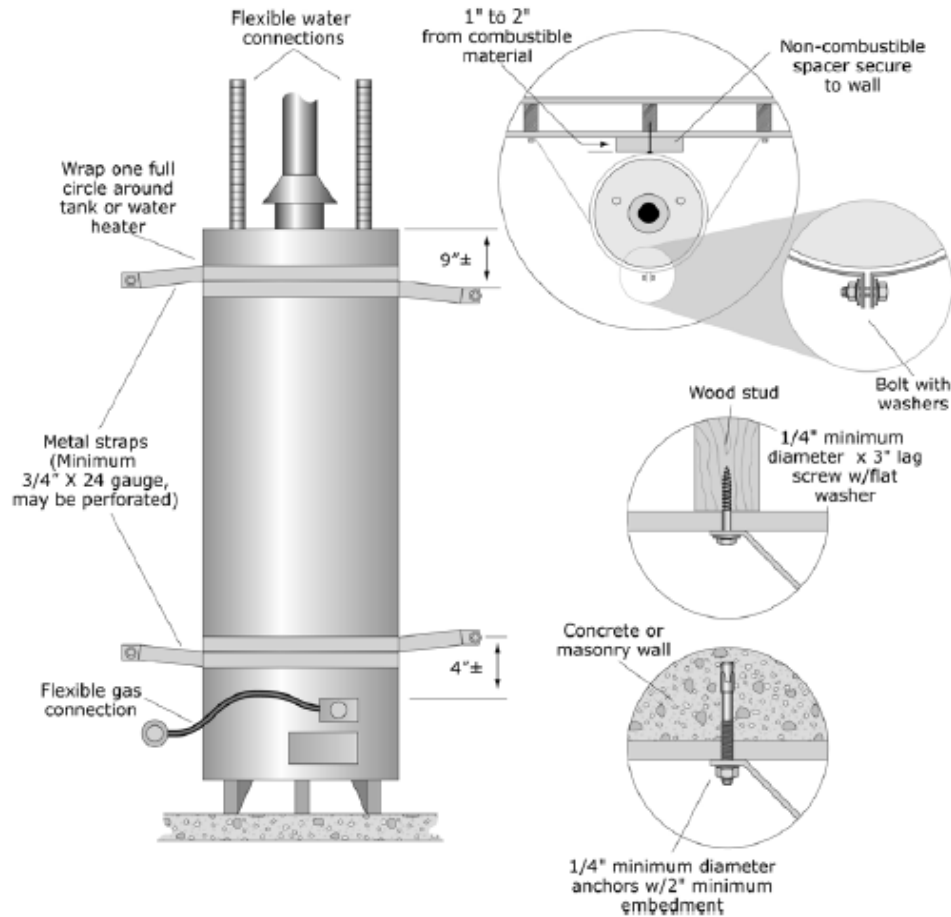


Figure G-33. Water Heater Strapping to Backing Wall.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

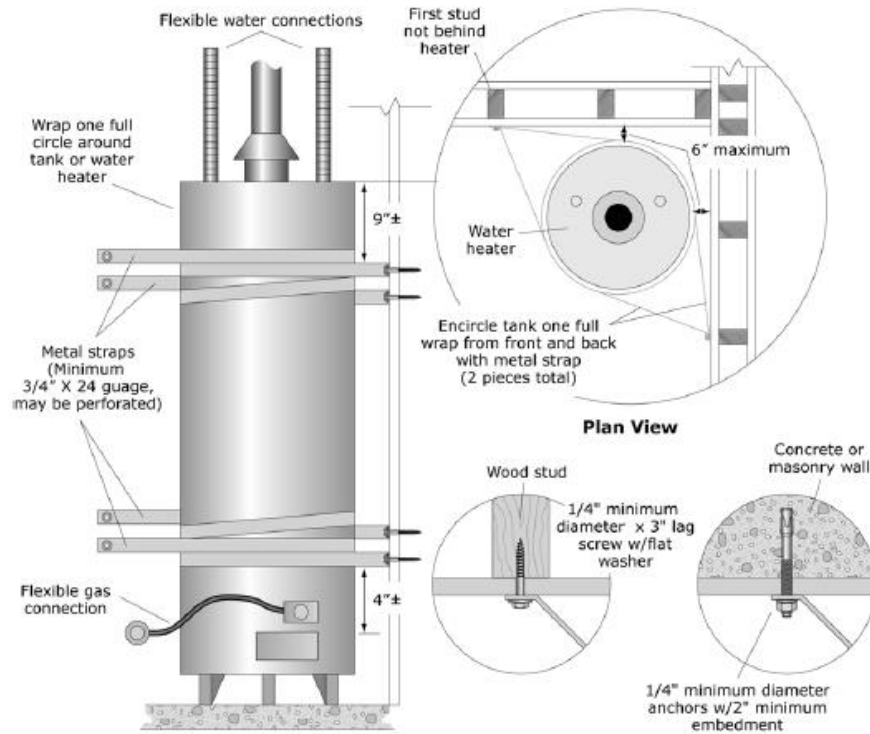


Figure G-34. Water Heater – Strapping at Corner Installation.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

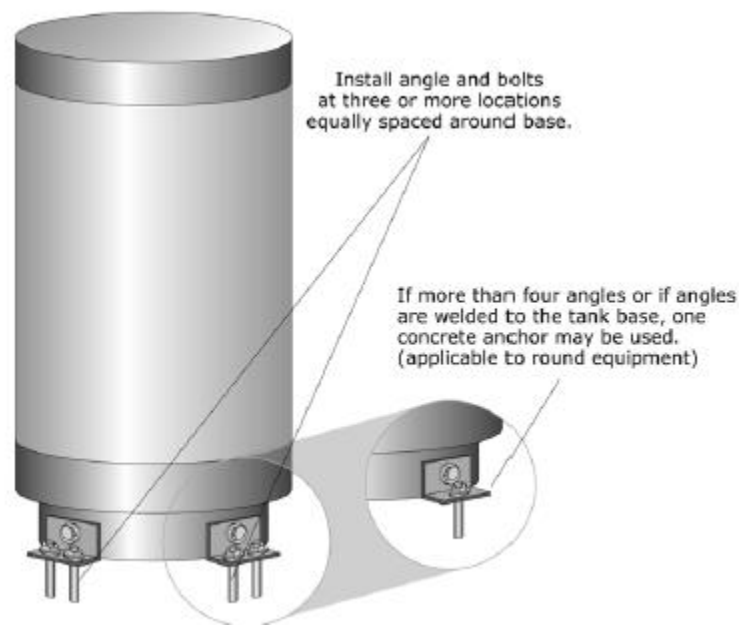


Figure G-35. Water Heater – Base Mounted.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

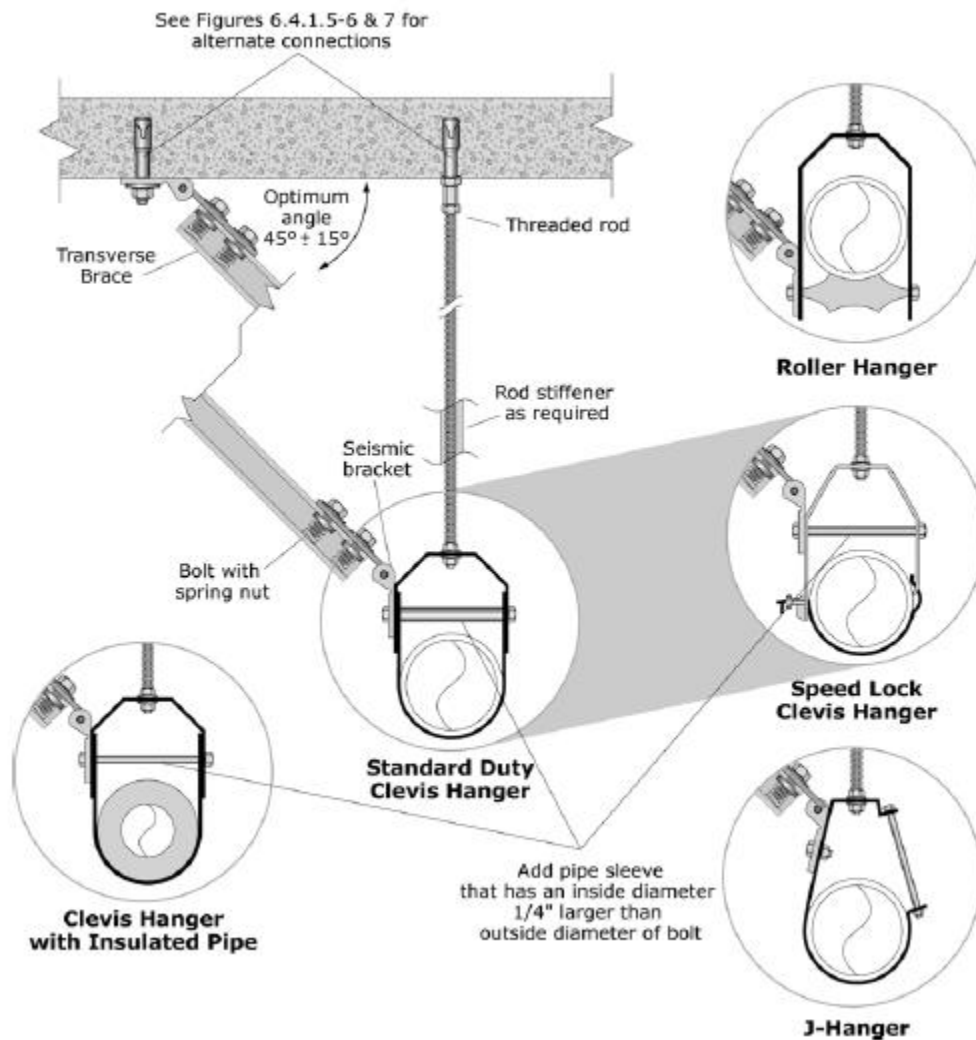


Figure G-36. Rigid Bracing – Single Pipe Transverse.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

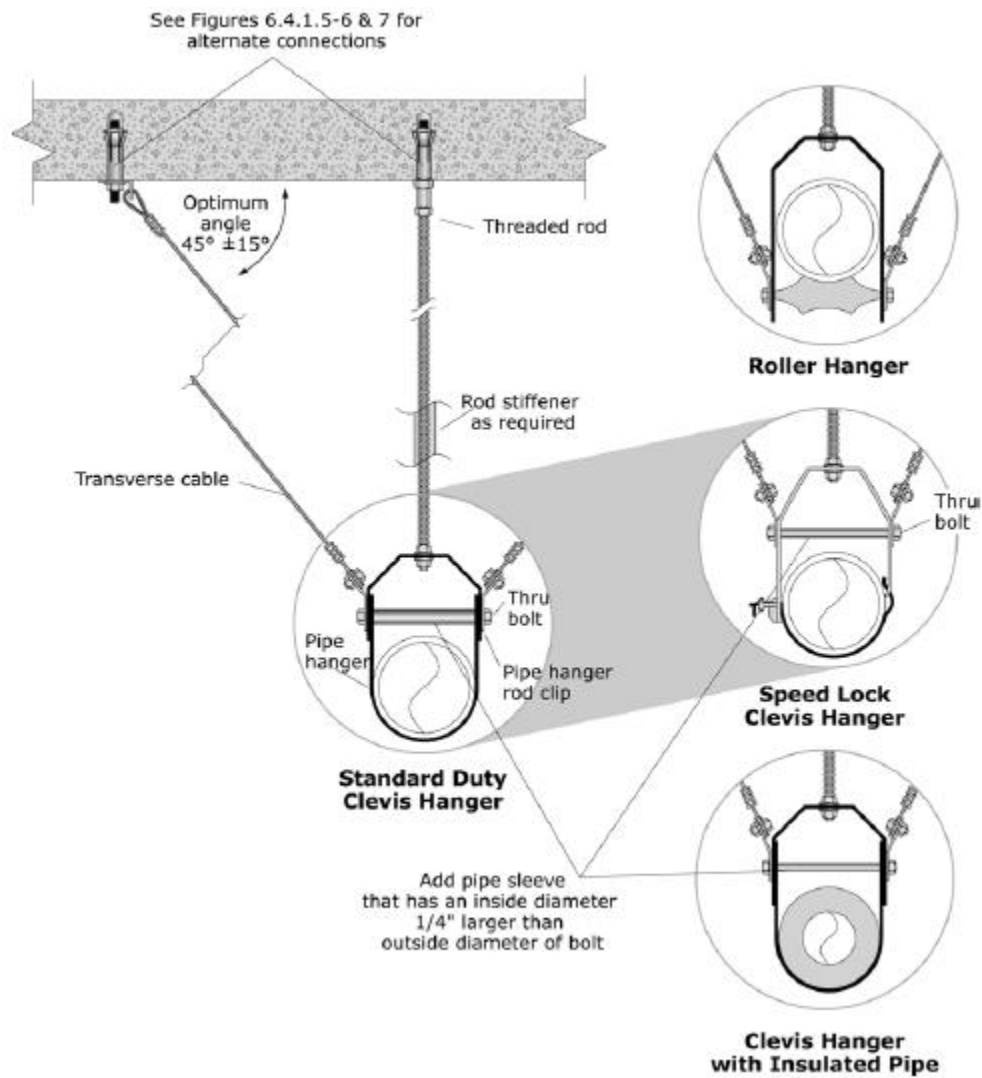


Figure G-37. Cable Bracing – Single Pipe Transverse.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

Electrical and Communications

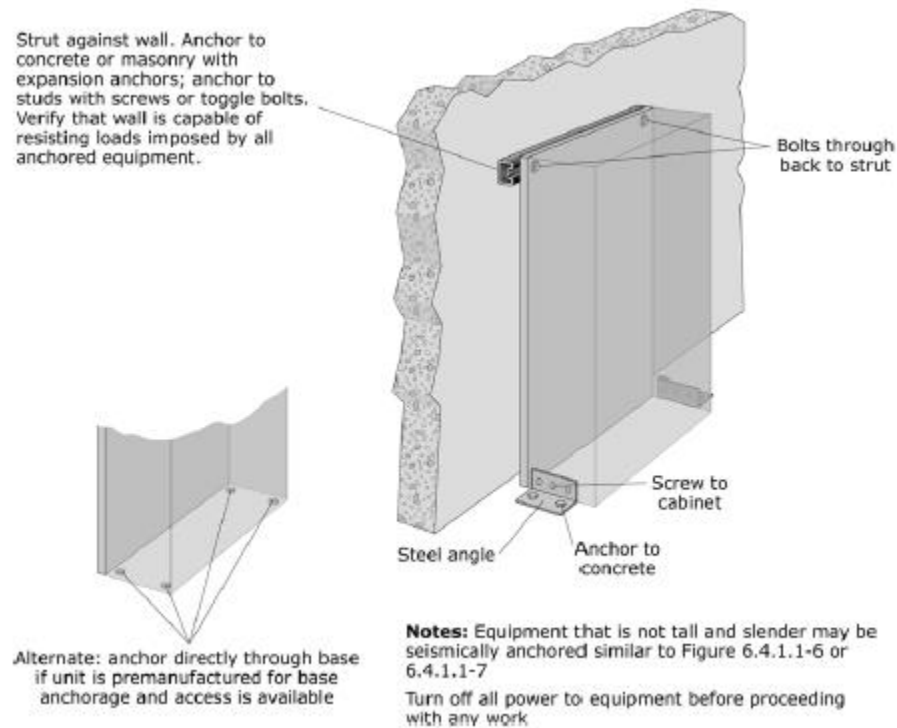


Figure G-38. Electrical Control Panels, Motor Controls Centers, or Switchgear.
(FEMA E-74, 2012, *Reducing the Risks of Nonstructural Earthquake Damage*)

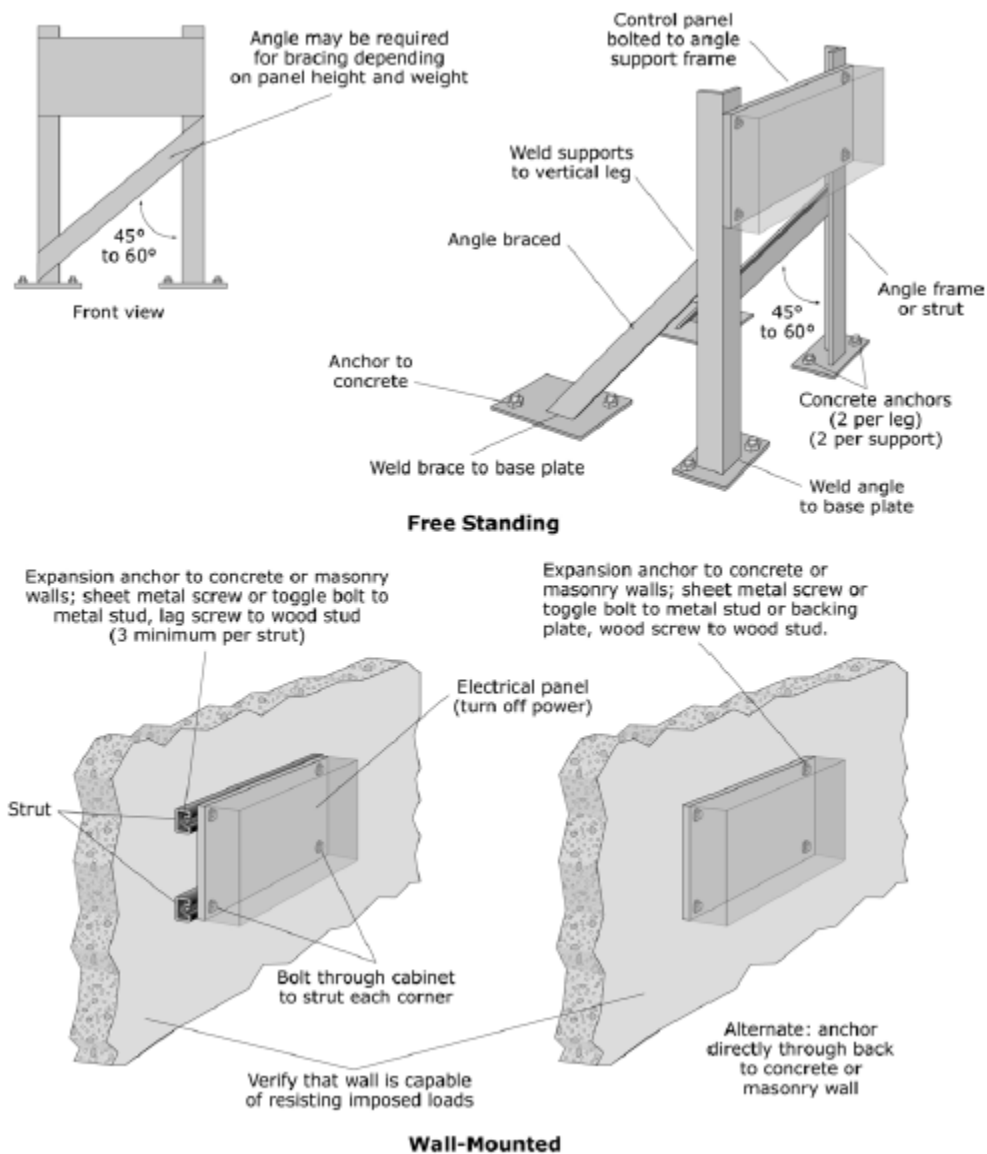


Figure G-39. Freestanding and Wall-mounted Electrical Control Panels, Motor Controls Centers, or Switchgear.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

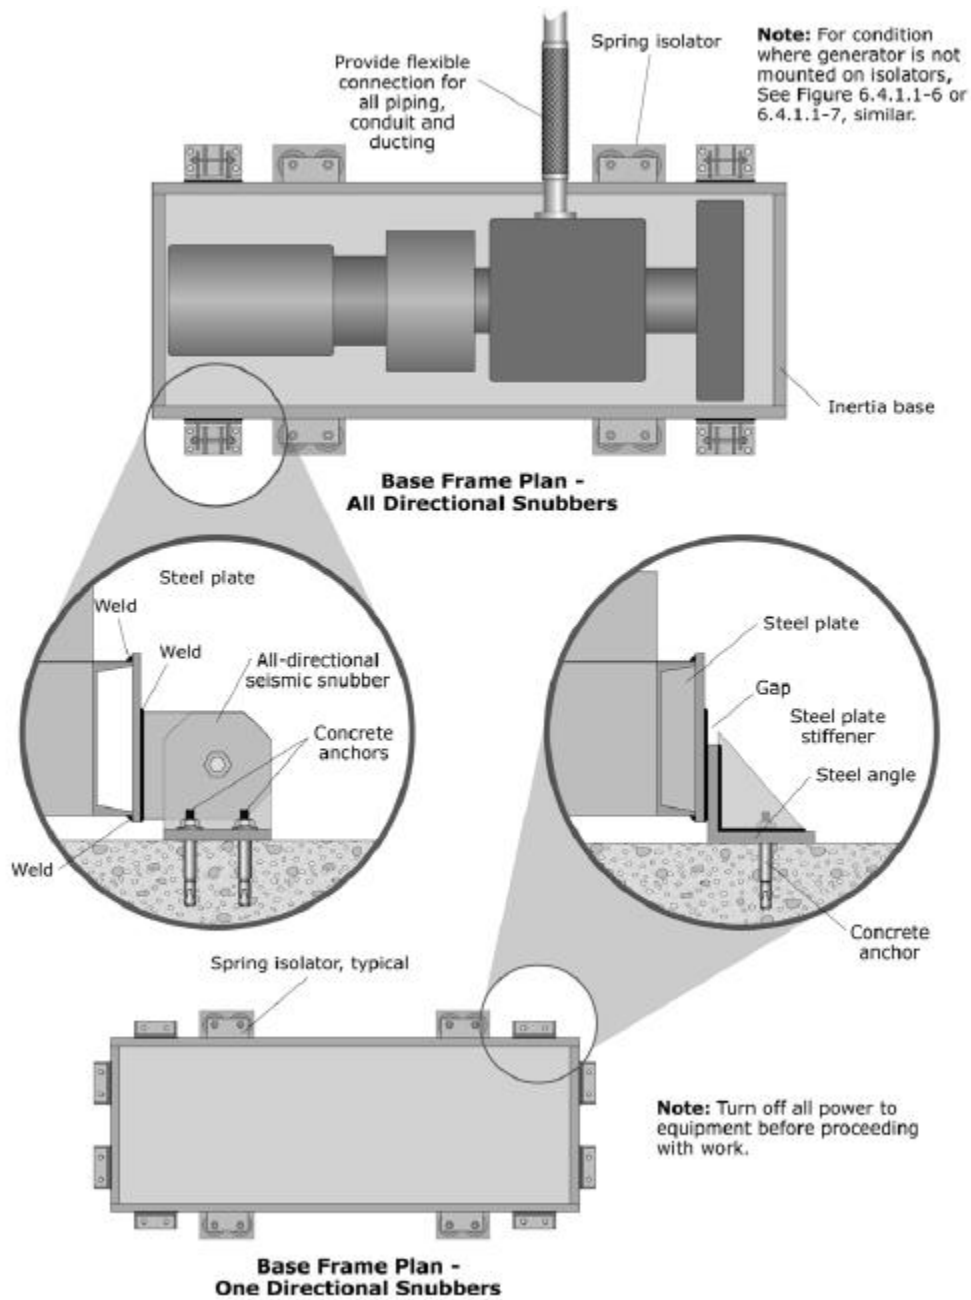


Figure G-40. Emergency Generator.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)